

FORM
6Rev
12/05

State of Colorado

Oil and Gas Conservation Commission

1120 Lincoln Street, Suite 801, Denver, Colorado 80203 Phone: (303) 894-2100 Fax: (303) 894-2109



DE ET OE ES

Document Number:

400276837

Date Received:

WELL ABANDONMENT REPORT

This form is to be submitted as an Intent to Abandon whenever an abandonment is planned on a borehole. After the abandonment is complete, this form shall again be submitted as a Subsequent Report of the actual work completed. The approved intent shall be valid for six months after the approval date, after that period, a new intent will be required. Attachments required with the Intent to Abandon are wellbore diagrams of the current configuration and the proposed configuration with plugs set.

A Subsequent Report of Abandonment shall indicate the actual work completed. Attachments required with a Subsequent Report are a wellbore diagram showing plugs that were set and casing remaining in the hole, the job summaries from all plugging contractors used, including wireline and cementing (third party verification) and any logs that may have been run during abandonment.

OGCC Operator Number: 100185

Contact Name: RUTHANN MORSS

Name of Operator: ENCANA OIL & GAS (USA) INC

Phone: (720) 876-5060

Address: 370 17TH ST STE 1700

Fax: (720) 876-6060

City: DENVER State: CO Zip: 80202-

Email: RUTHANN.MORSS@ENCANA.COM

For "Intent" 24 hour notice required,

Name: BROWNING, CHUCK

Tel: (970) 433-4139

COGCC contact:

Email: chuck.browning@state.co.us

API Number 05-077-05080-00

Well Name: HUDSON

Well Number: 1

Location: QtrQtr: SESE Section: 19 Township: 9S Range: 94W Meridian: 6

County: MESA

Federal, Indian or State Lease Number: 35473

Field Name: BUZZARD

Field Number: 9495

☒ Notice of Intent to Abandon☐ Subsequent Report of Abandonment

Only Complete the Following Background Information for Intent to Abandon

Latitude: 39.258580

Longitude: -107.919450

GPS Data:

Date of Measurement: 07/03/2007

PDOP Reading: 1.8

GPS Instrument Operator's Name: DANIEL TAGGART

Reason for Abandonment:

☐ Dry☒ Production for Sub-economic☐ Mechanical Problems☐ OtherCasing to be pulled: ☐ Yes☒ No

Top of Casing Cement:

Fish in Hole: ☐ Yes☒ No

If yes, explain details below

Wellbore has Uncemented Casing leaks:

☐ Yes☒ No

If yes, explain details below

Details:

Current and Previously Abandoned Zones

Formation	Code	Perf. Top	Perf. Bottom	Date	Method of Isolation	Plug Depth

Total: 0 zone(s)

Casing History

Casing Type	Size of Hole	Size of Casing	Weight Per Foot	Setting Depth	Sacks Cement	Cement Bot	Cement Top	Status
SURF	12+3/4	10+3/4	55.5	383	1	383	0	CALC
1ST	7+1/2	5+1/2	15.5	6,350	1	6,350	0	CALC

Plugging Procedure for Intent and Subsequent Report

CIBP #1: Depth 4568 with 2 sacks cmt on top. CIBP #2: Depth _____ with _____ sacks cmt on top.
CIBP #3: Depth _____ with _____ sacks cmt on top. CIBP #4: Depth _____ with _____ sacks cmt on top.
CIBP #5: Depth _____ with _____ sacks cmt on top.

NOTE: Two(2) sacks cement required on all CIBPs.

Set 45 sks cmt from 330 ft. to 230 ft. Plug Type: CASING Plug Tagged: ☐
Set 35 sks cmt from 50 ft. to 0 ft. Plug Type: ANNULUS Plug Tagged: ☐
Set _____ sks cmt from _____ ft. to _____ ft. Plug Type: _____ Plug Tagged: ☐
Set _____ sks cmt from _____ ft. to _____ ft. Plug Type: _____ Plug Tagged: ☐
Set _____ sks cmt from _____ ft. to _____ ft. Plug Type: _____ Plug Tagged: ☐
Perforate and squeeze at 330 ft. with 320 sacks. Leave at least 100 ft. in casing _____ CICR Depth
Perforate and squeeze at _____ ft. with _____ sacks. Leave at least 100 ft. in casing _____ CICR Depth
Perforate and squeeze at _____ ft. with _____ sacks. Leave at least 100 ft. in casing _____ CICR Depth

(Cast Iron Cement Retainer Depth)

Set _____ sacks half in. half out surface casing from _____ ft. to _____ ft. Plug Tagged: ☐

Set _____ sacks at surface

Cut four feet below ground level, weld on plate Above Ground Dry-Hole Marker: ☐ Yes ☒ No

Set _____ sacks in rat hole Set _____ sacks in mouse hole

Additional Plugging Information for Subsequent Report Only

Casing Recovered: _____ ft. of _____ inch casing

Plugging Date: _____

*Wireline Contractor: _____

*Cementing Contractor: _____

Type of Cement and Additives Used: _____

Flowline/Pipeline has been abandoned per Rule 1103 ☐ Yes ☐ No

*ATTACH JOB SUMMARY

Technical Detail/Comments:

Note: Cementing history is not known. Our well files do not have any cement tickets.

This well will be plugged and abandoned using the following procedure:

1. TOOH 175 jts 2 3/8" tubing
2. RIH with gauge ring to 4648'. Set 5 1/2" CIBP @ 4568'. Test casing to 500 psi. Dump bail 2 sacks cement on top of plug.
3. Perf @ 330'. Pump ~320 sacks G neat cement, circulate to surface
4. Spot balanced plug from 330' - 230' with ~45 sacks cement
5. Top off cement inside casing and annulus from 50' to surface with ~35 sacks cement.
6. Cut off wellhead 4' below ground level.
7. Weld on dry hole marker with 1/4" weep hole.
8. Weld on spec plate, back fill hole and release equipment.

I hereby certify all statements made in this form are, to the best of my knowledge, true, correct, and complete.

Signed: _____

Print Name: RUTHANN MORSS

Title: REGULATORY ANALYST

Date: _____

Email: RUTHANN.MORSS@ENCANA.COM

Based on the information provided herein, this Well Abandonment Report (Form 6) complies with COGCC Rules and applicable orders and is hereby approved.

COGCC Approved: _____

Date: _____

CONDITIONS OF APPROVAL, IF ANY: _____

Expiration Date: _____

Attachment Check List

Att Doc Num	Name
400277356	WELLBORE DIAGRAM
400279104	WELLBORE DIAGRAM

Total Attach: 2 Files

General Comments

<u>User Group</u>	<u>Comment</u>	<u>Comment Date</u>

Total: 0 comment(s)