



DE	ET	OE	ES
----	----	----	----

Document Number:  
400299212

Date Received:  
06/25/2012

**WELL ABANDONMENT REPORT**

This form is to be submitted as an Intent to Abandon whenever an abandonment is planned on a borehole. After the abandonment is complete, this form shall again be submitted as a Subsequent Report of the actual work completed. The approved intent shall be valid for six months after the approval date, after that period, a new intent will be required. Attachments required with the Intent to Abandon are wellbore diagrams of the current configuration and the proposed configuration with plugs set.  
 A Subsequent Report of Abandonment shall indicate the actual work completed. Attachments required with a Subsequent Report are a wellbore diagram showing plugs that were set and casing remaining in the hole, the job summaries from all plugging contractors used, including wireline and cementing (third party verification) and any logs that may have been run during abandonment.

OGCC Operator Number: 47120 Contact Name: Cheryl Light  
 Name of Operator: KERR-MCGEE OIL & GAS ONSHORE LP Phone: (720) 929-6461  
 Address: P O BOX 173779 Fax: (720) 929-7461  
 City: DENVER State: CO Zip: 80217- Email: cheryl.light@anadarko.com

**For "Intent" 24 hour notice required,** Name: HICKEY, MIKE Tel: (970) 302-1024  
**COGCC contact:** Email: mike.hickey@state.co.us

API Number 05-123-18735-00 Well Number: 42-3  
 Well Name: CANNON  
 Location: QtrQtr: SENE Section: 3 Township: 2N Range: 66W Meridian: 6  
 County: WELD Federal, Indian or State Lease Number: 59265  
 Field Name: WATTENBERG Field Number: 90750

Notice of Intent to Abandon  Subsequent Report of Abandonment

*Only Complete the Following Background Information for Intent to Abandon*

Latitude: 40.168900 Longitude: -104.756050  
 GPS Data:  
 Date of Measurement: 04/19/2006 PDOP Reading: 2.5 GPS Instrument Operator's Name: Steve Fisher  
 Reason for Abandonment:  Dry  Production for Sub-economic  Mechanical Problems  
 Other \_\_\_\_\_  
 Casing to be pulled:  Yes  No Top of Casing Cement: 6600  
 Fish in Hole:  Yes  No If yes, explain details below  
 Wellbore has Uncemented Casing leaks:  Yes  No If yes, explain details below  
 Details: External casing patch was placed over casing stub. Patch failed during cleanout. RBP left at 7277 with fill to 7210.

**Current and Previously Abandoned Zones**

Formation	Perf. Top	Perf. Btm	Abandoned Date	Method of Isolation	Plug Depth
CODELL	7514	7532			

Total: 1 zone(s)

**Casing History**

Casing Type	Size of Hole	Size of Casing	Weight Per Foot	Setting Depth	Sacks Cement	Cement Bot	Cement Top	Status
SURF	12+1/4	8+5/8	24	760	535	760	0	
1ST	7+7/8	2+7/8	6.5	7,670	225	7,670	6,603	

## Plugging Procedure for Intent and Subsequent Report

CIBP #1: Depth 7110 with 2 sacks cmt on top. CIBP #2: Depth \_\_\_\_\_ with \_\_\_\_\_ sacks cmt on top.  
CIBP #3: Depth \_\_\_\_\_ with \_\_\_\_\_ sacks cmt on top. CIBP #4: Depth \_\_\_\_\_ with \_\_\_\_\_ sacks cmt on top.  
CIBP #5: Depth \_\_\_\_\_ with \_\_\_\_\_ sacks cmt on top.

NOTE: Two(2) sacks cement required on all CIBPs.

Set 15 sks cmt from 6600 ft. to 6500 ft. Plug Type: STUB PLUG Plug Tagged:   
Set 60 sks cmt from 4750 ft. to 4550 ft. Plug Type: OPEN HOLE Plug Tagged:   
Set \_\_\_\_\_ sks cmt from \_\_\_\_\_ ft. to \_\_\_\_\_ ft. Plug Type: \_\_\_\_\_ Plug Tagged:   
Set \_\_\_\_\_ sks cmt from \_\_\_\_\_ ft. to \_\_\_\_\_ ft. Plug Type: \_\_\_\_\_ Plug Tagged:   
Set \_\_\_\_\_ sks cmt from \_\_\_\_\_ ft. to \_\_\_\_\_ ft. Plug Type: \_\_\_\_\_ Plug Tagged:   
Perforate and squeeze at \_\_\_\_\_ ft. with \_\_\_\_\_ sacks. Leave at least 100 ft. in casing \_\_\_\_\_ CICR Depth  
Perforate and squeeze at \_\_\_\_\_ ft. with \_\_\_\_\_ sacks. Leave at least 100 ft. in casing \_\_\_\_\_ CICR Depth  
Perforate and squeeze at \_\_\_\_\_ ft. with \_\_\_\_\_ sacks. Leave at least 100 ft. in casing \_\_\_\_\_ CICR Depth  
(Cast Iron Cement Retainer Depth)  
Set 50 sacks half in. half out surface casing from 840 ft. to 680 ft. Plug Tagged:   
Set 25 sacks at surface  
Cut four feet below ground level, weld on plate Above Ground Dry-Hole Marker:  Yes  No  
Set \_\_\_\_\_ sacks in rat hole Set \_\_\_\_\_ sacks in mouse hole

### Additional Plugging Information for Subsequent Report Only

Casing Recovered: \_\_\_\_\_ ft. of \_\_\_\_\_ inch casing Plugging Date: \_\_\_\_\_  
\*Wireline Contractor: \_\_\_\_\_ \*Cementing Contractor: \_\_\_\_\_  
Type of Cement and Additives Used: \_\_\_\_\_  
Flowline/Pipeline has been abandoned per Rule 1103  Yes  No \*ATTACH JOB SUMMARY

Technical Detail/Comments:

I hereby certify all statements made in this form are, to the best of my knowledge, true, correct, and complete.

Signed: \_\_\_\_\_ Print Name: Cheryl Light  
Title: Sr. Regulatory Analyst Date: 6/25/2012 Email: DJRegulatory@anadarko.com

Based on the information provided herein, this Well Abandonment Report (Form 6) complies with COGCC Rules and applicable orders and is hereby approved.

COGCC Approved: \_\_\_\_\_ Date: 7/3/2012

**CONDITIONS OF APPROVAL, IF ANY:** \_\_\_\_\_

Expiration Date: 1/2/2013

- 1) Provide 48 hour notice of MIRU to Mike Hickey at (970) 302-1024.
- 2) Provide an "As Plugged" wellbore diagram identifying the specific plugging completed.
- 3) Cut and pull casing above the top of cement. Cement plug across casing stub from 6600' to 6500' assumes that the casing is cut off at 6550'. Adjust depths for this plug, as necessary, depending on the actual depth of the casing stub. However, note that the stub plug must be set above the Niobrara top. Set the base of the stub plug at a depth of 6500' or above.
- 4) Leave at least 100' of cement in the hole for each plug.
- 5) For the surface casing shoe plug, if not circulated to surface, tag plug and it must be at least 710' or higher.
- 6) If unable to pull casing contact COGCC for plugging modifications.
- 7) Any cement volumes provided in the Plugging Procedures shall be considered approximate and are for informational purposes only. Actual plugs shall be set to cover the full extent of the depths identified and cement volumes shall be adjusted accordingly to provide this required coverage.
- 8) Properly abandon flowlines as per Rule 1103.
- 9) Operator must tag plugs upon verbal request by the COGCC engineer or COGCC field inspector.
- 10) Prior to or in conjunction with the submittal of the Form 6 Subsequent Report of Abandonment, all well production records shall be brought up to date. This includes any periods that the well was shut in or temporary abandoned, as production must be reported from spud to plug even if the well's production is zero.
- 11) See plugging changes above.

### **Attachment Check List**

Att Doc Num	Name
400299212	FORM 6 INTENT SUBMITTED
400299216	WELLBORE DIAGRAM
400299217	WELLBORE DIAGRAM
400299219	PROPOSED PLUGGING PROCEDURE

Total Attach: 4 Files

### **General Comments**

<b><u>User Group</u></b>	<b><u>Comment</u></b>	<b><u>Comment Date</u></b>
Permit	Well Completion dated 1/30/1995.	6/28/2012 8:50:23 AM

Total: 1 comment(s)