

FORM
6
Rev
12/05

State of Colorado
Oil and Gas Conservation Commission

1120 Lincoln Street, Suite 801, Denver, Colorado 80203 Phone: (303) 894-2100 Fax: (303) 894-2109



DE	ET	OE	ES
----	----	----	----

Document Number:

400361145

Date Received:

WELL ABANDONMENT REPORT

This form is to be submitted as an Intent to Abandon whenever an abandonment is planned on a borehole. After the abandonment is complete, this form shall again be submitted as a Subsequent Report of the actual work completed. The approved intent shall be valid for six months after the approval date, after that period, a new intent will be required. Attachments required with the Intent to Abandon are wellbore diagrams of the current configuration and the proposed configuration with plugs set.

A Subsequent Report of Abandonment shall indicate the actual work completed. Attachments required with a Subsequent Report are a wellbore diagram showing plugs that were set and casing remaining in the hole, the job summaries from all plugging contractors used, including wireline and cementing (third party verification) and any logs that may have been run during abandonment.

OGCC Operator Number: 47120 Contact Name: CHERYL LIGHT
 Name of Operator: KERR-MCGEE OIL & GAS ONSHORE LP Phone: (720) 929-6461
 Address: P O BOX 173779 Fax: (720) 929-7461
 City: DENVER State: CO Zip: 80217- Email: CHERYL.LIGHT@ANADARKO.COM

For "Intent" 24 hour notice required, Name: PRECUP, JIM Tel: (303) 726-3822
COGCC contact: Email: james.precup@state.co.us

API Number 05-123-08463-00 Well Number: 1
 Well Name: GORDON P. WEICHEL
 Location: QtrQtr: SWNE Section: 14 Township: 2N Range: 65W Meridian: 6
 County: WELD Federal, Indian or State Lease Number: _____
 Field Name: WATTENBERG Field Number: 90750

Notice of Intent to Abandon Subsequent Report of Abandonment

Only Complete the Following Background Information for Intent to Abandon

Latitude: 40.141250 Longitude: -104.627450
 GPS Data:
 Date of Measurement: 02/27/2007 PDOP Reading: 2.4 GPS Instrument Operator's Name: Steve Fisher
 Reason for Abandonment: Dry Production for Sub-economic Mechanical Problems
 Other _____
 Casing to be pulled: Yes No Estimated Depth: _____
 Fish in Hole: Yes No If yes, explain details below
 Wellbore has Uncemented Casing leaks: Yes No If yes, explain details below

Details: Collapsed tubing left downhole as a fish @ 7115', could not be retrieved (7/25/2011). On 10/22/2012 CICR was set @ 7030' and 10/23/2012 60 sx of class "G" neat cement was pumped through CICR with 1 bbl left on top. CBL ran on 10/23/2012 to confirm cement coverage from 570'-210'.

Current and Previously Abandoned Zones

Formation	Code	Perf. Top	Perf. Bottom	Date	Method of Isolation	Plug Depth
CODELL	CODL	7112	7128	10/23/2012	RETAINER/SQUEEZED	7030
J SAND	JSND	7571	7633	10/23/2012	RETAINER/SQUEEZED	7030

Total: 2 zone(s)

Casing History

Casing Type	Size of Hole	Size of Casing	Weight Per Foot	Setting Depth	Sacks Cement	Cement Bot	Cement Top	Status
SURF	12+1/4	8+5/8	28	245	200	245	0	
1ST	7+7/8	5+1/2	15.5	7,571	250	7,571	6,350	CBL
S.C. 1.1	7+7/8	5+1/2	15.5	7,571	200	570	210	CBL

Plugging Procedure for Intent and Subsequent Report

CIBP #1: Depth 550 with 65 sacks cmt on top. CIBP #2: Depth _____ with _____ sacks cmt on top.
 CIBP #3: Depth _____ with _____ sacks cmt on top. CIBP #4: Depth _____ with _____ sacks cmt on top.
 CIBP #5: Depth _____ with _____ sacks cmt on top.

NOTE: Two(2) sacks cement required on all CIBPs.

Set 55 sks cmt from 6990 ft. to 6422 ft. Plug Type: CASING Plug Tagged:
 Set _____ sks cmt from _____ ft. to _____ ft. Plug Type: _____ Plug Tagged:
 Set _____ sks cmt from _____ ft. to _____ ft. Plug Type: _____ Plug Tagged:
 Set _____ sks cmt from _____ ft. to _____ ft. Plug Type: _____ Plug Tagged:
 Set _____ sks cmt from _____ ft. to _____ ft. Plug Type: _____ Plug Tagged:

Perforate and squeeze at 7112 ft. with 60 sacks. Leave at least 100 ft. in casing 7030 CICR Depth
 Perforate and squeeze at _____ ft. with 725 sacks. Leave at least 100 ft. in casing 4110 CICR Depth
 Perforate and squeeze at _____ ft. with _____ sacks. Leave at least 100 ft. in casing _____ CICR Depth
 (Cast Iron Cement Retainer Depth)

Set _____ sacks half in. half out surface casing from _____ ft. to _____ ft. Plug Tagged:

Set _____ sacks at surface

Cut four feet below ground level, weld on plate Above Ground Dry-Hole Marker: Yes No

Set _____ sacks in rat hole Set _____ sacks in mouse hole

Additional Plugging Information for Subsequent Report Only

Casing Recovered: _____ ft. of _____ inch casing Plugging Date: _____

*Wireline Contractor: _____ *Cementing Contractor: _____

Type of Cement and Additives Used: _____

Flowline/Pipeline has been abandoned per Rule 1103 Yes No *ATTACH JOB SUMMARY

Technical Detail/Comments:

I hereby certify all statements made in this form are, to the best of my knowledge, true, correct, and complete.

Signed: _____ Print Name: CHERYL LIGHT
 Title: SR. REGULATORY ANALYST Date: _____ Email: DJREGULATORY@ANADARKO.COM

Based on the information provided herein, this Well Abandonment Report (Form 6) complies with COGCC Rules and applicable orders and is hereby approved.

COGCC Approved: _____ Date: _____

CONDITIONS OF APPROVAL, IF ANY: _____ Expiration Date: _____

Attachment Check List

Att Doc Num	Name
400361159	WELLBORE DIAGRAM
400361160	WELLBORE DIAGRAM
400361161	PROPOSED PLUGGING PROCEDURE

Total Attach: 3 Files

General Comments

<u>User Group</u>	<u>Comment</u>	<u>Comment Date</u>

Total: 0 comment(s)