

FORM

6

Rev  
12/05

## State of Colorado

## Oil and Gas Conservation Commission

1120 Lincoln Street, Suite 801, Denver, Colorado 80203 Phone: (303) 894-2100 Fax: (303) 894-2109



DE ET OE ES

Document Number:

400386228

Date Received:

## WELL ABANDONMENT REPORT

This form is to be submitted as an Intent to Abandon whenever an abandonment is planned on a borehole. After the abandonment is complete, this form shall again be submitted as a Subsequent Report of the actual work completed. The approved intent shall be valid for six months after the approval date, after that period, a new intent will be required. Attachments required with the Intent to Abandon are wellbore diagrams of the current configuration and the proposed configuration with plugs set.

A Subsequent Report of Abandonment shall indicate the actual work completed. Attachments required with a Subsequent Report are a wellbore diagram showing plugs that were set and casing remaining in the hole, the job summaries from all plugging contractors used, including wireline and cementing (third party verification) and any logs that may have been run during abandonment.

OGCC Operator Number: 10110

Contact Name: Tom Rand

Name of Operator: GREAT WESTERN OIL &amp; GAS COMPANY LLC

Phone: (970) 686-8831

Address: 1700 BROADWAY SUITE 650

Fax: (866) 742-1784

City: DENVER State: CO Zip: 80290

Email: trand@gwogco.com

For "Intent" 24 hour notice required,

Name: PRECUP, JIM

Tel: (303) 726-3822

COGCC contact:

Email: james.precup@state.co.us

API Number 05-001-06176-00

Well Name: HOSMER

Well Number: 1

Location: QtrQtr: NENE Section: 34 Township: 1S Range: 64W Meridian: 6

County: ADAMS

Federal, Indian or State Lease Number:

Field Name: JAMBOREE

Field Number: 40590

☒ Notice of Intent to Abandon☐ Subsequent Report of Abandonment

## Only Complete the Following Background Information for Intent to Abandon

Latitude: 39.925264

Longitude: -104.529394

GPS Data:

Date of Measurement: 04/03/2010

PDOP Reading: 2.0

GPS Instrument Operator's Name: Kristi McRedmond

Reason for Abandonment:

☐ Dry☐ Production for Sub-economic☒ Mechanical Problems☐ OtherCasing to be pulled: ☐ Yes☒ No

Estimated Depth:

Fish in Hole: ☒ Yes☐ No

If yes, explain details below

Wellbore has Uncemented Casing leaks:

☐ Yes☒ No

If yes, explain details below

Details: Parted casing @ 1365'. Stuck packer @ 1391'.

## Current and Previously Abandoned Zones

Formation	Code	Perf. Top	Perf. Bottom	Date	Method of Isolation	Plug Depth
D SAND	DSND	7774	7778			

Total: 1 zone(s)

## Casing History

Casing Type	Size of Hole	Size of Casing	Weight Per Foot	Setting Depth	Sacks Cement	Cement Bot	Cement Top	Status
SURF	12+1/4	8+5/8	24 lbs	171	150	150	0	VISU
1ST	7+7/8	4+1/4	11.6 lbs	7,932	250	7,932	6,630	CALC

## Plugging Procedure for Intent and Subsequent Report

CIBP #1: Depth \_\_\_\_\_ with \_\_\_\_\_ sacks cmt on top. CIBP #2: Depth \_\_\_\_\_ with \_\_\_\_\_ sacks cmt on top.  
CIBP #3: Depth \_\_\_\_\_ with \_\_\_\_\_ sacks cmt on top. CIBP #4: Depth \_\_\_\_\_ with \_\_\_\_\_ sacks cmt on top.  
CIBP #5: Depth \_\_\_\_\_ with \_\_\_\_\_ sacks cmt on top.

NOTE: Two(2) sacks cement required on all CIBPs.

Set \_\_\_\_\_ sks cmt from \_\_\_\_\_ ft. to \_\_\_\_\_ ft. Plug Type: \_\_\_\_\_ Plug Tagged: ☐  
Set \_\_\_\_\_ sks cmt from \_\_\_\_\_ ft. to \_\_\_\_\_ ft. Plug Type: \_\_\_\_\_ Plug Tagged: ☐  
Set \_\_\_\_\_ sks cmt from \_\_\_\_\_ ft. to \_\_\_\_\_ ft. Plug Type: \_\_\_\_\_ Plug Tagged: ☐  
Set \_\_\_\_\_ sks cmt from \_\_\_\_\_ ft. to \_\_\_\_\_ ft. Plug Type: \_\_\_\_\_ Plug Tagged: ☐  
Set \_\_\_\_\_ sks cmt from \_\_\_\_\_ ft. to \_\_\_\_\_ ft. Plug Type: \_\_\_\_\_ Plug Tagged: ☐

Perforate and squeeze at 1245 ft. with 288 sacks. Leave at least 100 ft. in casing \_\_\_\_\_ CICR Depth  
Perforate and squeeze at \_\_\_\_\_ ft. with \_\_\_\_\_ sacks. Leave at least 100 ft. in casing \_\_\_\_\_ CICR Depth  
Perforate and squeeze at \_\_\_\_\_ ft. with \_\_\_\_\_ sacks. Leave at least 100 ft. in casing \_\_\_\_\_ CICR Depth  
(Cast Iron Cement Retainer Depth)

Set 10 sacks half in. half out surface casing from \_\_\_\_\_ ft. to \_\_\_\_\_ ft. Plug Tagged: ☐

Set \_\_\_\_\_ sacks at surface

Cut four feet below ground level, weld on plate Above Ground Dry-Hole Marker: ☐ Yes ☒ No

Set 0 sacks in rat hole Set 0 sacks in mouse hole

### Additional Plugging Information for Subsequent Report Only

Casing Recovered: \_\_\_\_\_ ft. of \_\_\_\_\_ inch casing

Plugging Date: \_\_\_\_\_

\*Wireline Contractor: \_\_\_\_\_

\*Cementing Contractor: \_\_\_\_\_

Type of Cement and Additives Used: \_\_\_\_\_

Flowline/Pipeline has been abandoned per Rule 1103 ☐ Yes ☐ No

\*ATTACH JOB SUMMARY

Technical Detail/Comments:

No cement bond available for this well.

I hereby certify all statements made in this form are, to the best of my knowledge, true, correct, and complete.

Signed: 

Print Name: Tom Rand

Title: VP Operations

Date: 3/1/13

Email: trand@gwogco.com

Based on the information provided herein, this Well Abandonment Report (Form 6) complies with COGCC Rules and applicable orders and is hereby approved.

COGCC Approved: \_\_\_\_\_

Date: \_\_\_\_\_

CONDITIONS OF APPROVAL, IF ANY: \_\_\_\_\_

Expiration Date: \_\_\_\_\_

### Attachment Check List

Att Doc Num	Name
400387096	WELLBORE DIAGRAM
400387098	WELLBORE DIAGRAM

Total Attach: 2 Files

**General Comments**

**User Group**

**Comment**

**Comment Date**

--	--	--

Total: 0 comment(s)