

General Comments

<u>User Group</u>	<u>Comment</u>	<u>Comment Date</u>

Total:

Plugging procedure and wellbore diagram as follows:

1. MIRU
2. POOH w/ 2-3/8" tubing to 7,400'
3. Set 200' balance plug @ 7,200' (20 sx). Tag plug.
4. POOH w/ 2-3/8" tubing.
5. Freepoint casing.
6. MIRU wireline.
7. Back off casing above 3,600'
8. POOH w/ 4-1/2" casing
9. RIH w/ 2-3/8" tubing to 200'.
10. Set 100' balance plug @ 200' (40 sx). Tag plug.
11. POOH w/ 2-3/8" tubing.
12. Set 10 sx @ surface.
13. ND BOP
14. Cut off WH.
15. Add cement to annulus if necessary.
16. Weld on Information Plate
17. RDMO