



DE ET OE ES

Document Number:
400442080

Date Received:

WELL ABANDONMENT REPORT

This form is to be submitted as an Intent to Abandon whenever an abandonment is planned on a borehole. After the abandonment is complete, this form shall again be submitted as a Subsequent Report of the actual work completed. The approved intent shall be valid for six months after the approval date, after that period, a new intent will be required. Attachments required with the Intent to Abandon are wellbore diagrams of the current configuration and the proposed configuration with plugs set.
 A Subsequent Report of Abandonment shall indicate the actual work completed. Attachments required with a Subsequent Report are a wellbore diagram showing plugs that were set and casing remaining in the hole, the job summaries from all plugging contractors used, including wireline and cementing (third party verification) and any logs that may have been run during abandonment.

OGCC Operator Number: 69175 Contact Name: Jenifer Hakkarinen
 Name of Operator: PDC ENERGY INC Phone: (303) 8605800
 Address: 1775 SHERMAN STREET - STE 3000 Fax: (303) 8605838
 City: DENVER State: CO Zip: 80203 Email: Jenifer.Hakkarinen@pdce.com
For "Intent" 24 hour notice required, Name: HICKEY, MIKE Tel: (970) 302-1024
COGCC contact: Email: mike.hickey@state.co.us

API Number 05-123-17221-00 Well Name: WARNER Well Number: W 14-1
 Location: QtrQtr: NENE Section: 14 Township: 2N Range: 66W Meridian: 6
 County: WELD Federal, Indian or State Lease Number: _____
 Field Name: WATTENBERG Field Number: 90750

Notice of Intent to Abandon Subsequent Report of Abandonment

Only Complete the Following Background Information for Intent to Abandon

Latitude: 40.144203 Longitude: -104.737445
 GPS Data:
 Date of Measurement: 06/24/2010 PDOP Reading: 3.2 GPS Instrument Operator's Name: Shantell Kling
 Reason for Abandonment: Dry Production for Sub-economic Mechanical Problems
 Other _____
 Casing to be pulled: Yes No Estimated Depth: 6710
 Fish in Hole: Yes No If yes, explain details below
 Wellbore has Uncemented Casing leaks: Yes No If yes, explain details below
 Details: _____

Current and Previously Abandoned Zones

Formation	Code	Perf. Top	Perf. Bottom	Date	Method of Isolation	Plug Depth
CODELL	CODL	7506	7520			

Total: 1 zone(s)

Casing History

Casing Type	Size of Hole	Size of Casing	Weight Per Foot	Setting Depth	Sacks Cement	Cement Bot	Cement Top	Status
SURF	12+1/4	8+5/8	24	887	640	887	0	
1ST	7+7/8	2+7/8	8.7	7,673	225	7,673	0	

Plugging Procedure for Intent and Subsequent Report

CIBP #1: Depth 7450 with 2 sacks cmt on top. CIBP #2: Depth _____ with _____ sacks cmt on top.
 CIBP #3: Depth _____ with _____ sacks cmt on top. CIBP #4: Depth _____ with _____ sacks cmt on top.
 CIBP #5: Depth _____ with _____ sacks cmt on top.

NOTE: Two(2) sacks cement required on all CIBPs.

Set 50 sks cmt from 6710 ft. to 6660 ft. Plug Type: STUB PLUG Plug Tagged:
 Set 200 sks cmt from 4200 ft. to 4700 ft. Plug Type: OPEN HOLE Plug Tagged:
 Set _____ sks cmt from _____ ft. to _____ ft. Plug Type: _____ Plug Tagged:
 Set _____ sks cmt from _____ ft. to _____ ft. Plug Type: _____ Plug Tagged:
 Set _____ sks cmt from _____ ft. to _____ ft. Plug Type: _____ Plug Tagged:
 Perforate and squeeze at _____ ft. with _____ sacks. Leave at least 100 ft. in casing _____ CICR Depth
 Perforate and squeeze at _____ ft. with _____ sacks. Leave at least 100 ft. in casing _____ CICR Depth
 Perforate and squeeze at _____ ft. with _____ sacks. Leave at least 100 ft. in casing _____ CICR Depth
(Cast Iron Cement Retainer Depth)
 Set 100 sacks half in. half out surface casing from 837 ft. to 937 ft. Plug Tagged:
 Set 10 sacks at surface
 Cut four feet below ground level, weld on plate Above Ground Dry-Hole Marker: Yes No
 Set _____ sacks in rat hole Set _____ sacks in mouse hole

Additional Plugging Information for Subsequent Report Only

Casing Recovered: _____ ft. of _____ inch casing Plugging Date: _____
 *Wireline Contractor: _____ *Cementing Contractor: _____
 Type of Cement and Additives Used: _____
 Flowline/Pipeline has been abandoned per Rule 1103 Yes No *ATTACH JOB SUMMARY

Technical Detail/Comments:

Plugging Procedure
 Codell
 Existing Perforations:
 Codell: 7506'-7520'
 PBD: 7573'
 8 5/8" 24# Casing set @ 887' cemented w/ 640 sx
 2 7/8" 8.7# Casing set @ 7673' cemented w/ 225 sx
 Procedure:
 1)MIRU wireline
 2)RIH w/CIBP set @ 7450'
 3)RIH w/dump bailer and dump 2 sx cement on top of CIBP
 4)RIH w/casing cutter, cut & pull casing @ ~6710'
 5)TIH set 50 sack plug @ casing stub (6710')
 6)TIH to tag stub plug
 7)TOH to set 200 sack plug @ Parkman/Sussex (~4200'--4700')
 8)TOH and set 100 sack cement plug half in half out of surface casing from 837'-937'
 9)Set 10 sx @ top of surface
 10)Cut casing and weld on cap

I hereby certify all statements made in this form are, to the best of my knowledge, true, correct, and complete.

Signed: _____ Print Name: Jenifer Hakkarinen
 Title: Regulatory Tech Date: _____ Email: Jenifer.Hakkarien@pdce.com

Based on the information provided herein, this Well Abandonment Report (Form 6) complies with COGCC Rules and applicable orders and is hereby approved.

COGCC Approved: _____

Date: _____

CONDITIONS OF APPROVAL, IF ANY: _____

Expiration Date: _____

--

Attachment Check List

Att Doc Num	Name
400442084	WELLBORE DIAGRAM
400442085	WELLBORE DIAGRAM

Total Attach: 2 Files

General Comments

<u>User Group</u>	<u>Comment</u>	<u>Comment Date</u>

Total: 0 comment(s)