



DE ET OE ES

Document Number:
400438227

Date Received:
06/24/2013

WELL ABANDONMENT REPORT

This form is to be submitted as an Intent to Abandon whenever an abandonment is planned on a borehole. After the abandonment is complete, this form shall again be submitted as a Subsequent Report of the actual work completed. The approved intent shall be valid for six months after the approval date, after that period, a new intent will be required. Attachments required with the Intent to Abandon are wellbore diagrams of the current configuration and the proposed configuration with plugs set.
 A Subsequent Report of Abandonment shall indicate the actual work completed. Attachments required with a Subsequent Report are a wellbore diagram showing plugs that were set and casing remaining in the hole, the job summaries from all plugging contractors used, including wireline and cementing (third party verification) and any logs that may have been run during abandonment.

OGCC Operator Number: 47120 Contact Name: CHERYL LIGHT
 Name of Operator: KERR-MCGEE OIL & GAS ONSHORE LP Phone: (720) 929-6461
 Address: P O BOX 173779 Fax: (720) 929-7461
 City: DENVER State: CO Zip: 80217- Email: CHERYL.LIGHT@ANADARKO.COM
For "Intent" 24 hour notice required, Name: HICKEY, MIKE Tel: (970) 302-1024
COGCC contact: Email: mike.hickey@state.co.us

API Number 05-123-09158-00 Well Number: 1
 Well Name: UPRR 43 PAN AM GAS UNIT J
 Location: QtrQtr: SWNE Section: 19 Township: 1N Range: 67W Meridian: 6
 County: WELD Federal, Indian or State Lease Number: _____
 Field Name: WATTENBERG Field Number: 90750

Notice of Intent to Abandon Subsequent Report of Abandonment

Only Complete the Following Background Information for Intent to Abandon

Latitude: 40.039363 Longitude: -104.928720
 GPS Data:
 Date of Measurement: 05/03/2006 PDOP Reading: 3.3 GPS Instrument Operator's Name: Steve Fisher
 Reason for Abandonment: Dry Production for Sub-economic Mechanical Problems
 Other _____
 Casing to be pulled: Yes No Estimated Depth: 1542
 Fish in Hole: Yes No If yes, explain details below
 Wellbore has Uncemented Casing leaks: Yes No If yes, explain details below
 Details: _____

Current and Previously Abandoned Zones

Formation	Perf. Top	Perf. Btm	Abandoned Date	Method of Isolation	Plug Depth
CODELL	7873	7883			
J SAND	8326	8344			
Total: 2 zone(s)					

Casing History

Casing Type	Size of Hole	Size of Casing	Weight Per Foot	Setting Depth	Sacks Cement	Cement Bot	Cement Top	Status
SURF	12+1/4	8+5/8	24	856	675	856	0	CALC
1ST	7+7/8	4+1/2	11.6&10.5	8,440	200	8,440	7,328	CALC

Plugging Procedure for Intent and Subsequent Report

CIBP #1: Depth 8250 with 2 sacks cmt on top. CIBP #2: Depth 7800 with 2 sacks cmt on top.
CIBP #3: Depth 100 with 2 sacks cmt on top. CIBP #4: Depth _____ with _____ sacks cmt on top.
CIBP #5: Depth _____ with _____ sacks cmt on top.

NOTE: Two(2) sacks cement required on all CIBPs.

Set _____ sks cmt from _____ ft. to _____ ft. Plug Type: _____ Plug Tagged:
Set _____ sks cmt from _____ ft. to _____ ft. Plug Type: _____ Plug Tagged:
Set _____ sks cmt from _____ ft. to _____ ft. Plug Type: _____ Plug Tagged:
Set _____ sks cmt from _____ ft. to _____ ft. Plug Type: _____ Plug Tagged:
Set _____ sks cmt from _____ ft. to _____ ft. Plug Type: _____ Plug Tagged:

Perforate and squeeze at 7300 ft. with 100 sacks. Leave at least 100 ft. in casing 7100 CICR Depth
Perforate and squeeze at 5547 ft. with 650 sacks. Leave at least 100 ft. in casing 4725 CICR Depth
Perforate and squeeze at _____ ft. with _____ sacks. Leave at least 100 ft. in casing _____ CICR Depth

(Cast Iron Cement Retainer Depth)

Set 510 sacks half in. half out surface casing from 1642 ft. to 656 ft. Plug Tagged:

Set 30 sacks at surface

Cut four feet below ground level, weld on plate Above Ground Dry-Hole Marker: Yes No

Set _____ sacks in rat hole Set _____ sacks in mouse hole

Additional Plugging Information for Subsequent Report Only

Casing Recovered: _____ ft. of _____ inch casing Plugging Date: _____

*Wireline Contractor: _____ *Cementing Contractor: _____

Type of Cement and Additives Used: _____

Flowline/Pipeline has been abandoned per Rule 1103 Yes No *ATTACH JOB SUMMARY

Technical Detail/Comments:

Perforate and squeeze at 7300' & 7075' ft. with 100 sacks Leave at least 100 ft. in casing 7100 CICR Depth
Perforate and squeeze at 5547' & 4689' ft. with 650 sacks Leave at least 100 ft. in casing 4725' CICR Depth

I hereby certify all statements made in this form are, to the best of my knowledge, true, correct, and complete.

Signed: _____ Print Name: CHERYL LIGHT

Title: SR. REGULATORY ANALYST Date: 6/24/2013 Email: DJREGULATORY@ANADARKO.COM

Based on the information provided herein, this Well Abandonment Report (Form 6) complies with COGCC Rules and applicable orders and is hereby approved.

COGCC Approved: HOLLINSHEAD, RYAN Date: 7/12/2013

CONDITIONS OF APPROVAL, IF ANY: _____ Expiration Date: 1/11/2014

- 1) Provide 24-hour notice of MIRU to Jim Precup at (303) 726-3822.
- 2) Provide an "As Plugged" wellbore diagram identifying the specific plugging completed.
- 3) If unable to pull casing deeper than 1542', contact COGCC for plugging modifications.
- 4) Properly abandon flowlines as per Rule 1103.
- 5) Operator must tag plugs upon verbal request by the COGCC engineer or COGCC field inspector.

Attachment Check List

Att Doc Num	Name
400438227	FORM 6 INTENT SUBMITTED
400438229	PROPOSED PLUGGING PROCEDURE
400438230	WELLBORE DIAGRAM

Total Attach: 3 Files

General Comments

<u>User Group</u>	<u>Comment</u>	<u>Comment Date</u>
Permit	Well completion report dated 6/3/1977 & 5/7/2001.	6/25/2013 8:30:49 AM

Total: 1 comment(s)