

UPRR 31-14K

- 1 Call foreman or lead operator at least 24 hr prior to rig move. Request that they catch and remove the plunger, isolate production equipment and remove any automation prior to rig showing up. Install perimeter fence as needed.
- 2 GYRO complete JUL13.
- 3 Provide notice of MIRU to COGCC field inspector as specified in approved form 6.
- 4 Notify IOC when rig mobilizes to location to generate workorder for flowline removal and one call for line locates.
- 5 Prepare location for base beam equipped rig
- 6 MIRU, kill as necessary using clean fresh water with biocide. ND WH. NU BOP. Unseat landing jt, LD.
- 7 Notify cementers to be on call. Provide volumes (25 sx G w/ 20% silica flour, 0.4% CD-32, 0.4% ASA-301 and R-3 to achieve 2:30 pump time mixed 15.8 ppg and 1.38 yield(In pipe only), 45 sx class G, 0.4% CD-32, 0.4% ASA-301 15.8ppg 1.15 yield (In pipe only), 160 sx Type III CaCl₂ cement 1.53 yield (10"+20%)).
- 8 TOOH 2.06" production tubing. LD.
- 9 MIRU WL. RIH gauge ring for 3.5" 7.7#/ft csg to 8190'.
- 10 RIH CIBP, set at 8130'. PT CIBP to 1000 psi. PU dump bailer, dump bail 2 sx class G cement on CIBP. RD WL
- 11 TIH with 1.66" 2.1 #/ft J-55 IJ tubing to 7920'+/- hydrotesting tubing in to 3000 psi. Roll hole using water containing biocide. TOOH.
- 12 RU cement services.
- 13 Spot 25 sx G w/ 20% silica flour, 0.4% CD-32, 0.4% ASA-301 and R-3 to achieve 2:30 pump time mixed 15.8 ppg and 1.38 yield from 7920'-7249'.
- 14 PUH 13 stands from 7920'. Circulate 70 BBL water if forward circulating, 15 BBL if reverse circulating to clear tubing. WOC 4 hrs.
- 15 TIH to 7249'+/-' and tag cement top. Note depth, if below 7520', discuss with production engineer.
- 16 Place 9.0 ppg mud containing biocide from tag to 5000'. (~20BBLs).
- 17 Spot 45 sx class G, 0.4% CD-32, 0.4% ASA-301 with 1.15 cuft/sk yield from 5010' to 4080'.

- 18 PUH 18 stands from 5010'. Circulate 40 BBL water containing biocide if forward circulating, 10 BBL if reverse circulating to clear tubing. WOC 4 hrs.
- 19 TIH and tag plug. If below 4080', contact production engineer to discuss.
- 20 Place 9.0 ppg mud containing biocide from tag to 800' (~30BBL).
- 21 P&SB 900' tbg. LD remainder.
- 22 RU WL. Crack coupling or shoot off casing at 900'. RDMO WL. Circulate hole using 80 BBL water containing biocide to remove any gas.
- 23 NDBOP, NDTH.
- 24 NU BOP on casing head, install 3-1/2" pipe rams.
- 25 TOOH with 3-1/2" casing, LD.
- 26 TIH into csg stub using production tubing to 900'.
- 27 Spot 160 SX Type III CaCl₂ cement with 1.53cuft/sk yield.
- 28 PUH to 150'. Circulate 10 BBLs 9.0 ppg mud with biocide.
- 29 TOOH. WOC 4 hrs.
- 30 TIH and tag. If cement is below 338', discuss with production engineer.
- 31 Fill casing with 9.0 ppg drilling mud containing biocide from tag to 100'.
- 32 RU Wireline services. RIH 8-5/8" CIBP to 100'. Set, PT to 1000psi for 15 min. If tests, RDMO WL and WO rig.
- 33 Supervisor submit paper copies of all invoices, logs, and reports to Frantz, Sabrina.
- 34 Excavation crew to notify One Call to clear excavation area around wellhead and for flowlines.
- 35 Place Redi Mix cement on will call if cement top in 8 5/8" is more than 25' below surface.
- 36 Excavate hole around surface casing enough to allow welder to cut 8 5/8" casing minimum 5' below ground level.
- 37 Welder cut 8 5/8" casing minimum 5' below ground level.
- 38 MIRU redimix. Use 4500psi compressive strength cement, (NO gravel) fill stubout.
- 39 Spot weld on steel marker plate. Marker should contain Well name, Well number, legal location (1/4 ¼ descriptor) and API number

- 40 Properly abandon flowlines per Rule 1103.
- 41 Back fill hole with fill. Clean location, level.
- 42 Submit Form 6 to COGCC ensuring to provide “As performed” WBD identifying operations completed.