

**FORM**  
**6**  
Rev  
12/05

**State of Colorado**  
**Oil and Gas Conservation Commission**

1120 Lincoln Street, Suite 801, Denver, Colorado 80203 Phone: (303) 894-2100 Fax: (303) 894-2109



DE	ET	OE	ES
----	----	----	----

Document Number:  
400490169

Date Received:

**WELL ABANDONMENT REPORT**

This form is to be submitted as an Intent to Abandon whenever an abandonment is planned on a borehole. After the abandonment is complete, this form shall again be submitted as a Subsequent Report of the actual work completed. The approved intent shall be valid for six months after the approval date, after that period, a new intent will be required. Attachments required with the Intent to Abandon are wellbore diagrams of the current configuration and the proposed configuration with plugs set.

A Subsequent Report of Abandonment shall indicate the actual work completed. Attachments required with a Subsequent Report are a wellbore diagram showing plugs that were set and casing remaining in the hole, the job summaries from all plugging contractors used, including wireline and cementing (third party verification) and any logs that may have been run during abandonment.

OGCC Operator Number: 47120 Contact Name: CHERYL LIGHT  
 Name of Operator: KERR-MCGEE OIL & GAS ONSHORE LP Phone: (720) 929-6461  
 Address: P O BOX 173779 Fax: (720) 929-7461  
 City: DENVER State: CO Zip: 80217- Email: CHERYL.LIGHT@ANADARKO.COM

**For "Intent" 24 hour notice required,** Name: PRECUP, JIM Tel: (303) 726-3822  
**COGCC contact:** Email: james.precup@state.co.us

API Number 05-123-11149-00 Well Number: 1  
 Well Name: UPRR 42 PAN AM GU AL-TRUE  
 Location: QtrQtr: NWNW Section: 17 Township: 1N Range: 67W Meridian: 6  
 County: WELD Federal, Indian or State Lease Number: \_\_\_\_\_  
 Field Name: WATTENBERG Field Number: 90750

Notice of Intent to Abandon  Subsequent Report of Abandonment

*Only Complete the Following Background Information for Intent to Abandon*

Latitude: 40.055570 Longitude: -104.920490  
 GPS Data:  
 Date of Measurement: 10/18/2006 PDOP Reading: 2.0 GPS Instrument Operator's Name: Chris Fisher  
 Reason for Abandonment:  Dry  Production for Sub-economic  Mechanical Problems  
 Other \_\_\_\_\_  
 Casing to be pulled:  Yes  No Estimated Depth: 1075  
 Fish in Hole:  Yes  No If yes, explain details below  
 Wellbore has Uncemented Casing leaks:  Yes  No If yes, explain details below  
 Details: \_\_\_\_\_

**Current and Previously Abandoned Zones**

Formation	Code	Perf. Top	Perf. Bottom	Date	Method of Isolation	Plug Depth
CODELL	CODL	7754	7774		BRIDGE PLUG	7660
J SAND	JSND	8188	8236		BRIDGE PLUG	8100

Total: 2 zone(s)

**Casing History**

Casing Type	Size of Hole	Size of Casing	Weight Per Foot	Setting Depth	Sacks Cement	Cement Bot	Cement Top	Status
SURF	12+1/4	9+5/8	36	974	475	974	0	
1ST	11+1/2	5+1/2	15.5	8,320	1,240	8,355	4,559	

## Plugging Procedure for Intent and Subsequent Report

CIBP #1: Depth 8100 with 2 sacks cmt on top. CIBP #2: Depth 7660 with 80 sacks cmt on top.  
 CIBP #3: Depth \_\_\_\_\_ with \_\_\_\_\_ sacks cmt on top. CIBP #4: Depth \_\_\_\_\_ with \_\_\_\_\_ sacks cmt on top.  
 CIBP #5: Depth \_\_\_\_\_ with \_\_\_\_\_ sacks cmt on top.

NOTE: Two(2) sacks cement required on all CIBPs.

Set 90 sks cmt from 5300 ft. to 4550 ft. Plug Type: CASING Plug Tagged:   
 Set 115 sks cmt from 1175 ft. to 775 ft. Plug Type: CASING Plug Tagged:   
 Set \_\_\_\_\_ sks cmt from \_\_\_\_\_ ft. to \_\_\_\_\_ ft. Plug Type: \_\_\_\_\_ Plug Tagged:   
 Set \_\_\_\_\_ sks cmt from \_\_\_\_\_ ft. to \_\_\_\_\_ ft. Plug Type: \_\_\_\_\_ Plug Tagged:   
 Set \_\_\_\_\_ sks cmt from \_\_\_\_\_ ft. to \_\_\_\_\_ ft. Plug Type: \_\_\_\_\_ Plug Tagged:

Perforate and squeeze at 4550 ft. with 430 sacks. Leave at least 100 ft. in casing 4490 CICR Depth  
 Perforate and squeeze at \_\_\_\_\_ ft. with \_\_\_\_\_ sacks. Leave at least 100 ft. in casing \_\_\_\_\_ CICR Depth  
 Perforate and squeeze at \_\_\_\_\_ ft. with \_\_\_\_\_ sacks. Leave at least 100 ft. in casing \_\_\_\_\_ CICR Depth  
(Cast Iron Cement Retainer Depth)

Set \_\_\_\_\_ sacks half in. half out surface casing from \_\_\_\_\_ ft. to \_\_\_\_\_ ft. Plug Tagged:   
 Set 27 sacks at surface  
 Cut four feet below ground level, weld on plate Above Ground Dry-Hole Marker:  Yes  No  
 Set \_\_\_\_\_ sacks in rat hole Set \_\_\_\_\_ sacks in mouse hole

### Additional Plugging Information for Subsequent Report Only

Casing Recovered: \_\_\_\_\_ ft. of \_\_\_\_\_ inch casing Plugging Date: \_\_\_\_\_  
 \*Wireline Contractor: \_\_\_\_\_ \*Cementing Contractor: \_\_\_\_\_  
 Type of Cement and Additives Used: \_\_\_\_\_  
 Flowline/Pipeline has been abandoned per Rule 1103  Yes  No \*ATTACH JOB SUMMARY

Technical Detail/Comments:

I hereby certify all statements made in this form are, to the best of my knowledge, true, correct, and complete.

Signed: \_\_\_\_\_ Print Name: CHERYL LIGHT  
 Title: SR. REGULATORY ANALYST Date: \_\_\_\_\_ Email: DJREGULATORY@ANADARKO.COM

Based on the information provided herein, this Well Abandonment Report (Form 6) complies with COGCC Rules and applicable orders and is hereby approved.

COGCC Approved: \_\_\_\_\_ Date: \_\_\_\_\_

**CONDITIONS OF APPROVAL, IF ANY:** \_\_\_\_\_ Expiration Date: \_\_\_\_\_

COA Type	Description

## Attachment Check List

<u>Att Doc Num</u>	<u>Name</u>
400490175	PROPOSED PLUGGING PROCEDURE
400490176	WELLBORE DIAGRAM
400490177	WELLBORE DIAGRAM

Total Attach: 3 Files

## General Comments

<u>User Group</u>	<u>Comment</u>	<u>Comment Date</u>

Total: 0 comment(s)