

## P&A Proposal for Federal 1-34

Maralex Resources, Inc. proposes to plug and abandon the Government Fed 1-34 well located in Sec 34 T9S R98W under the following procedure:

1. Move in rig up service unit (MIRUSU)
2. Install blow out preventer (BOP)
3. Blow well down and unseat tubing
4. Trip out of hole (TOH) with 64 joints 2 3/8" EUE J55 4.7ppf tubing
5. Rig up wireline unit and set cast iron bridge plug at 2020 feet and dump 10sacks cement on top of bridge plug
6. Load hole with water
7. Trip in hole (TIH) with tubing to 300'
8. Set a balanced plug with 12 sacks (100') balanced plug across surface casing shoe from 200' to 300'
9. Trip out of hole (TOH) with tubing and wait on cement
10. Trip in hole (TIH) with one joint of tubing. Set 10 sack plug of regular cement at surface.
11. Cut off casing four feet below surface and weld P&A marker on top