

WORKOVER PROCEDURE

WELL NAME: INTERMILL 01-22 **DATE:** 10/16/2013

LOCATION:
Qtr/Qtr: SWNE Section: 22 Township: 6N Range: 66W

COUNTY: WELD **STATE:** CO **API #:** 05-123-10947

ENGINEER: LEAH PERKINS 7 Day Notice Sent: _____
(Please notify Engineer of any major Do not start operations until: _____
changes prior to work) Notice Expires: _____

OBJECTIVE: P&A

WELL DATA:

Surface Csg:	<u>8 5/8" 24# @ 411'</u>	KB Elevation:	<u>4752</u>
Surface Cmt:	<u>350 sx</u>	GL Elevation:	<u>4740</u>
Long St Csg:	<u>4 1/2" 10.50# @ 7284'</u>	TD:	<u>7295</u>
Long St Cmt:	<u>300 sx</u>	PBTD:	<u>7260</u>
Long St Date:	<u>1/4/1983</u>		

Plug Back (Sand or CIBP): _____
Perforation Interval (1): Niobrara Perfs 6890' - 7094'
Perforation Interval (2): Codell Perfs 7196' - 7212'
Perforation Interval (3): _____
Tubing: 2 3/8" 4.70# J-55 @ 7186' Rods: _____
Pump: _____
Misc.: _____

PRODUCTION STATUS: _____
COMMENTS: _____

- PROCEDURE:**
- 1) MIRU Workover rig, pump & tank.
 - 2) POOH w/ 2 3/8" tbg and lay down.
 - 3) RU WL. RIH w/CIBP. Set CIBP @ 6840', dump bail 2 sx of cement on top.
 - 4) Unland casing. Cut casing off +/- 5000'. POOH with casing laying down on trailer.
 - 5) RIH w/ workstring to pump (100) sx stub plug where csg was pulled. If maintain circulation, do not need to tag plug.
 - 6) Pump 50 sx Courtesy Plug @ 2500'. POOH w/workstring to 520'. Pump approx 200 sx shoe plug. Cement to surface.
 - 7) RIH. Tag shoe plug. Add cement if needed.
 - 8) Cut surface casing off 6'-8' below ground.
 - 9) Clean up location. Reclaim location. RDMO.