

FORM
6

Rev
12/05

State of Colorado
Oil and Gas Conservation Commission

1120 Lincoln Street, Suite 801, Denver, Colorado 80203 Phone: (303) 894-2100 Fax: (303) 894-2109



DE	ET	OE	ES
----	----	----	----

Document Number:

400529480

Date Received:

12/18/2013

WELL ABANDONMENT REPORT

This form is to be submitted as an Intent to Abandon whenever an abandonment is planned on a borehole. After the abandonment is complete, this form shall again be submitted as a Subsequent Report of the actual work completed. The approved intent shall be valid for six months after the approval date, after that period, a new intent will be required. Attachments required with the Intent to Abandon are wellbore diagrams of the current configuration and the proposed configuration with plugs set.

A Subsequent Report of Abandonment shall indicate the actual work completed. Attachments required with a Subsequent Report are a wellbore diagram showing plugs that were set and casing remaining in the hole, the job summaries from all plugging contractors used, including wireline and cementing (third party verification) and any logs that may have been run during abandonment.

OGCC Operator Number: 100322 Contact Name: Seth Gordon
 Name of Operator: NOBLE ENERGY INC Phone: (720) 587-2288
 Address: 1625 BROADWAY STE 2200 Fax: (970) 304-5099
 City: DENVER State: CO Zip: 80202 Email: sgordon@nobleenergyinc.com

For "Intent" 24 hour notice required, Name: MONTOYA, JOHN Tel: (970) 3974124

COGCC contact: Email: john.montoya@state.co.us

API Number 05-123-24791-00 Well Number: 3-6
 Well Name: WASTE MANAGEMENT USX Y
 Location: QtrQtr: SENW Section: 3 Township: 2N Range: 64W Meridian: 6
 County: WELD Federal, Indian or State Lease Number: _____
 Field Name: WATTENBERG Field Number: 90750

Notice of Intent to Abandon Subsequent Report of Abandonment

Only Complete the Following Background Information for Intent to Abandon

Latitude: 40.168920 Longitude: -104.539610

GPS Data:
 Date of Measurement: 07/20/2007 PDOP Reading: 2.6 GPS Instrument Operator's Name: PAUL TAPPY

Reason for Abandonment: Dry Production for Sub-economic Mechanical Problems
 Other _____

Casing to be pulled: Yes No Estimated Depth: 2500

Fish in Hole: Yes No If yes, explain details below

Wellbore has Uncemented Casing leaks: Yes No If yes, explain details below

Details: _____

Current and Previously Abandoned Zones

Formation	Perf. Top	Perf. Btm	Abandoned Date	Method of Isolation	Plug Depth
CODELL	7043	7055			
NIOBRARA	6806	6906			

Total: 2 zone(s)

Casing History

Casing Type	Size of Hole	Size of Casing	Weight Per Foot	Setting Depth	Sacks Cement	Cement Bot	Cement Top	Status
SURF	12+1/4	8+5/8	24	906	434	906	10	VISU
1ST	7+7/8	4+1/2	11.6	7,186	660	7,195	3,502	CBL

Plugging Procedure for Intent and Subsequent Report

CIBP #1: Depth 6756 with 2 sacks cmt on top. CIBP #2: Depth _____ with _____ sacks cmt on top.
CIBP #3: Depth _____ with _____ sacks cmt on top. CIBP #4: Depth _____ with _____ sacks cmt on top.
CIBP #5: Depth _____ with _____ sacks cmt on top.

NOTE: Two(2) sacks cement required on all CIBPs.

Set 100 sks cmt from 2600 ft. to 2400 ft. Plug Type: STUB PLUG Plug Tagged:
Set _____ sks cmt from _____ ft. to _____ ft. Plug Type: _____ Plug Tagged:
Set _____ sks cmt from _____ ft. to _____ ft. Plug Type: _____ Plug Tagged:
Set _____ sks cmt from _____ ft. to _____ ft. Plug Type: _____ Plug Tagged:
Set _____ sks cmt from _____ ft. to _____ ft. Plug Type: _____ Plug Tagged:

Perforate and squeeze at _____ ft. with _____ sacks. Leave at least 100 ft. in casing _____ CICR Depth
Perforate and squeeze at _____ ft. with _____ sacks. Leave at least 100 ft. in casing _____ CICR Depth
Perforate and squeeze at _____ ft. with _____ sacks. Leave at least 100 ft. in casing _____ CICR Depth
(Cast Iron Cement Retainer Depth)

Set 400 sacks half in. half out surface casing from 1006 ft. to 0 ft. Plug Tagged:

Set _____ sacks at surface

Cut four feet below ground level, weld on plate Above Ground Dry-Hole Marker: Yes No

Set _____ sacks in rat hole Set _____ sacks in mouse hole

Additional Plugging Information for Subsequent Report Only

Casing Recovered: _____ ft. of _____ inch casing Plugging Date: _____

*Wireline Contractor: _____ *Cementing Contractor: _____

Type of Cement and Additives Used: _____

Flowline/Pipeline has been abandoned per Rule 1103 Yes No *ATTACH JOB SUMMARY

Technical Detail/Comments:

WASTE MANAGEMENT USX Y #3-6

PROCEDURE:

- 1) MIRU Workover rig, pump & tank.
- 2) POOH w/ 2 3/8" tbg and lay down.
- 3) RU WL. RIH w/CIBP. Set CIBP @ 6756", dump bail 2 sx of cement on top.
- 4) Unland casing. Cut casing off +/- 2500'. POOH with casing laying down on trailer.
- 5) RIH w/ workstring to pump (100) sx stub plug where csg was pulled. If maintain circulation, do not need to tag plug.
- 6) POOH w/workstring to 1006'. Pump approx 400 sx shoe plug. Cement to surface.
- 7) RIH. Tag shoe plug. Add cement if needed.
- 8) Cut surface casing off 6'-8' below ground.
- 9) Clean up location. Reclaim location. RDMO.

I hereby certify all statements made in this form are, to the best of my knowledge, true, correct, and complete.

Signed: _____ Print Name: Stephanie Dionne
Title: Base Production Tech Date: 12/18/2013 Email: sdionne@nobleenergyinc.com

Based on the information provided herein, this Well Abandonment Report (Form 6) complies with COGCC Rules and applicable orders and is hereby approved.

COGCC Approved: SCHLAGENHAUF, MARK Date: 12/24/2013

CONDITIONS OF APPROVAL, IF ANY: _____ Expiration Date: 6/23/2014

COA Type	Description
	1) Submit Form 42 electronically to COGCC 48 hours prior to MIRU. 2) If unable to pull casing, contact COGCC for plugging modifications. 3) Leave at least 100' cement in the wellbore for each plug. 4) For 1006' plug: pump plug and displace, shut-in, WOC 4 hours and tag plug – must be 700' or shallower. If shoe plug not circulated to surface then place 5-10 sx inside casing at surface. 5) Properly abandon flowlines as per Rule 1103. Once properly abandoned file electronic form 42. 6. Submit missing Induction log in TIF format with 6 (s).

Attachment Check List

Att Doc Num	Name
400529480	FORM 6 INTENT SUBMITTED
400529511	WELLBORE DIAGRAM
400529513	PROPOSED PLUGGING PROCEDURE
400529514	WELLBORE DIAGRAM

Total Attach: 4 Files

General Comments

User Group	Comment	Comment Date

Total: 0 comment(s)