

STATE OF
COLORADO

045-15092

DNR, Jay <jay.krabacher@state.co.us>

History and Plan for DWU CP08B-33 E34 496

2 messages

RECEIVED

JAN 13 2014

Bazile, Jay <Jay.Bazile@encana.com>

To: "COGCC-Jay Krabacher (jay.krabacher@state.co.us)" <jay.krabacher@state.co.us>

COGCC/Rifle Office
Mon, Jan 13, 2014 at 4:10 PM

Hi Jay,

Here is the information that you needed for an approval to proceed with Workover operations on the DWU CP08B-33 E34 496

Thanks,

Jay Bazile

C: 303-931-0451

Well: DWU CP08B-33 E34 496

API: 05-045-15092-0000

Surface Casing: 9-5/8" 36# J-55 set@ 3,615'

Production Casing" 5-1/2" 20# P-110 set @ 11,710'

Fish in hole @ 2,735'


September 2013: Could not get a standard bridge plug through the wellhead. On 9/26/2013 we set an expandable bridge plug in the well at 2,718', dumped 3 sacks of sand on top of the plug, and chased the sand with water.

1/9/2014-1/10/2014. Killed well and nipped down B-section. Discovered the casing slips had not been set properly, and pinched the casing . The pinched casing was not allowing us to get standard size 5.5" casing tools down the well.

Our plan is to do an internal cut on the 5.5" production casing at 400' and then set an external casing patch to repair the pinched casing.

This email communication and any files transmitted with it may contain confidential and or proprietary information and is provided for the use of the intended recipient only. Any review, retransmission or dissemination of this information by anyone other than the intended recipient is prohibited. If you receive this email in error, please contact the sender and delete this communication and any copies immediately. Thank you.

<http://www.encana.com>

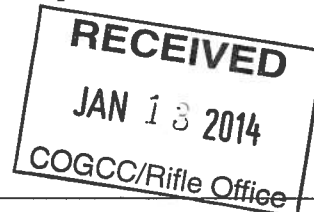

Krabacher - DNR, Jay <jay.krabacher@state.co.us>

Mon, Jan 13, 2014 at 4:34 PM

To: "Bazile, Jay" <Jay.Bazile@encana.com>

Cc: "Steinke, Mitch" <Mitchell.Steinke@encana.com>, "Andrews, David" <David.Andrews@state.co.us>

Thanks Jay.

This will serve to document the verbal approval to commence work on the subject well. (a.k.a. 045-15092).

The Sundry Notice (Form 4) documenting the situation which precluded the proposed work, and documenting the work which will be done on this well, will be forthcoming. COGCC may request a Form 5 (Well Completion Report) if the well configuration has been changed, as per COGCC Rule 308A. Have Encana's regulatory staff check this, to see if the proposed procedure qualifies as changing of the wellbore configuration.

Regards,

Jay Krabacher

[Quoted text hidden]

—

Jay Krabacher

N W Area Engineer

COGCC

| cosas son mas como son ahora que ellas siempre fueron