

**Koch Exploration Company LLC**  
**Workover Procedure**  
**WRD Dow 20-22**

Pertinent Information

API Number: 05-103-09894

Well Location: 1999' FNL 1992' FWL  
Section 20, Township 2 North, Range 96 West  
Rio Blanco County, Colorado

Elevation: 6149' GL, 6165' KB

TD: 7568'

Casing: 8 5/8" 24# J55 Surface Casing set at 1085'  
5 1/2" 17# N80 Long String set at 7568'

Tubing:

Perforations: Mesaverde  
6504' – 7433'

Procedure

1. MIRU workover rig. Install BOP.
2. Clean out to 6600'. Set composite bridge plug at 6450'. Set 5 sx of cement on bridge plug.
3. Run packer and set at ±6400'.
4. Test casing and come up the hole testing to identify the casing leak.
5. Set CBP below casing leak and squeeze. Drill out to CBP and test to 500 psi.
6. Drill out CBP and clean out well to 7488'.
7. Run production tubing. Hang off tubing, remove BOP and install well head.
8. Rig down workover rig. Clean up location.
9. Return the well to production.