

FORM

6

Rev
12/05

State of Colorado

Oil and Gas Conservation Commission

1120 Lincoln Street, Suite 801, Denver, Colorado 80203 Phone: (303) 894-2100 Fax: (303) 894-2109



DE ET OE ES

Document Number:

400577051

Date Received:

WELL ABANDONMENT REPORT

This form is to be submitted as an Intent to Abandon whenever an abandonment is planned on a borehole. After the abandonment is complete, this form shall again be submitted as a Subsequent Report of the actual work completed. The approved intent shall be valid for six months after the approval date, after that period, a new intent will be required.

Attachments required with the Intent to Abandon are wellbore diagrams of the current configuration and the proposed configuration with plugs set.

A Subsequent Report of Abandonment shall indicate the actual work completed. Attachments required with a Subsequent Report are a wellbore diagram showing plugs that were set and casing remaining in the hole, the job summaries from all plugging contractors used, including wireline and cementing (third party verification) and any logs that may have been run during abandonment.

OGCC Operator Number: 47120

Contact Name: CHERYL LIGHT

Name of Operator: KERR-MCGEE OIL & GAS ONSHORE LP

Phone: (720) 929-6461

Address: P O BOX 173779

Fax: (720) 929-7461

City: DENVER State: CO Zip: 80217-

Email: CHERYL.LIGHT@ANADARKO.COM

For "Intent" 24 hour notice required,

Name: Carlile, Craig

Tel: (303) 8942100

COGCC contact:

Email: craig.carlile@state.co.us

API Number 05-123-07940-00

Well Name: RANKIN J WALTER UNIT

Well Number: 1

Location: QtrQtr: SWSW Section: 19 Township: 3N Range: 67W Meridian: 6

County: WELD

Federal, Indian or State Lease Number:

Field Name: WATTENBERG

Field Number: 90750

☒ Notice of Intent to Abandon☐ Subsequent Report of Abandonment

Only Complete the Following Background Information for Intent to Abandon

Latitude: 40.207200

Longitude: -104.938200

GPS Data:

Date of Measurement: 03/08/2006

PDOP Reading: 1.9

GPS Instrument Operator's Name: Steve Fisher

Reason for Abandonment:

☐ Dry☒ Production for Sub-economic☐ Mechanical Problems☐ OtherCasing to be pulled: ☒ Yes☐ No

Estimated Depth: 970

Fish in Hole: ☐ Yes☒ No

If yes, explain details below

Wellbore has Uncemented Casing leaks:

☐ Yes☒ No

If yes, explain details below

Details: Four squeeze jobs were performed 04/2000. Squeeze perms present at 6944', 6986', 6946', and 5500', and were each cemented with 200, 50, 50, and 200 sx of cement, respectively. We intend to place an internal casing plug over all of the niobrara perforations up to the TOC, and use a suicide squeeze above the 5500' squeeze job.

Current and Previously Abandoned Zones

Formation	Perf. Top	Perf. Btm	Abandoned Date	Method of Isolation	Plug Depth
CODELL	7218	7236			
J SAND	7660	7688			
NIORARA	6948	7018			

Total: 3 zone(s)

Casing History

Casing Type	Size of Hole	Size of Casing	Weight Per Foot	Setting Depth	Sacks Cement	Cement Bot	Cement Top	Status
SURF	12+1/4	8+5/8	24	219	200	219	0	VISU
1ST	7+7/8	4+1/2	10.5/11.6	7,811	200	7,821	6,850	CBL

Plugging Procedure for Intent and Subsequent Report

CIBP #1: Depth 7145 with 2 sacks cmt on top. CIPB #2: Depth 100 with 23 sacks cmt on top.
CIBP #3: Depth _____ with _____ sacks cmt on top. CIPB #4: Depth _____ with _____ sacks cmt on top.
CIBP #5: Depth _____ with _____ sacks cmt on top.

NOTE: Two(2) sacks cement required on all CIBPs.

Set 50 sks cmt from 7145 ft. to 6390 ft. Plug Type: CASING Plug Tagged: ☐
Set 520 sks cmt from 1070 ft. to 100 ft. Plug Type: STUB PLUG Plug Tagged: ☒
Set _____ sks cmt from _____ ft. to _____ ft. Plug Type: _____ Plug Tagged: ☐
Set _____ sks cmt from _____ ft. to _____ ft. Plug Type: _____ Plug Tagged: ☐
Set _____ sks cmt from _____ ft. to _____ ft. Plug Type: _____ Plug Tagged: ☐

Perforate and squeeze at 3890 ft. with 380 sacks. Leave at least 100 ft. in casing 3920 CICR Depth
Perforate and squeeze at _____ ft. with _____ sacks. Leave at least 100 ft. in casing _____ CICR Depth
Perforate and squeeze at _____ ft. with _____ sacks. Leave at least 100 ft. in casing _____ CICR Depth

(Cast Iron Cement Retainer Depth)

Set 520 sacks half in. half out surface casing from 1070 ft. to 100 ft. Plug Tagged: ☐
Set 23 sacks at surface
Cut four feet below ground level, weld on plate Above Ground Dry-Hole Marker: ☐ Yes ☒ No
Set _____ sacks in rat hole Set _____ sacks in mouse hole

Additional Plugging Information for Subsequent Report Only

Casing Recovered: _____ ft. of _____ inch casing Plugging Date: _____
*Wireline Contractor: _____ *Cementing Contractor: _____
Type of Cement and Additives Used: _____
Flowline/Pipeline has been abandoned per Rule 1103 ☐ Yes ☐ No *ATTACH JOB SUMMARY

Technical Detail/Comments:

Perforate and squeeze at 4500 / 3890 ft. with 380 sacks Leave at least 100 ft. in casing 3920' CICR Depth

I hereby certify all statements made in this form are, to the best of my knowledge, true, correct, and complete.

Signed: _____ Print Name: CHERYL LIGHT
Title: SR. REGULATORY ANALYST Date: _____ Email: DJREGULATORY@ANADARKO.COM

Based on the information provided herein, this Well Abandonment Report (Form 6) complies with COGCC Rules and applicable orders and is hereby approved.

COGCC Approved: _____ Date: _____

CONDITIONS OF APPROVAL, IF ANY: _____

Expiration Date: _____

COA Type

Description

--	--

Attachment Check List

Att Doc Num

Name

400577052	PROPOSED PLUGGING PROCEDURE
400577053	WELLBORE DIAGRAM

Total Attach: 2 Files

General Comments

User Group

Comment

Comment Date

--	--	--

Total: 0 comment(s)