



## P&A PROCEDURE

May 23, 2014

### Executive Brief

The scope of this work is to re-enter the old wellbore that had previously been plugged and abandoned. The well will be properly plugged and abandoned by setting cement plugs to isolate the Niobrara, freshwater zones, and setting a cement cap near the surface. Then the surface casing will have a plate welded as final seal 5' below the surface. The old wellbore will then be buried and the surface location will be remediated.

Well Information	
Surface Location	660' FNL & 660' FEL from the Section Line
Lat/Long	Lat: 40.609605 & Long:-104.071361
API Number	05-123-14473
<b>AFE Number</b>	
Ground Level Elevation, feet	4920
Working Interest	100%
Estimated TD, feet	7030

Formation Tops	
Top Names	Footage
Freshwater Zone	0' - 500'
Niobrara	6108
D Sand	6848
J Sand	6912

Existing Tubular Data										
Size in	Depth	Weight	Grade	ID	Drift	Thread	Burst w/ No SF	Collapse w/ No SF	Capacity	Capacity
	(MD ft)	lb/ft		In	In		Psi	Psi	Bbl/ft	ft <sup>3</sup> /ft
8 5/8"	220	24	J55	8.097	7.972	STC	2,950	1,370	0.06368	0.35758

All personnel should keep their speed down to **30 mph** once they are near a residence or in a high traffic area to minimize dust.

### PERFORM SAFETY CHECKS AND SAFETY MEETING

Perform safety meeting prior to rigging up **ANY** equipment on location. Discuss the job procedure and objectives with all personnel on location. Document the safety meeting on the report sent to Carrizo. Make note of all potential risks/hazards, and clearly identify an emergency route and emergency vehicle. Also make note of any new or inexperienced personnel on location. Ensure proper Personal Protective Equipment (PPE) is used during the job. Minimums are hard hats, steel toes, and safety glasses.

### PROCEDURE

1. Locate old surface casing using magnetometer. Record the GPS coordinates and the datum used for the GPS coordinates.

Set a stake and try to locate the boundaries of the old pad site.

2. Dig down to the old surface casing and cut plate off. Weld on 4' -8 5/8" pup jt and 8 5/8" wellhead.
3. MIRU workover rig and related equipment including power swivel, mud tank and pump. NU the rig BOP's.

### Re-enter & Cleanout Wellbore

4. Test the BOP's to 250 psi for a low test and 4,500 psi for a high test. RU the work floor and PU 2 7/8" 8 rd work string, 3-4 3/4" DCs, and a 6 1/2" rock bit. Pressure test surface casing to 1000 psi.
5. Drill up cement plug at surface and below casing shoe, and and continue washing down to 4 1/2" casing stub at 6,000". If problems encountered before reaching 6000', contact office for alternate depth. Circulate and POOH
6. GIH with tubing to top of casing, circulate mud and prepare to set cement plugs.

### Set Cement Plugs and Abandon Well

7. RU cementers. Test lines to 4,500 psi.
8. Set plugs coming up hole according to the following Cement Plug Table.
9. Once the top plug has been set cut casing to 5' below surface and weld on a plate to seal the well. Cover up the well and remediate the disturbed area with the appropriate seed mix.

Re-entry Hole Data		
Planned Hole Size in	Capacity bbl/ft	Capacity ft <sup>3</sup> /ft
7.875	0.06024	0.33824
7.875 x 5.5	0.03086	0.1733

Cement Plug Table						
Plug Number	Formation or Location	Plug Btm Depth	Plug Top Depth	Cement Class	Yield ft <sup>3</sup> /sk	Number of Sacks
1	Casing Stub	5900	5600	G	1.18	86
2	Fresh Water Zone	600	0	G	1.18	174

Total      **260**      sacks