

FORM

6

Rev  
12/05

## State of Colorado

## Oil and Gas Conservation Commission

1120 Lincoln Street, Suite 801, Denver, Colorado 80203 Phone: (303) 894-2100 Fax: (303) 894-2109



DE	ET	OE	ES
----	----	----	----

Replug By Other Operator

Document Number:

400619830

Date Received:

## WELL ABANDONMENT REPORT

This form is to be submitted as an Intent to Abandon whenever an abandonment is planned on a borehole. After the abandonment is complete, this form shall again be submitted as a Subsequent Report of the actual work completed. The approved intent shall be valid for six months after the approval date, after that period, a new intent will be required. Attachments required with the Intent to Abandon are wellbore diagrams of the current configuration and the proposed configuration with plugs set.

A Subsequent Report of Abandonment shall indicate the actual work completed. Attachments required with a Subsequent Report are a wellbore diagram showing plugs that were set and casing remaining in the hole, the job summaries from all plugging contractors used, including wireline and cementing (third party verification) and any logs that may have been run during abandonment.

OGCC Operator Number: 47120

Contact Name: CHERYL LIGHT

Name of Operator: KERR MCGEE OIL &amp; GAS ONSHORE LP

Phone: (720) 929-6461

Address: P O BOX 173779

Fax: (720) 929-7461

City: DENVER State: CO Zip: 80217-

Email: CHERYL.LIGHT@ANADARKO.COM

For "Intent" 24 hour notice required,

Name: MONTOYA, JOHN

Tel: (970) 3974124

COGCC contact:

Email: john.montoya@state.co.us

API Number 05-123-07554-00

Well Name: REHDER

Well Number: 1

Location: QtrQtr: SWSW Section: 6 Township: 2N Range: 65W Meridian: 6

County: WELD

Federal, Indian or State Lease Number:

Field Name: WATTENBERG

Field Number: 90750

☒ Notice of Intent to Abandon☐ Subsequent Report of Abandonment

## Only Complete the Following Background Information for Intent to Abandon

Latitude: 40.162757

Longitude: -104.712378

GPS Data:

Date of Measurement: PDOP Reading: GPS Instrument Operator's Name:

Reason for Abandonment: ☐ Dry ☐ Production for Sub-economic ☐ Mechanical Problems☒ Other Abandoned in 1992Casing to be pulled: ☐ Yes ☒ No Estimated Depth:Fish in Hole: ☐ Yes ☒ No If yes, explain details belowWellbore has Uncemented Casing leaks: ☐ Yes ☒ No If yes, explain details below

Details: This well was originally abandoned in 1992. Well is to be re-entered and additional cement added to isolate the Niobrara, Sussex, and Fox Hills formations.

Perforate and squeeze at 7350 / 6685 ft. with 230 sacks Leave at least 100 ft. in casing 6715 CICR Depth  
 Perforate and squeeze at 4653 / 4250 ft. with 360 sacks Leave at least 100 ft. in casing 4280 CICR Depth  
 Perforate and squeeze at 1340 / 780 ft. with 430 sacks Leave at least 100 ft. in casing 810 CICR Depth

## Current and Previously Abandoned Zones

Formation	Perf. Top	Perf. Btm	Abandoned Date	Method of Isolation	Plug Depth
J SAND	7836	7860	07/21/1992	B PLUG CEMENT TOP	7800

Total: 1 zone(s)

## Casing History

Casing Type	Size of Hole	Size of Casing	Weight Per Foot	Setting Depth	Sacks Cement	Cement Bot	Cement Top	Status
SURF	12+1/4	8+5/8	24	215	175	215	0	VISU
1ST	7+7/8	4+1/2	11.6	7,954	175	7,954	7,370	CALC
			Stage Tool	768	200	768	390	CALC

### Plugging Procedure for Intent and Subsequent Report

CIBP #1: Depth 100 with 10 sacks cmt on top. CIBP #2: Depth \_\_\_\_\_ with \_\_\_\_\_ sacks cmt on top.  
CIBP #3: Depth \_\_\_\_\_ with \_\_\_\_\_ sacks cmt on top. CIBP #4: Depth \_\_\_\_\_ with \_\_\_\_\_ sacks cmt on top.  
CIBP #5: Depth \_\_\_\_\_ with \_\_\_\_\_ sacks cmt on top.

NOTE: Two(2) sacks cement required on all CIBPs.

Set \_\_\_\_\_ sks cmt from \_\_\_\_\_ ft. to \_\_\_\_\_ ft. Plug Type: \_\_\_\_\_ Plug Tagged: ☐  
Set \_\_\_\_\_ sks cmt from \_\_\_\_\_ ft. to \_\_\_\_\_ ft. Plug Type: \_\_\_\_\_ Plug Tagged: ☐  
Set \_\_\_\_\_ sks cmt from \_\_\_\_\_ ft. to \_\_\_\_\_ ft. Plug Type: \_\_\_\_\_ Plug Tagged: ☐  
Set \_\_\_\_\_ sks cmt from \_\_\_\_\_ ft. to \_\_\_\_\_ ft. Plug Type: \_\_\_\_\_ Plug Tagged: ☐  
Set \_\_\_\_\_ sks cmt from \_\_\_\_\_ ft. to \_\_\_\_\_ ft. Plug Type: \_\_\_\_\_ Plug Tagged: ☐

Perforate and squeeze at 7350 ft. with 230 sacks. Leave at least 100 ft. in casing 6715 CICR Depth  
Perforate and squeeze at 4653 ft. with 360 sacks. Leave at least 100 ft. in casing 4280 CICR Depth  
Perforate and squeeze at 1340 ft. with 430 sacks. Leave at least 100 ft. in casing 810 CICR Depth

(Cast Iron Cement Retainer Depth)

Set \_\_\_\_\_ sacks half in. half out surface casing from \_\_\_\_\_ ft. to \_\_\_\_\_ ft. Plug Tagged: ☐

Set 10 sacks at surface

Cut four feet below ground level, weld on plate Above Ground Dry-Hole Marker: ☐ Yes ☒ No

Set \_\_\_\_\_ sacks in rat hole Set \_\_\_\_\_ sacks in mouse hole

### Additional Plugging Information for Subsequent Report Only

Casing Recovered: \_\_\_\_\_ ft. of \_\_\_\_\_ inch casing Plugging Date: \_\_\_\_\_

\*Wireline Contractor: \_\_\_\_\_ \*Cementing Contractor: \_\_\_\_\_

Type of Cement and Additives Used: \_\_\_\_\_

Flowline/Pipeline has been abandoned per Rule 1103 ☐ Yes ☐ No \*ATTACH JOB SUMMARY

Technical Detail/Comments:

As-built well location GPS data will be submitted on the Form 6 Subsequent Report of Abandonment.  
Purpose is to reenter and adequately replug prior to hydraulic stimulation of proposed horizontal well per DJ Basin Offset Policy dated December 16, 2013.  
Closed loop system will not be used.  
Re-plug and re-entry procedure attached.

I hereby certify all statements made in this form are, to the best of my knowledge, true, correct, and complete.

Signed: \_\_\_\_\_ Print Name: CHERYL LIGHT  
Title: SR. REGULATORY ANALYST Date: \_\_\_\_\_ Email: DJREGULATORY@ANADARKO.COM

Based on the information provided herein, this Well Abandonment Report (Form 6) complies with COGCC Rules and applicable orders and is hereby approved.

COGCC Approved: \_\_\_\_\_ Date: \_\_\_\_\_

CONDITIONS OF APPROVAL, IF ANY: \_\_\_\_\_ Expiration Date: \_\_\_\_\_

### Attachment Check List

<u>Att Doc Num</u>	<u>Name</u>
400619837	OTHER
400619838	PROPOSED PLUGGING PROCEDURE
400619839	SURFACE AGRMT/SURETY
400619840	WELLBORE DIAGRAM

Total Attach: 4 Files

### General Comments

<u>User Group</u>	<u>Comment</u>	<u>Comment Date</u>

Total: 0 comment(s)