

FORM

6

Rev
12/05

State of Colorado

Oil and Gas Conservation Commission

1120 Lincoln Street, Suite 801, Denver, Colorado 80203 Phone: (303) 894-2100 Fax: (303) 894-2109



DE	ET	OE	ES
----	----	----	----

Document Number:

400659424

Date Received:

WELL ABANDONMENT REPORT

This form is to be submitted as an Intent to Abandon whenever an abandonment is planned on a borehole. After the abandonment is complete, this form shall again be submitted as a Subsequent Report of the actual work completed. The approved intent shall be valid for six months after the approval date, after that period, a new intent will be required. Attachments required with the Intent to Abandon are wellbore diagrams of the current configuration and the proposed configuration with plugs set.

A Subsequent Report of Abandonment shall indicate the actual work completed. Attachments required with a Subsequent Report are a wellbore diagram showing plugs that were set and casing remaining in the hole, the job summaries from all plugging contractors used, including wireline and cementing (third party verification) and any logs that may have been run during abandonment.

OGCC Operator Number: 47120

Contact Name: CHERYL LIGHT

Name of Operator: KERR MCGEE OIL & GAS ONSHORE LP

Phone: (720) 929-6461

Address: P O BOX 173779

Fax: (720) 929-7461

City: DENVER State: CO Zip: 80217-

Email: CHERYL.LIGHT@ANADARKO.COM

For "Intent" 24 hour notice required,

Name: JOHNSON, RANDELL

Tel: (303) 815-9641

COGCC contact:

Email: randell.johnson@state.co.us

API Number 05-123-08409-00

Well Name: WILLIAM E GEE GAS UNIT

Well Number: 1

Location: QtrQtr: NWNE Section: 24 Township: 2N Range: 67W Meridian: 6

County: WELD

Federal, Indian or State Lease Number:

Field Name: WATTENBERG

Field Number: 90750

☒ Notice of Intent to Abandon☐ Subsequent Report of Abandonment

Only Complete the Following Background Information for Intent to Abandon

Latitude: 40.127740

Longitude: -104.835370

GPS Data:

Date of Measurement: 06/04/2008

PDOP Reading: 2.7

GPS Instrument Operator's Name: Cuddy Mattson

Reason for Abandonment:

☐ Dry☒ Production for Sub-economic☐ Mechanical Problems☐ Other

Casing to be pulled:

☐ Yes☒ No

Estimated Depth:

Fish in Hole:

☐ Yes☒ No

If yes, explain details below

Wellbore has Uncemented Casing leaks:

☐ Yes☒ No

If yes, explain details below

Details: Cement Squeeze from 575' to 212' w/ 290 sacks of class "g" to fix the casing leak between 563' - 548'. Estimate Date: 11/20/ 1995

Current and Previously Abandoned Zones

Formation	Perf. Top	Perf. Btm	Abandoned Date	Method of Isolation	Plug Depth
CODELL	7388	7394			
J SAND	7839	7869			
NIOBRARA	7178	7182			

Total: 3 zone(s)

Casing History

Casing Type	Size of Hole	Size of Casing	Weight Per Foot	Setting Depth	Sacks Cement	Cement Bot	Cement Top	Status
SURF	12+1/4	8+5/8	24	215	275	215	0	VISU
1ST	7+7/8	4+1/2	11.6	7,965	475	7,965	6,750	
			Stage Tool	572	290	572	215	

Plugging Procedure for Intent and Subsequent Report

CIBP #1: Depth 7780 with 2 sacks cmt on top. CIBP #2: Depth 7120 with 30 sacks cmt on top.

CIBP #3: Depth _____ with _____ sacks cmt on top. CIBP #4: Depth _____ with _____ sacks cmt on top.

CIBP #5: Depth _____ with _____ sacks cmt on top.

NOTE: Two(2) sacks cement required on all CIBPs.

Set _____ sks cmt from _____ ft. to _____ ft. Plug Type: _____ Plug Tagged: ☐

Set _____ sks cmt from _____ ft. to _____ ft. Plug Type: _____ Plug Tagged: ☐

Set _____ sks cmt from _____ ft. to _____ ft. Plug Type: _____ Plug Tagged: ☐

Set _____ sks cmt from _____ ft. to _____ ft. Plug Type: _____ Plug Tagged: ☐

Set _____ sks cmt from _____ ft. to _____ ft. Plug Type: _____ Plug Tagged: ☐

Perforate and squeeze at 4600 ft. with 330 sacks. Leave at least 100 ft. in casing 4230 CICR Depth

Perforate and squeeze at 1300 ft. with 490 sacks. Leave at least 100 ft. in casing 630 CICR Depth

Perforate and squeeze at _____ ft. with _____ sacks. Leave at least 100 ft. in casing _____ CICR Depth

(Cast Iron Cement Retainer Depth)

Set 40 sacks half in. half out surface casing from 600 ft. to 100 ft. Plug Tagged: ☐

Set _____ sacks at surface

Cut four feet below ground level, weld on plate Above Ground Dry-Hole Marker: ☐ Yes ☒ No

Set _____ sacks in rat hole Set _____ sacks in mouse hole

Additional Plugging Information for Subsequent Report Only

Casing Recovered: _____ ft. of _____ inch casing Plugging Date: _____

*Wireline Contractor: _____ *Cementing Contractor: _____

Type of Cement and Additives Used: _____

Flowline/Pipeline has been abandoned per Rule 1103 ☐ Yes ☐ No *ATTACH JOB SUMMARY

Technical Detail/Comments:

Perforate and squeeze at 4600'/4200' ft. with 330 sacks Leave at least 100 ft. in casing 4230 CICR Depth
Perforate and squeeze at 1300'/600' ft. with 490 sacks Leave at least 100 ft. in casing 630 CICR Depth

I hereby certify all statements made in this form are, to the best of my knowledge, true, correct, and complete.

Signed: _____ Print Name: CHERYL LIGHT

Title: SR. REGULATORY ANALYST Date: _____ Email: DJREGULATORY@ANADARKO.COM

Based on the information provided herein, this Well Abandonment Report (Form 6) complies with COGCC Rules and applicable orders and is hereby approved.

COGCC Approved: _____ Date: _____

CONDITIONS OF APPROVAL, IF ANY: _____ Expiration Date: _____

Attachment Check List

Att Doc Num

Name

400659428	PROPOSED PLUGGING PROCEDURE
400659430	WELLBORE DIAGRAM

Total Attach: 2 Files

General Comments

User Group

Comment

Comment Date

--	--	--

Total: 0 comment(s)