

STATE OF
COLORADO

EnviroScan - DNR, OGCC <dnr_ogcc.enviroscan@state.co.us>

KPK Franklin Stermole Unit #1 Complaint #200411312

1 message

Axelson - DNR, John <john.axelson@state.co.us>

Mon, Sep 22, 2014 at 10:29 AM

To: Brad Windell <brad@aquaticandwetland.com>

Cc: Randell Johnson - DNR <Randell.Johnson@state.co.us>, James Precup - DNR <James.Precup@state.co.us>, OGCC EnviroScan - DNR <OGCC.EnviroScan@state.co.us>

Mr. Windell,

I wanted to follow up with you regarding the complaint you filed on the KPK Franklin Stermole Unit #1 (API #123-09052). As you are aware, COGCC Field Engineer, Randell Johnson, inspected the location on September 3, 2014. I believe you were already copied, but another copy of the inspection is attached for your records.

Several corrective actions were identified including a requirement to cleanup spills and remove unused equipment. In addition, COGCC used a Forward Looking Infrared (FLIR) camera that documented VOC emissions from the regulators on the piping next to the sales meter. As a result, a requirement was made that KPK perform pressure tests on the flowlines and also perform a Mechanical Integrity Test on the well. Failure of these tests would require appropriate repairs or abandonment.

COGCC will follow up to verify that the corrective actions are performed, or appropriate enforcement will be pursued. I will leave the complaint report open until all of the corrective actions have been satisfied.

Please let me know if you have any questions or require additional information at this time.

Thank you,

John E. Axelson, P.G.

East Environmental Supervisor



P 303.894.2100 x5115 | F 303.894.2109 | C 303-916-0527

1120 Lincoln Street, Suite 801, Denver, CO 80203

john.axelson@state.co.us | www.colorado.gov/cogcc

Cc. Complaint #200411312 - Correspondence

AWC Complaint_insp_668302299.pdf
129K