

Document Number:
400702351

Date Received:
10/06/2014

WELL ABANDONMENT REPORT

This form is to be submitted as an Intent to Abandon whenever an abandonment is planned on a borehole. After the abandonment is complete, this form shall again be submitted as a Subsequent Report of the actual work completed. The approved intent shall be valid for six months after the approval date, after that period, a new intent will be required. Attachments required with the Intent to Abandon are wellbore diagrams of the current configuration and the proposed configuration with plugs set.

A Subsequent Report of Abandonment shall indicate the actual work completed. Attachments required with a Subsequent Report are a wellbore diagram showing plugs that were set and casing remaining in the hole, the job summaries from all plugging contractors used, including wireline and cementing (third party verification) and any logs that may have been run during abandonment.

OGCC Operator Number: 69175 Contact Name: Jenifer Hakkarinen

Name of Operator: PDC ENERGY INC Phone: (303) 8605800

Address: 1775 SHERMAN STREET - STE 3000 Fax: _____

City: DENVER State: CO Zip: 80203 Email: Jenifer.Hakkarinen@pdce.com

For "Intent" 24 hour notice required, Name: Gomez, Jason Tel: (970) 573-1277

COGCC contact: Email: jason.gomez@state.co.us

API Number 05-123-20132-00

Well Name: AUSTIN Well Number: 1

Location: QtrQtr: NWSE Section: 19 Township: 5N Range: 64W Meridian: 6

County: WELD Federal, Indian or State Lease Number: _____

Field Name: WATTENBERG Field Number: 90750

Notice of Intent to Abandon Subsequent Report of Abandonment

Only Complete the Following Background Information for Intent to Abandon

Latitude: 40.382778 Longitude: -104.590278

GPS Data:
Date of Measurement: 04/16/2010 PDOP Reading: 1.5 GPS Instrument Operator's Name: Chuck Kraft

Reason for Abandonment: Dry Production for Sub-economic Mechanical Problems

Other _____

Casing to be pulled: Yes No Estimated Depth: _____

Fish in Hole: Yes No If yes, explain details below

Wellbore has Uncemented Casing leaks: Yes No If yes, explain details below

Details: _____

Current and Previously Abandoned Zones

Formation	Perf. Top	Perf. Btm	Abandoned Date	Method of Isolation	Plug Depth
CODELL	6870	6883			
NIOBRARA	6584	6870			

Total: 2 zone(s)

Casing History

Casing Type	Size of Hole	Size of Casing	Weight Per Foot	Setting Depth	Sacks Cement	Cement Bot	Cement Top	Status
SURF	12+1/4	8+5/8	24	361	255	361	0	VISU
1ST	7	4+1/2	11.6	6,971	708	6,971	6,100	CBL

Plugging Procedure for Intent and Subsequent Report

CIBP #1: Depth 6520 with 2 sacks cmt on top. CIBP #2: Depth _____ with _____ sacks cmt on top.
CIBP #3: Depth _____ with _____ sacks cmt on top. CIBP #4: Depth _____ with _____ sacks cmt on top.
CIBP #5: Depth _____ with _____ sacks cmt on top.

NOTE: Two(2) sacks cement required on all CIBPs.

Set 200 sks cmt from 3500 ft. to 4500 ft. Plug Type: CASING Plug Tagged:
Set _____ sks cmt from _____ ft. to _____ ft. Plug Type: _____ Plug Tagged:
Set _____ sks cmt from _____ ft. to _____ ft. Plug Type: _____ Plug Tagged:
Set _____ sks cmt from _____ ft. to _____ ft. Plug Type: _____ Plug Tagged:
Set _____ sks cmt from _____ ft. to _____ ft. Plug Type: _____ Plug Tagged:
Perforate and squeeze at _____ ft. with _____ sacks. Leave at least 100 ft. in casing _____ CICR Depth
Perforate and squeeze at _____ ft. with _____ sacks. Leave at least 100 ft. in casing _____ CICR Depth
Perforate and squeeze at _____ ft. with _____ sacks. Leave at least 100 ft. in casing _____ CICR Depth
(Cast Iron Cement Retainer Depth)
Set 250 sacks half in. half out surface casing from 540 ft. to 0 ft. Plug Tagged:
Set _____ sacks at surface
Cut four feet below ground level, weld on plate Above Ground Dry-Hole Marker: Yes No
Set _____ sacks in rat hole Set _____ sacks in mouse hole

Additional Plugging Information for Subsequent Report Only

Casing Recovered: _____ ft. of _____ inch casing Plugging Date: _____
*Wireline Contractor: _____ *Cementing Contractor: _____
Type of Cement and Additives Used: _____
Flowline/Pipeline has been abandoned per Rule 1103 Yes No *ATTACH JOB SUMMARY

Technical Detail/Comments:

Plugging Procedure
Codell
Niobrara
Existing Perforations:
Niobrara: 6,584'-6,870'
Codell: 6,870'-6,883'
PBTD: 6739'
8 5/8" 24# @ 361' w/ 255 sks cmt.
4.5" 11.6# @ 6971' w/ 200 sks G cmt (TOC 6100'), 508 sks lite cmt to surface
Procedure:
1. MIRU wireline
2. RIH, tag cement on top of CIBP set @ 6,520'
3. TOH to set 200 sack plug @ Parkman/Sussex (3500-4500)
4. TOH and set 250 sack cement plug half in half out of surface casing from 540' to surface
5. Cut casing and weld on cap

I hereby certify all statements made in this form are, to the best of my knowledge, true, correct, and complete.

Signed: _____ Print Name: Jenifer Hakkarinen
Title: Regulatory TEch Date: 10/6/2014 Email: JEnifer.Hakkarinen@pdce.com

Based on the information provided herein, this Well Abandonment Report (Form 6) complies with COGCC Rules and applicable orders and is hereby approved.

COGCC Approved: JENKINS, STEVE Date: 10/13/2014

COA Type

Description

	<p>Note changes to plugging procedure:</p> <ol style="list-style-type: none"> 1) Provide 48 hour notice of plugging MIRU via electronic Form 42. 2) For 4500' plug: pump plug and displace, shut-in, WOC 4 hours and tag plug – must be 3500' or shallower. 3) For 540' plug: pump plug and displace – must be 311' or shallower. If surface casing plug does not circulate to surface then tag plug and provide 10 sx plug at the surface. Leave at least 100' cement in the casing for each plug. 4) Properly abandon flowlines as per Rule 1103. File electronic Form 42 once abandonment complete.
--	--

Attachment Check List

Att Doc Num

Name

400702351	FORM 6 INTENT SUBMITTED
400702443	WELLBORE DIAGRAM
400702446	WELLBORE DIAGRAM

Total Attach: 3 Files

General Comments

User Group

Comment

Comment Date

--	--	--

Total: 0 comment(s)