

FORM
6Rev
12/05State of Colorado
Oil and Gas Conservation Commission

1120 Lincoln Street, Suite 801, Denver, Colorado 80203 Phone: (303) 894-2100 Fax: (303) 894-2109



DE ET OE ES

Replug By Other Operator

Document Number:

400717502

Date Received:

10/27/2014

WELL ABANDONMENT REPORT

This form is to be submitted as an Intent to Abandon whenever an abandonment is planned on a borehole. After the abandonment is complete, this form shall again be submitted as a Subsequent Report of the actual work completed. The approved intent shall be valid for six months after the approval date, after that period, a new intent will be required. Attachments required with the Intent to Abandon are wellbore diagrams of the current configuration and the proposed configuration with plugs set.

A Subsequent Report of Abandonment shall indicate the actual work completed. Attachments required with a Subsequent Report are a wellbore diagram showing plugs that were set and casing remaining in the hole, the job summaries from all plugging contractors used, including wireline and cementing (third party verification) and any logs that may have been run during abandonment.

OGCC Operator Number: 100322

Contact Name: Ryan Olson

Name of Operator: NOBLE ENERGY INC

Phone: (720) 587-2370

Address: 1625 BROADWAY STE 2200

Fax: (303) 228-4286

City: DENVER State: CO Zip: 80202

Email: eroberts@nobleenergyinc.com

For "Intent" 24 hour notice required,

Name: Rains, Bill

Tel: (970) 590-6480

COGCC contact:

Email: bill.rains@state.co.us

API Number 05-123-14348-00

Well Name: HILLS

Well Number: 10-27

Location: QtrQtr: NWSE Section: 27 Township: 9N Range: 59W Meridian: 6

County: WELD

Federal, Indian or State Lease Number:

Field Name: WILDCAT

Field Number: 99999

☒ Notice of Intent to Abandon☐ Subsequent Report of Abandonment

Only Complete the Following Background Information for Intent to Abandon

Latitude: 40.719705

Longitude: -103.961509

GPS Data:

Date of Measurement: PDOP Reading: GPS Instrument Operator's Name:

Reason for Abandonment: ☐ Dry ☐ Production for Sub-economic ☐ Mechanical Problems☒ Other ReEnter well, set plug, PA well w/ new cement.Casing to be pulled: ☐ Yes ☐ No Estimated Depth:Fish in Hole: ☐ Yes ☐ No If yes, explain details belowWellbore has Uncemented Casing leaks: ☐ Yes ☒ No If yes, explain details below

Details: See Attached procedure of ReEntry and new PA.

Current and Previously Abandoned Zones

Formation	Perf. Top	Perf. Btm	Abandoned Date	Method of Isolation	Plug Depth

Total: 0 zone(s)

Casing History

Casing Type	Size of Hole	Size of Casing	Weight Per Foot	Setting Depth	Sacks Cement	Cement Bot	Cement Top	Status
SURF	12+1/4	8+5/8	24.00	259	160	259	0	VISU
OPEN HOLE	7+7/8			6,807				

Plugging Procedure for Intent and Subsequent Report

CIBP #1: Depth _____ with _____ sacks cmt on top. CIBP #2: Depth _____ with _____ sacks cmt on top.
CIBP #3: Depth _____ with _____ sacks cmt on top. CIBP #4: Depth _____ with _____ sacks cmt on top.
CIBP #5: Depth _____ with _____ sacks cmt on top.

NOTE: Two(2) sacks cement required on all CIBPs.

Set _____ 35 _____ sks cmt from _____ 6807 _____ ft. to _____ 6650 _____ ft. Plug Type: OPEN HOLE Plug Tagged: ☐
Set _____ 290 _____ sks cmt from _____ 290 _____ ft. to _____ 0 _____ ft. Plug Type: OPEN HOLE Plug Tagged: ☐
Set _____ sks cmt from _____ ft. to _____ ft. Plug Type: _____ Plug Tagged: ☐
Set _____ sks cmt from _____ ft. to _____ ft. Plug Type: _____ Plug Tagged: ☐
Set _____ sks cmt from _____ ft. to _____ ft. Plug Type: _____ Plug Tagged: ☐

Perforate and squeeze at _____ ft. with _____ sacks. Leave at least 100 ft. in casing _____ CICR Depth

Perforate and squeeze at _____ ft. with _____ sacks. Leave at least 100 ft. in casing _____ CICR Depth

Perforate and squeeze at _____ ft. with _____ sacks. Leave at least 100 ft. in casing _____ CICR Depth

(Cast Iron Cement Retainer Depth)

Set _____ sacks half in. half out surface casing from _____ ft. to _____ ft. Plug Tagged: ☐

Set _____ sacks at surface

Cut four feet below ground level, weld on plate Above Ground Dry-Hole Marker: ☐ Yes ☐ No

Set _____ sacks in rat hole Set _____ sacks in mouse hole

Additional Plugging Information for Subsequent Report Only

Casing Recovered: _____ ft. of _____ inch casing Plugging Date: _____

*Wireline Contractor: _____ *Cementing Contractor: _____

Type of Cement and Additives Used: _____

Flowline/Pipeline has been abandoned per Rule 1103 ☐ Yes ☐ No *ATTACH JOB SUMMARY

Technical Detail/Comments:

PROCEDURE:

- 1) Survey and locate abandoned well, mark with stake
- 2) Excavate to expose top of surface casing
- 3) Weld 2" collar to top of 8 5/8" surface casing cap. Make up to collar, pneumatic drill with non-sparking bit. Drill out cap venting possible trapped gas.
- 4) Once verified that no gas exists beneath top of surface casing plate, cut off surface casing below plate with torch, dress up smooth.
- 5) Butt weld 8 5/8" casing to dressed cut, bringing threaded end of casing to ground level.
- 6) Make up to 8 5/8" casing, one 8 5/8" collar and 8 5/8" starter well head
- 7) NU flange adaptor and 5k BOP, test BOP.
- 8) NU and RIH with 6 7/8" cone bit, PU 2 7/8" drill collar, 2 7/8" 8.7# tubing, and TIW valve
- 9) Drill out first cement plug inside surface casing, roll hole clean. Verify top of next cement plug inside of surface casing by tagging.
- 10) If unable to verify isolation of surface casing with tag of cement plug, set RBP inside surface casing
- 11) Once isolation of surface casing is established, either with tagging of surface plug or setting of RBP, pressure test surface casing to 200psi
- 12) After pressure test of surface casing, retrieve RBP or continue drill out of cement plug under surface casing shoe.
- 13) Assume pressure under surface casing shoe, roll hole with kill fluid until well dead, or blow down.
- 14) Continue RIH, cleaning out with drilling mud or water to 3000'
- 15) TOO H with cone bit, drill collars, and 2 7/8" tubing.
- 16) PU and RIH with mule shoe and 2 7/8" tubing to 3000'.
- 17) RU cement crew and pump a balanced plug of 100sk 15.8 ppg Class G "neat" cement
- 18) POOH to 783' (150' below base of Fox Hills @ 633')
- 19) RU cement crew and pump 290 sxs of 15.8ppg Class G "neat" cement bring cement to surface
- 20) POOH with 2 7/8" tubing. Wait 4 hrs, and tag TOC. If cement has fallen, top off back to surface
- 21) Let cement set over night, verify cement has not settled and is still at surface. RDMO
- 22) Excavate around wellhead to 8' below grade, cut off 8 5/8" casing, weld on cap
- 23) Backfill hole and reclaim surface to original conditions

I hereby certify all statements made in this form are, to the best of my knowledge, true, correct, and complete.

Signed: _____ Print Name: Eileen Roberts
Title: Regulatory Analyst I Date: 10/27/2014 Email: eroberts@nobleenergyinc.com

Based on the information provided herein, this Well Abandonment Report (Form 6) complies with COGCC Rules and applicable orders and is hereby approved.

COGCC Approved: JENKINS, STEVE Date: 10/28/2014

CONDITIONS OF APPROVAL, IF ANY: _____ Expiration Date: 4/27/2015

<u>COA Type</u>	<u>Description</u>
	1) Provide 48 hour notice of plugging MIRU via electronic Form 42. 2) For 290' plug: pump plug and displace. If surface casing plug is not circulated to surface then tag plug – must be 201' or shallower and provide 10 sx plug at the surface. Leave at least 100' cement in the casing for each plug.
	1) As built GPS coordinates will be provided on the form 6, SRA. 2) Operator will submit a Form 42 - Offset Mitigation Completed for the re-plugged well, referencing the API Number of the proposed horizontal well. 3) Operator will submit a Form 4 to report date Final Reclamation will commence. Final reclamation should begin as soon as practicable. 4) Operator will schedule a joint onsite inspection with a COGCC Field Inspector prior to any new disturbance. (This applies if there is no final rec inspection in the well file.)

Attachment Check List

<u>Att Doc Num</u>	<u>Name</u>
2157820	WELLBORE DIAGRAM-PROPOSED
400717502	FORM 6 INTENT SUBMITTED
400717517	OTHER
400717523	LOCATION PHOTO
400717525	WELLBORE DIAGRAM

Total Attach: 5 Files

General Comments

<u>User Group</u>	<u>Comment</u>	<u>Comment Date</u>
Engineer	Revised plugging procedure tab to correspond to proposed well plugging wellbore diagram, and plugging procedure as stated on the Submit tab.	10/28/2014 12:01:09 PM
Permit	Oper. submitted proposed plugging WBD. Final rec inspection #500190508, 11/29/1990, in well file.	10/28/2014 7:15:17 AM

Total: 2 comment(s)