

State of Colorado  
Oil and Gas Conservation Commission1120 Lincoln Street, Suite 801, Denver, Colorado 80203  
Phone: (303) 894-2100 Fax: (303) 894-2109

DE	ET	OE	ES
Document Number: <b>400740599</b>			
Date Received:			

## SUNDRY NOTICE

Submit a signed original. This form is to be used for general, technical and environmental sundry information. For proposed or completed operations, describe in full in Comments or provide as an attachment. Identify Well by API Number; identify Oil and Gas Location by Location ID Number; identify other Facility by Facility ID Number.

OGCC Operator Number:	47120	Contact Name	Cheryl Light
Name of Operator:	KERR MCGEE OIL & GAS ONSHORE LP		Phone: (720) 929-6461
Address:	P O BOX 173779		Fax: (720) 929-7461
City:	DENVER	State:	CO Zip: 80217-3779 Email: cheryl.light@anadarko.com

Complete the Attachment  
Checklist

OP OGCC

API Number :	05-	123	26923	00	OGCC Facility ID Number:	296808
Well/Facility Name:	TALLGRASS			Well/Facility Number:	22-17	
Location	QtrQtr:	NESW	Section:	17	Township:	1N Range: 68W Meridian: 6
County:	WELD		Field Name:	WATTENBERG		
Federal, Indian or State Lease Number:						

Survey Plat		
Directional Survey		
Srfc Eqpmt Diagram		
Technical Info Page		
Other		

## CHANGE OF LOCATION OR AS BUILT GPS REPORT

☐ Change of Location \* ☐ As-Built GPS Location Report ☐ As-Built GPS Location Report with Survey

\* Well location change requires new plat. A substantive surface location change may require new Form 2A.

SURFACE LOCATION GPS DATA Data must be provided for Change of Surface Location and As Built Reports.

Latitude \_\_\_\_\_ PDOP Reading \_\_\_\_\_ Date of Measurement \_\_\_\_\_  
Longitude \_\_\_\_\_ GPS Instrument Operator's Name \_\_\_\_\_

## LOCATION CHANGE (all measurements in Feet)

Well will be: \_\_\_\_\_ (Vertical, Directional, Horizontal)

Change of **Surface** Footage **From** Exterior Section Lines:Change of **Surface** Footage **To** Exterior Section Lines:Current **Surface** Location **From** QtrQtr **NESW** Sec **17**New **Surface** Location **To** QtrQtr \_\_\_\_\_ Sec \_\_\_\_\_Change of **Top of Productive Zone** Footage **From** Exterior Section Lines:Change of **Top of Productive Zone** Footage **To** Exterior Section Lines:Current **Top of Productive Zone** Location **From** Sec **17**New **Top of Productive Zone** Location **To** Sec \_\_\_\_\_Change of **Bottomhole** Footage **From** Exterior Section Lines:Change of **Bottomhole** Footage **To** Exterior Section Lines:Current **Bottomhole** Location Sec **17** Twp **1N**New **Bottomhole** Location Sec \_\_\_\_\_ Twp \_\_\_\_\_

Is location in High Density Area? \_\_\_\_\_

Distance, in feet, to nearest building \_\_\_\_\_, public road: \_\_\_\_\_, above ground utility: \_\_\_\_\_, railroad: \_\_\_\_\_,  
property line: \_\_\_\_\_, lease line: \_\_\_\_\_, well in same formation: \_\_\_\_\_

Ground Elevation \_\_\_\_\_ feet Surface owner consultation date \_\_\_\_\_

FNL/FSL		FEL/FWL	
1358	FSL	1423	FWL
Twp 1N	Range 68W	Meridian 6	
Twp	Range	Meridian	
2525	FSL	1279	FWL
Twp 1N	Range 68W		
Twp	Range		
2525	FSL	1279	FWL
Twp 1N	Range 68W		
Twp	Range		

\*\*

\*\*

\*\* attach deviated drilling plan

CHANGE OR ADD OBJECTIVE FORMATION AND/OR SPACING UNIT				
Objective Formation	Formation Code	Spacing Order Number	Unit Acreage	Unit Configuration

OTHER CHANGES			
<input type="checkbox"/>	<b>REMOVE FROM SURFACE BOND</b>	Signed surface use agreement is a required attachment	
<input type="checkbox"/>	<b>CHANGE OF WELL, FACILITY OR OIL &amp; GAS LOCATION NAME OR NUMBER</b>		
	From: Name	TALLGRASS	Number 22-17 Effective Date:
	To: Name		Number
<input type="checkbox"/>	<b>ABANDON PERMIT: Permit can only be abandoned if the permitted operation has NOT been conducted. Field inspection will be conducted to verify site status.</b>		
<input type="checkbox"/>	WELL: Abandon Application for Permit-to-Drill (Form2) – Well API Number has not been drilled.		
<input type="checkbox"/>	PIT: Abandon Earthen Pit Permit (Form 15) – COGCC Pit Facility ID Number has not been constructed (Permitted and constructed pit requires closure per Rule 905)		
<input type="checkbox"/>	CENTRALIZED E&P WASTE MANAGEMENT FACILITY: Abandon Centralized E&P Waste Management Facility Permit (Form 28) – Facility ID Number has not been constructed (Constructed facility requires closure per Rule 908)		
	OIL & GAS LOCATION ID Number:		
<input type="checkbox"/>	Abandon Oil & Gas Location Assessment (Form 2A) – Location has not been constructed and site will not be used in the future.		
<input type="checkbox"/>	Keep Oil & Gas Location Assessment (Form 2A) active until expiration date. This site will be used in the future.		
	<b>Surface disturbance from Oil and Gas Operations must be reclaimed per Rule 1003 and Rule 1004.</b>		
<input type="checkbox"/>	<b>REQUEST FOR CONFIDENTIAL STATUS</b>		
<input type="checkbox"/>	<b>DIGITAL WELL LOG UPLOAD</b>		
<input type="checkbox"/>	<b>DOCUMENTS SUBMITTED</b>	Purpose of Submission:	

## RECLAMATION

### INTERIM RECLAMATION

☐ Interim Reclamation will commence approximately \_\_\_\_\_  
Per Rule 1003.e.(3) operator shall submit Sundry Notice reporting interim reclamation is complete and site is ready for inspection when vegetation reaches 80% coverage.

☐ Interim reclamation complete, site ready for inspection.  
Per Rule 1003.e(3) describe interim reclamation procedure in Comments below or provide as an attachment and attach required location photographs.

**Field inspection will be conducted to document Rule 1003.e. compliance**

### FINAL RECLAMATION

☐ Final Reclamation will commence approximately \_\_\_\_\_  
Per Rule 1004.c.(4) operator shall submit Sundry Notice reporting final reclamation is complete and site is ready for inspection when vegetation reaches 80% coverage.

☐ Final reclamation complete, site ready for inspection. Per Rule 1004.c(4) describe final reclamation procedure in Comments below or provide as an attachment.

**Field inspection will be conducted to document Rule 1004.c. compliance**

Comments:

## ENGINEERING AND ENVIRONMENTAL WORK

### ☐ NOTICE OF CONTINUED TEMPORARILY ABANDONED STATUS

Indicate why the well is temporarily abandoned and describe future plans for utilization in the COMMENTS box below or provide as an attachment, as required by Rule 319.b.(3).

Date well temporarily abandoned \_\_\_\_\_ Has Production Equipment been removed from site? \_\_\_\_\_

Mechanical Integrity Test (MIT) required if shut in longer than 2 years. Date of last MIT \_\_\_\_\_

☐ SPUD DATE: \_\_\_\_\_

## TECHNICAL ENGINEERING AND ENVIRONMENTAL WORK

Details of work must be described in full in the COMMENTS below or provided as an attachment.

☒ NOTICE OF INTENT Approximate Start Date 12/05/2014

☐ REPORT OF WORK DONE Date Work Completed \_\_\_\_\_

- |  |   |  |
|--|---|--|
| <input type="checkbox"/> Intent to Recomplete (Form 2 also required) | <input type="checkbox"/> Request to Vent or Flare   | <input type="checkbox"/> E&P Waste Mangement Plan      |
| <input type="checkbox"/> Change Drilling Plan                        | <input checked="" type="checkbox"/> Repair Well   | <input type="checkbox"/> Beneficial Reuse of E&P Waste |
| <input type="checkbox"/> Gross Interval Change                       | <input type="checkbox"/> Rule 502 variance requested. Must provide detailed info regarding request. |  |
| <input type="checkbox"/> Other _____                                 | <input type="checkbox"/> Status Update/Change of Remediation Plans for Spills and Releases          |  |

## COMMENTS:

1 Well already has directional survey.  
2 Call foreman/field coordinator at least 24 hrs prior to rig move. If not already completed, request that they catch and remove plunger, isolate production equipment and remove any automation equipment prior to the rig showing up. Install perimeter fence as needed.  
3 If unable to catch plunger, MIRU SL. Fish plunger and tag PBMD (should be 8133'). Otherwise, use rig to tag fill with tbg. Inform engineer of tag depth.  
4 Prepare location for base beam rig.  
5 Spot 25 jts of 2-3/8" 4.7# J-55 8RD EUE tbg.  
6 Spot 1800' of 1-1/4" 2.33# J-55 10rd LJ tbg.  
7 MIRU WO rig. Kill well with fresh water and biocide. ND WH, NU BOP.  
8 PU tbg to break any possible sand bridges. Do not exceed 80% of tubing tensile strength, or 57,384 lb. LD landing jt.  
9 Unseat tbg hanger. Install rubber wiper in stripping head.  
10 MIRU EMI equipment. TOOHH with 2-3/8" tbg. EMI tbg while TOOHH. Lay down jts with wall loss or penetrations >35%. Replace jts as necessary. Keep yellow and blue band tbg. Note jt number and depth of tubing leak(s) on production equipment failure report in OpenWells. Clearly mark all junk (red band) tbg sent to yard.  
11 PU and TIH with 238 jts of 2-3/8" tbg with 4-1/2" RBP (4-1/2" 11.6# I-80). Set RBP at +/- 7500' (Collars at 7483' and 7526'). Spot 2 sx sand on top of RBP. TOOHH. Stand back tbg.  
12 Pressure test RBP to 1000 psi for 15 minutes. If pressure test passes, proceed.  
13 ND BOP, ND tbg head. Unland 4-1/2" 11.6# I-80 csg (Do not exceed 130,000-lb pull weight). NU double entry flange, NU BOP.  
14 PU and TIH with 1700' of 1-1/4" tbg outside 4-1/2" csg (should be +/- 57 jts).  
15 Circulate and condition hole with ~110 bbls of water with rig pump (1.5x annular volume from 1700'), or until well is completely dead. Spot 40 bbls of 10 ppg drilling mud.  
16 TOOHH with 7 jts 1-1/4" tbg to 1500'.  
17 MIRU cement company. Commence pumping cement job consisting of 5 bbls fresh water, 20 bbls sodium metasilicate and 5 bbls fresh water followed with 130 sx of Control Set "C" cement with 1/4 lb/sk cello-flake mixed at 13.5 ppg and 1.74 cf/sk (cement from 1500' to 874'. 8.75" hole avg from caliper, adding 20% excess).  
18 TOOHH with 27 jts of 1-1/4" tbg to +/- 700' and circulate with drilling mud to clean up.  
19 TOOHH with remaining 1-1/4" tbg and LD.  
20 RMDO cement company.  
21 ND BOP, ND double entry flange, re-land 4-1/2" csg. NU BOP.  
22 Leave well SI for minimum of 24 hours.

**CASING AND CEMENTING CHANGES**

Casing Type	Size	Of	/	Hole	Size	Of	/	Casing	Wt/Ft	Csg/LinTop	Setting Depth	Sacks of Cement	Cement Bottom	Cement Top

**H2S REPORTING**

**Data Fields in this section are intended to document Sample and Location Data associated with the collection of a Gas Sample that is submitted for Laboratory Analysis.**

**Gas Analysis Report must be attached.**

H2S Concentration: \_\_\_\_\_ in ppm (parts per million)

Date of Measurement or Sample Collection \_\_\_\_\_

Description of Sample Point:

Absolute Open Flow Potential \_\_\_\_\_ in CFPD (cubic feet per day)

Description of Release Potential and Duration (If flow is not open to the atmosphere, identify the duration in which the container or pipeline would likely be opened for servicing operations.):

Distance to nearest occupied residence, school, church, park, school bus stop, place of business, or other areas where the public could reasonably be expected to frequent: \_\_\_\_\_

Distance to nearest Federal, State, County, or municipal road or highway owned and principally maintained for public use: \_\_\_\_\_

COMMENTS:

**Best Management Practices**

**No BMP/COA Type**

**Description**

--	--

**Operator Comments:**

23 MIRU WL and run CCL-GR-CBL-VDL from 1700' to surface (cement should be from +/- 1500' to 874'). If Fox Hills plug is not above 874', contact engineering for further instructions. Email logs to engineering and DJVendors@anadarko.com. RDMO WL.  
24 If tbg head is not as described, ND BOP. Install new GE 5000 psi 4-1/2" bottom threaded tbg head with 7-1/16" flanged top, 7-1/16" flanged 5000 psi tbg head adaptor with 2-1/16" studded top, 2-1/16" flanged 5000 psi master valve, flanged 5000 psi 2-3/8" plunger lubricator (side outlets threaded). All valves, fittings, plugs on well head need to be rated for 5000 psi. NU BOP.  
25 Pressure test csg to 5000 psi for 15 mins. If pressure test does not hold, call engineering.  
26 TIH with 2-3/8" tbg and retrieving head to tag sand above RBP at +/- 7500'. Circulate sand off RBP, latch onto RBP and TOOH. SB tbg, LD RBP.  
27 PU and TIH with 2-3/8" NC, 2-3/8" XN, and 251 jts 2-3/8" tbg. If necessary, drop down with extra jts and circulate to cleanout sand. Land end of tbg at +/- 7950' (1 jt above top Codell perf).  
28 ND BOP, NU WH.  
29 GE should pressure test tbg head through test port on side of tbg head adaptor flange to 5000 psi for 15 mins.  
30 RDMO WO rig. Return well to production team.  
31 Clean location and swab well back to production. Notify field foreman/field coordinator of finished work and turn well back over to production team.

I hereby certify all statements made in this form are, to the best of my knowledge, true, correct, and complete.

Signed: \_\_\_\_\_ Print Name: Cheryl Light  
Title: Sr. Regulatory Analyst Email: DJRegulatory@anadarko.com Date: \_\_\_\_\_

Based on the information provided herein, this Sundry Notice (Form 4) complies with COGCC Rules and applicable orders and is hereby approved.

COGCC Approved: \_\_\_\_\_ Date: \_\_\_\_\_

**CONDITIONS OF APPROVAL, IF ANY:****General Comments**

<u>User Group</u>	<u>Comment</u>	<u>Comment Date</u>

Total: 0 comment(s)

**Attachment Check List**

<u>Att Doc Num</u>	<u>Name</u>
400740603	OTHER

Total Attach: 1 Files