

FORM  
6Rev  
12/05State of Colorado  
Oil and Gas Conservation Commission

1120 Lincoln Street, Suite 801, Denver, Colorado 80203 Phone: (303) 894-2100 Fax: (303) 894-2109



DE ET OE ES

Document Number:

400747251

Date Received:

## WELL ABANDONMENT REPORT

This form is to be submitted as an Intent to Abandon whenever an abandonment is planned on a borehole. After the abandonment is complete, this form shall again be submitted as a Subsequent Report of the actual work completed. The approved intent shall be valid for six months after the approval date, after that period, a new intent will be required. Attachments required with the Intent to Abandon are wellbore diagrams of the current configuration and the proposed configuration with plugs set.

A Subsequent Report of Abandonment shall indicate the actual work completed. Attachments required with a Subsequent Report are a wellbore diagram showing plugs that were set and casing remaining in the hole, the job summaries from all plugging contractors used, including wireline and cementing (third party verification) and any logs that may have been run during abandonment.

OGCC Operator Number: 69175

Contact Name: Jenfier Hakkarinen

Name of Operator: PDC ENERGY INC

Phone: (303) 8605800

Address: 1775 SHERMAN STREET - STE 3000

Fax:

City: DENVER State: CO Zip: 80203

Email: Jenifer.Hakkarinen@pdce.com

For "Intent" 24 hour notice required,

Name: Rains, Bill

Tel: (970) 590-6480

COGCC contact:

Email: bill.rains@state.co.us

API Number 05-123-19436-00

Well Name: STATE 6525

Well Number: 33-32

Location: QtrQtr: NWSE Section: 32 Township: 6N Range: 63W Meridian: 6

County: WELD

Federal, Indian or State Lease Number: 59424

Field Name: WATTENBERG

Field Number: 90750

☒ Notice of Intent to Abandon☐ Subsequent Report of Abandonment

## Only Complete the Following Background Information for Intent to Abandon

Latitude: 40.441110

Longitude: -104.458440

GPS Data:

Date of Measurement: 07/02/2007

PDOP Reading: 1.9

GPS Instrument Operator's Name: Holly L. Tracy

Reason for Abandonment: ☐ Dry ☐ Production for Sub-economic ☒ Mechanical Problems☐ OtherCasing to be pulled: ☒ Yes ☐ No

Estimated Depth: 3570

Fish in Hole: ☐ Yes ☒ No If yes, explain details belowWellbore has Uncemented Casing leaks: ☒ Yes ☐ No If yes, explain details below

Details: PDC moved to well to preform MIT, found holes in casing. Set cast iron bridge plug with 2 sx of cement. See doc#400633076

## Current and Previously Abandoned Zones

Formation	Perf. Top	Perf. Btm	Abandoned Date	Method of Isolation	Plug Depth
CODELL	6776	6786			

Total: 1 zone(s)

## Casing History

Casing Type	Size of Hole	Size of Casing	Weight Per Foot	Setting Depth	Sacks Cement	Cement Bot	Cement Top	Status
SURF	12+1/4	8+5/8	24	315	220	315	0	
1ST	7	3+1/2	9.2	6,911	310	6,911	3,580	

## Plugging Procedure for Intent and Subsequent Report

CIBP #1: Depth 6684 with 2 sacks cmt on top. CIBP #2: Depth \_\_\_\_\_ with \_\_\_\_\_ sacks cmt on top.  
CIBP #3: Depth \_\_\_\_\_ with \_\_\_\_\_ sacks cmt on top. CIBP #4: Depth \_\_\_\_\_ with \_\_\_\_\_ sacks cmt on top.  
CIBP #5: Depth \_\_\_\_\_ with \_\_\_\_\_ sacks cmt on top.

NOTE: Two(2) sacks cement required on all CIBPs.

Set 50 sks cmt from 3000 ft. to 3600 ft. Plug Type: STUB PLUG Plug Tagged: ☒

Set \_\_\_\_\_ sks cmt from \_\_\_\_\_ ft. to \_\_\_\_\_ ft. Plug Type: \_\_\_\_\_ Plug Tagged: ☐

Set \_\_\_\_\_ sks cmt from \_\_\_\_\_ ft. to \_\_\_\_\_ ft. Plug Type: \_\_\_\_\_ Plug Tagged: ☐

Set \_\_\_\_\_ sks cmt from \_\_\_\_\_ ft. to \_\_\_\_\_ ft. Plug Type: \_\_\_\_\_ Plug Tagged: ☐

Set \_\_\_\_\_ sks cmt from \_\_\_\_\_ ft. to \_\_\_\_\_ ft. Plug Type: \_\_\_\_\_ Plug Tagged: ☐

Perforate and squeeze at \_\_\_\_\_ ft. with \_\_\_\_\_ sacks. Leave at least 100 ft. in casing \_\_\_\_\_ CICR Depth

Perforate and squeeze at \_\_\_\_\_ ft. with \_\_\_\_\_ sacks. Leave at least 100 ft. in casing \_\_\_\_\_ CICR Depth

Perforate and squeeze at \_\_\_\_\_ ft. with \_\_\_\_\_ sacks. Leave at least 100 ft. in casing \_\_\_\_\_ CICR Depth

(Cast Iron Cement Retainer Depth)

Set 150 sacks half in. half out surface casing from 480 ft. to 0 ft. Plug Tagged: ☒

Set \_\_\_\_\_ sacks at surface

Cut four feet below ground level, weld on plate Above Ground Dry-Hole Marker: ☐ Yes ☐ No

Set \_\_\_\_\_ sacks in rat hole Set \_\_\_\_\_ sacks in mouse hole

### Additional Plugging Information for Subsequent Report Only

Casing Recovered: \_\_\_\_\_ ft. of \_\_\_\_\_ inch casing Plugging Date: \_\_\_\_\_

\*Wireline Contractor: \_\_\_\_\_ \*Cementing Contractor: \_\_\_\_\_

Type of Cement and Additives Used: \_\_\_\_\_

Flowline/Pipeline has been abandoned per Rule 1103 ☐ Yes ☐ No \*ATTACH JOB SUMMARY

Technical Detail/Comments:

Plugging Procedure

Codell

Existing Perforations:

Codell: 6776'-6786'

PBTD: 7006'

8 5/8" 24# @ 315' w/ 220 sks cmt

3 1/2" 9.2# @ 6911' w/ 310 sks cmt (TOC @ 3580')

Procedure:

1. MIRU wireline

2. RIH tag plug at @ 6684'

3. RIH w/dump bailer, bail 2 sx of cement on top of plug

4. RIH w/ casing cutter, cut @ 3570'

5. TIH set 50 sack stub plug @ casing stub (3000'-3600')

6. TOH and set 150 sack cement plug half in half out of surface casing from 480' to surface

7. Cut casing and weld on cap

I hereby certify all statements made in this form are, to the best of my knowledge, true, correct, and complete.

Signed: \_\_\_\_\_ Print Name: Jenifer Hakkarinen

Title: Regulatory Tech Date: \_\_\_\_\_ Email: Jenifer.Hakkarinen@pdce.com

Based on the information provided herein, this Well Abandonment Report (Form 6) complies with COGCC Rules and applicable orders and is hereby approved.

COGCC Approved: \_\_\_\_\_ Date: \_\_\_\_\_

CONDITIONS OF APPROVAL, IF ANY: \_\_\_\_\_

Expiration Date: \_\_\_\_\_

### **Attachment Check List**

**Att Doc Num**

**Name**

400748673	WELLBORE DIAGRAM
400748674	WELLBORE DIAGRAM

Total Attach: 2 Files

### **General Comments**

**User Group**

**Comment**

**Comment Date**

--	--	--

Total: 0 comment(s)