

Document Number:  
400768815

Date Received:

**WELL ABANDONMENT REPORT**

This form is to be submitted as an Intent to Abandon whenever an abandonment is planned on a borehole. After the abandonment is complete, this form shall again be submitted as a Subsequent Report of the actual work completed. The approved intent shall be valid for six months after the approval date, after that period, a new intent will be required. Attachments required with the Intent to Abandon are wellbore diagrams of the current configuration and the proposed configuration with plugs set. A Subsequent Report of Abandonment shall indicate the actual work completed. Attachments required with a Subsequent Report are a wellbore diagram showing plugs that were set and casing remaining in the hole, the job summaries from all plugging contractors used, including wireline and cementing (third party verification) and any logs that may have been run during abandonment.

OGCC Operator Number: 69175 Contact Name: Jenifer Hakkarinen  
 Name of Operator: PDC ENERGY INC Phone: (303) 8605800  
 Address: 1775 SHERMAN STREET - STE 3000 Fax: \_\_\_\_\_  
 City: DENVER State: CO Zip: 80203 Email: Jenifer.Hakkarinen@pdce.com

**For "Intent" 24 hour notice required,** Name: \_\_\_\_\_ Tel: \_\_\_\_\_  
 Email: \_\_\_\_\_

**COGCC contact:** \_\_\_\_\_

API Number 05-123-17224-00 Well Number: 14-8  
 Well Name: WARNER W  
 Location: QtrQtr: SENE Section: 14 Township: 2N Range: 66W Meridian: 6  
 County: WELD Federal, Indian or State Lease Number: \_\_\_\_\_  
 Field Name: WATTENBERG Field Number: 90750

Notice of Intent to Abandon  Subsequent Report of Abandonment

*Only Complete the Following Background Information for Intent to Abandon*

Latitude: 40.140000 Longitude: -104.737500  
 GPS Data:  
 Date of Measurement: 06/24/2010 PDOP Reading: 2.3 GPS Instrument Operator's Name: Shantell Kling  
 Reason for Abandonment:  Dry  Production for Sub-economic  Mechanical Problems  
 Other \_\_\_\_\_  
 Casing to be pulled:  Yes  No Estimated Depth: \_\_\_\_\_  
 Fish in Hole:  Yes  No If yes, explain details below  
 Wellbore has Uncemented Casing leaks:  Yes  No If yes, explain details below  
 Details: \_\_\_\_\_

**Current and Previously Abandoned Zones**

Formation	Perf. Top	Perf. Btm	Abandoned Date	Method of Isolation	Plug Depth
CODELL	7507	7523	05/08/2014	B PLUG CEMENT TOP	7430
Total: 1 zone(s)					

**Casing History**

Casing Type	Size of Hole	Size of Casing	Weight Per Foot	Setting Depth	Sacks Cement	Cement Bot	Cement Top	Status
SURF	12+1/2	8+5/8	24	907	630	907	0	CALC
1ST	7+7/8	2+7/8	8.7	7,675	275	7,675	6,615	CBL

## Plugging Procedure for Intent and Subsequent Report

CIBP #1: Depth 7430 with 2 sacks cmt on top. CIBP #2: Depth \_\_\_\_\_ with \_\_\_\_\_ sacks cmt on top.  
CIBP #3: Depth \_\_\_\_\_ with \_\_\_\_\_ sacks cmt on top. CIBP #4: Depth \_\_\_\_\_ with \_\_\_\_\_ sacks cmt on top.  
CIBP #5: Depth \_\_\_\_\_ with \_\_\_\_\_ sacks cmt on top.

NOTE: Two(2) sacks cement required on all CIBPs.

Set 50 sks cmt from 5315 ft. to 5485 ft. Plug Type: STUB PLUG Plug Tagged:   
Set 245 sks cmt from 4168 ft. to 5001 ft. Plug Type: OPEN HOLE Plug Tagged:   
Set \_\_\_\_\_ sks cmt from \_\_\_\_\_ ft. to \_\_\_\_\_ ft. Plug Type: \_\_\_\_\_ Plug Tagged:   
Set \_\_\_\_\_ sks cmt from \_\_\_\_\_ ft. to \_\_\_\_\_ ft. Plug Type: \_\_\_\_\_ Plug Tagged:   
Set \_\_\_\_\_ sks cmt from \_\_\_\_\_ ft. to \_\_\_\_\_ ft. Plug Type: \_\_\_\_\_ Plug Tagged:   
Perforate and squeeze at \_\_\_\_\_ ft. with \_\_\_\_\_ sacks. Leave at least 100 ft. in casing \_\_\_\_\_ CICR Depth  
Perforate and squeeze at \_\_\_\_\_ ft. with \_\_\_\_\_ sacks. Leave at least 100 ft. in casing \_\_\_\_\_ CICR Depth  
Perforate and squeeze at \_\_\_\_\_ ft. with \_\_\_\_\_ sacks. Leave at least 100 ft. in casing \_\_\_\_\_ CICR Depth  
(Cast Iron Cement Retainer Depth)  
Set 320 sacks half in. half out surface casing from 972 ft. to 0 ft. Plug Tagged:   
Set 10 sacks at surface  
Cut four feet below ground level, weld on plate Above Ground Dry-Hole Marker:  Yes  No  
Set \_\_\_\_\_ sacks in rat hole Set \_\_\_\_\_ sacks in mouse hole

### Additional Plugging Information for Subsequent Report Only

Casing Recovered: 5845 ft. of 2+7/8 inch casing Plugging Date: 05/08/2014  
\*Wireline Contractor: Magna \*Cementing Contractor: Magna  
Type of Cement and Additives Used: \_\_\_\_\_  
Flowline/Pipeline has been abandoned per Rule 1103  Yes  No \*ATTACH JOB SUMMARY

Technical Detail/Comments:

Plugging Procedure  
Codell  
Existing Perforations:  
Codell: 7507'-7523'  
PBSD: 7610'  
8 5/8" 24# Casing set @ 907' cemented w/ 630 sx (TOC @ Surface)  
2 7/8" 8.7# Casing set @ 7675' cemented w/ 275 sx (TOC @ 6615')  
Procedure:  
1)MIRU wireline  
2)RIH w/CIBP set @ 7430'  
3)RIH w/dump bailer and dump 2 sx cement on top of CIBP @ 7430'  
4)RIH w/casing cutter, cut & pull casing @ ~5485'  
5)TIH set 50 sack plug @ casing stub (5315'-5485')  
7)TOH to set 245 sack plug @ Parkman/Sussex (4168'-5001')  
8)TOH and set 320 sack cement plug half in half out of surface casing from 972' to surface  
9)Set 10 sx @ top of surface  
10)Cut casing and weld on cap

I hereby certify all statements made in this form are, to the best of my knowledge, true, correct, and complete.

Signed: \_\_\_\_\_ Print Name: Jenifer Hakkarinen  
Title: Regulatory Tech Date: \_\_\_\_\_ Email: Jenifer.Hakkarinen@pdce.com

Based on the information provided herein, this Well Abandonment Report (Form 6) complies with COGCC Rules and applicable orders and is hereby approved.

COGCC Approved: \_\_\_\_\_

Date: \_\_\_\_\_

**CONDITIONS OF APPROVAL, IF ANY:**

**Attachment Check List**

<b>Att Doc Num</b>	<b>Name</b>
400768817	WELLBORE DIAGRAM
400768818	CEMENT JOB SUMMARY
400768820	WIRELINE JOB SUMMARY

Total Attach: 3 Files

**General Comments**

<b>User Group</b>	<b>Comment</b>	<b>Comment Date</b>

Total: 0 comment(s)