

FORM
6Rev
12/05

State of Colorado

Oil and Gas Conservation Commission

1120 Lincoln Street, Suite 801, Denver, Colorado 80203 Phone: (303) 894-2100 Fax: (303) 894-2109



DE ET OE ES

Replug By Other Operator

Document Number:

400790950

Date Received:

02/12/2015

WELL ABANDONMENT REPORT

This form is to be submitted as an Intent to Abandon whenever an abandonment is planned on a borehole. After the abandonment is complete, this form shall again be submitted as a Subsequent Report of the actual work completed. The approved intent shall be valid for six months after the approval date, after that period, a new intent will be required. Attachments required with the Intent to Abandon are wellbore diagrams of the current configuration and the proposed configuration with plugs set.

A Subsequent Report of Abandonment shall indicate the actual work completed. Attachments required with a Subsequent Report are a wellbore diagram showing plugs that were set and casing remaining in the hole, the job summaries from all plugging contractors used, including wireline and cementing (third party verification) and any logs that may have been run during abandonment.

OGCC Operator Number: 100322

Contact Name: Hunter Dunham

Name of Operator: NOBLE ENERGY INC

Phone: (303) 228-4308

Address: 1625 BROADWAY STE 2200

Fax: (303) 228-4286

City: DENVER State: CO Zip: 80202

Email: hdunham@nobleenergyinc.com

For "Intent" 24 hour notice required,

Name: Rains, Bill

Tel: (970) 590-6480

COGCC contact:

Email: bill.rains@state.co.us

API Number 05-123-20367-00

Well Name: STATE 6525

Well Number: 11-32

Location: QtrQtr: NWNW Section: 32 Township: 6N Range: 63W Meridian: 6

County: WELD

Federal, Indian or State Lease Number:

Field Name: WATTENBERG

Field Number: 90750

☒ Notice of Intent to Abandon☐ Subsequent Report of Abandonment

Only Complete the Following Background Information for Intent to Abandon

Latitude: 40.448055

Longitude: -104.467822

GPS Data:

Date of Measurement: PDOP Reading: GPS Instrument Operator's Name:

Reason for Abandonment: ☐ Dry ☐ Production for Sub-economic ☐ Mechanical Problems☒ Other ReEnter well, set plug, PA well w/new cement.Casing to be pulled: ☐ Yes ☐ No Estimated Depth:Fish in Hole: ☐ Yes ☐ No If yes, explain details belowWellbore has Uncemented Casing leaks: ☐ Yes ☒ No If yes, explain details below

Details: See attached procedure of ReEntry and new PA.

Current and Previously Abandoned Zones

Formation	Perf. Top	Perf. Btm	Abandoned Date	Method of Isolation	Plug Depth

Total: 0 zone(s)

Casing History

Casing Type	Size of Hole	Size of Casing	Weight Per Foot	Setting Depth	Sacks Cement	Cement Bot	Cement Top	Status
SURF	13+3/4	8+5/8	24	399	280	399	0	
OPEN HOLE	7+7/8			6,987				

Plugging Procedure for Intent and Subsequent Report

CIBP #1: Depth _____ with _____ sacks cmt on top. CIBP #2: Depth _____ with _____ sacks cmt on top.
CIBP #3: Depth _____ with _____ sacks cmt on top. CIBP #4: Depth _____ with _____ sacks cmt on top.
CIBP #5: Depth _____ with _____ sacks cmt on top.

NOTE: Two(2) sacks cement required on all CIBPs.

Set	50	sks cmt from	6530	ft. to	6530	ft.	Plug Type:	OPEN HOLE	Plug Tagged:	<input type="checkbox"/>
Set	100	sks cmt from	3000	ft. to	2725	ft.	Plug Type:	OPEN HOLE	Plug Tagged:	<input type="checkbox"/>
Set	265	sks cmt from	700	ft. to	0	ft.	Plug Type:	OPEN HOLE	Plug Tagged:	<input type="checkbox"/>
Set	_____	sks cmt from	_____	ft. to	_____	ft.	Plug Type:	_____	Plug Tagged:	<input type="checkbox"/>
Set	_____	sks cmt from	_____	ft. to	_____	ft.	Plug Type:	_____	Plug Tagged:	<input type="checkbox"/>

Perforate and squeeze at _____ ft. with _____ sacks. Leave at least 100 ft. in casing _____ CICR Depth

Perforate and squeeze at _____ ft. with _____ sacks. Leave at least 100 ft. in casing _____ CICR Depth

Perforate and squeeze at _____ ft. with _____ sacks. Leave at least 100 ft. in casing _____ CICR Depth

(Cast Iron Cement Retainer Depth)

Set _____ sacks half in. half out surface casing from _____ ft. to _____ ft. Plug Tagged: ☐

Set _____ sacks at surface

Cut four feet below ground level, weld on plate Above Ground Dry-Hole Marker: ☐ Yes ☐ No

Set _____ sacks in rat hole Set _____ sacks in mouse hole

Additional Plugging Information for Subsequent Report Only

Casing Recovered: _____ ft. of _____ inch casing Plugging Date: _____

*Wireline Contractor: _____ *Cementing Contractor: _____

Type of Cement and Additives Used: _____

Flowline/Pipeline has been abandoned per Rule 1103 ☐ Yes ☐ No *ATTACH JOB SUMMARY

Technical Detail/Comments:

- 1) Survey and locate abandoned well, mark with stake
- 2) Excavate to expose top of surface casing
- 3) Weld 2" collar to top of 8 5/8" surface casing cap. Make up to collar, pneumatic drill with non-sparking bit. Drill out cap venting possible trapped gas.
- 4) Once verified that no gas exists beneath top of surface casing plate, cut off surface casing below plate with torch, dress up smooth.
- 5) Butt weld 8 5/8" casing to dressed cut, bringing threaded end of casing to ground level.
- 6) Make up to 8 5/8" casing, one 8 5/8" collar and 8 5/8" starter well head
- 7) NU flange adaptor and 5k BOP, test BOP.
- 8) NU and RIH with 6 7/8" cone bit, PU 2 7/8" drill collar, 2 7/8" 8.7# tubing, and TIW valve
- 9) Drill out first cement plug inside surface casing, roll hole clean. Verify top of next cement plug inside of surface casing by tagging (near 350').
- 10) If unable to verify isolation of surface casing with tag of cement plug, set RBP inside surface casing
- 11) Once isolation of surface casing is established, either with tagging of surface plug or setting of RBP, pressure test surface casing to 200psi
- 12) After pressure test of surface casing, retrieve RBP or continue drill out of cement plug under surface casing shoe.
- 13) Assume pressure under surface casing shoe, roll hole with kill fluid until well dead, or blow down.
- 14) Continue RIH, cleaning out with drilling mud or water to 3000'
- 15) TOOH with cone bit, drill collars, and 2 7/8" tubing.
- 16) PU and RIH with mule shoe and 2 7/8" tubing to 3000'
- 17) RU cement crew and pump 100sk 15.8 ppg Class G "neat" cement
- 18) POOH to 700' (100' below base of Fox Hills @ 600')
- 19) RU cement crew and pump 265sk 15.8 ppg Class G "neat" cement. Bring to surface
- 20) POOH with 2 7/8" tubing. Wait 4 hrs, and tag TOC. If cement has fallen, top off back to surface
- 21) Let cement set over night, verify cement has not settled and is still at surface. RDMO
- 22) Excavate around wellhead to 8' below grade, cut off 8 5/8" casing, weld on cap
- 23) Backfill hole and reclaim surface to original conditions

I hereby certify all statements made in this form are, to the best of my knowledge, true, correct, and complete.

Signed: _____ Print Name: Eileen Roberts
Title: Regulatory Analyst I Date: 2/12/2015 Email: eroberts@nobleenergyinc.com

Based on the information provided herein, this Well Abandonment Report (Form 6) complies with COGCC Rules and applicable orders and is hereby approved.

COGCC Approved: HICKEY, MIKE Date: 2/23/2015

CONDITIONS OF APPROVAL, IF ANY: _____ Expiration Date: 8/22/2015

<u>COA Type</u>	<u>Description</u>
	1) Submit Form 42 electronically to COGCC 48 hours prior to MIRU. 2) For 700' plug: pump plug and displace. If cement is not circulated to surface, shut-in, WOC 4 hours and tag plug – must be 349' or shallower. Leave at least 100' of cement in the wellbore for each plug. 3) Properly abandon flowlines as per Rule 1103. Once flowlines are properly abandoned, file electronic form 42.

Attachment Check List

<u>Att Doc Num</u>	<u>Name</u>
400790950	FORM 6 INTENT SUBMITTED
400790991	WELLBORE DIAGRAM
400790992	LOCATION PHOTO
400790994	WELLBORE DIAGRAM
400790995	SURFACE AGRMT/SURETY

Total Attach: 5 Files

General Comments

<u>User Group</u>	<u>Comment</u>	<u>Comment Date</u>
Permit	Well was drilled and abandoned. 1337377 Drilling Completion Report 05/07/2002	2/12/2015 2:04:21 PM

Total: 1 comment(s)