

FORM  
6Rev  
12/05

# State of Colorado Oil and Gas Conservation Commission

1120 Lincoln Street, Suite 801, Denver, Colorado 80203 Phone: (303) 894-2100 Fax: (303) 894-2109



DE	ET	OE	ES
----	----	----	----

Document Number:

400814043

Date Received:

## WELL ABANDONMENT REPORT

This form is to be submitted as an Intent to Abandon whenever an abandonment is planned on a borehole. After the abandonment is complete, this form shall again be submitted as a Subsequent Report of the actual work completed. The approved intent shall be valid for six months after the approval date, after that period, a new intent will be required. Attachments required with the Intent to Abandon are wellbore diagrams of the current configuration and the proposed configuration with plugs set.

A Subsequent Report of Abandonment shall indicate the actual work completed. Attachments required with a Subsequent Report are a wellbore diagram showing plugs that were set and casing remaining in the hole, the job summaries from all plugging contractors used, including wireline and cementing (third party verification) and any logs that may have been run during abandonment.

OGCC Operator Number: 69175

Contact Name: Jenifer Hakkarinen

Name of Operator: PDC ENERGY INC

Phone: (303) 8605800

Address: 1775 SHERMAN STREET - STE 3000

Fax:

City: DENVER State: CO Zip: 80203

Email: Jenifer.Hakkarinen@pdce.com

**For "Intent" 24 hour notice required,**

Name: Gomez, Jason

Tel: (970) 573-1277

**COGCC contact:**

Email: jason.gomez@state.co.us

API Number 05-123-14877-00

Well Name: SCHAFTER

Well Number: 2

Location: QtrQtr: NWSE Section: 8 Township: 6N Range: 65W Meridian: 6

County: WELD

Federal, Indian or State Lease Number: 55996

Field Name: EATON

Field Number: 19350

☒ Notice of Intent to Abandon☐ Subsequent Report of Abandonment

### Only Complete the Following Background Information for Intent to Abandon

Latitude: 40.499283

Longitude: -104.685699

GPS Data:

Date of Measurement: 01/16/2010

PDOP Reading: 2.6

GPS Instrument Operator's Name: Brandon Lucason

Reason for Abandonment:

☐ Dry☒ Production for Sub-economic☐ Mechanical Problems☐ OtherCasing to be pulled: ☒ Yes☐ No

Estimated Depth: 6175

Fish in Hole: ☐ Yes☒ No

If yes, explain details below

Wellbore has Uncemented Casing leaks:

☐ Yes☒ No

If yes, explain details below

Details:

### Current and Previously Abandoned Zones

Formation	Perf. Top	Perf. Btm	Abandoned Date	Method of Isolation	Plug Depth
CODELL	7135	7145			

Total: 1 zone(s)

### Casing History

Casing Type	Size of Hole	Size of Casing	Weight Per Foot	Setting Depth	Sacks Cement	Cement Bot	Cement Top	Status
SURF	12+1/4	8+5/8	24	397	285	397	0	
1ST	7+7/8	4+1/2	15.1	7,302	170	7,302	6,276	

## Plugging Procedure for Intent and Subsequent Report

CIBP #1: Depth 7075 with 30 sacks cmt on top. CIBP #2: Depth \_\_\_\_\_ with \_\_\_\_\_ sacks cmt on top.  
CIBP #3: Depth \_\_\_\_\_ with \_\_\_\_\_ sacks cmt on top. CIBP #4: Depth \_\_\_\_\_ with \_\_\_\_\_ sacks cmt on top.  
CIBP #5: Depth \_\_\_\_\_ with \_\_\_\_\_ sacks cmt on top.

NOTE: Two(2) sacks cement required on all CIBPs.

Set 50 sks cmt from 6020 ft. to 6175 ft. Plug Type: STUB PLUG Plug Tagged: ☒

Set 350 sks cmt from 3515 ft. to 4600 ft. Plug Type: OPEN HOLE Plug Tagged: ☒

Set \_\_\_\_\_ sks cmt from \_\_\_\_\_ ft. to \_\_\_\_\_ ft. Plug Type: \_\_\_\_\_ Plug Tagged: ☐

Set \_\_\_\_\_ sks cmt from \_\_\_\_\_ ft. to \_\_\_\_\_ ft. Plug Type: \_\_\_\_\_ Plug Tagged: ☐

Set \_\_\_\_\_ sks cmt from \_\_\_\_\_ ft. to \_\_\_\_\_ ft. Plug Type: \_\_\_\_\_ Plug Tagged: ☐

Perforate and squeeze at \_\_\_\_\_ ft. with \_\_\_\_\_ sacks. Leave at least 100 ft. in casing \_\_\_\_\_ CICR Depth

Perforate and squeeze at \_\_\_\_\_ ft. with \_\_\_\_\_ sacks. Leave at least 100 ft. in casing \_\_\_\_\_ CICR Depth

Perforate and squeeze at \_\_\_\_\_ ft. with \_\_\_\_\_ sacks. Leave at least 100 ft. in casing \_\_\_\_\_ CICR Depth

(Cast Iron Cement Retainer Depth)

Set 300 sacks half in. half out surface casing from 600 ft. to 0 ft. Plug Tagged: ☒

Set \_\_\_\_\_ sacks at surface

Cut four feet below ground level, weld on plate Above Ground Dry-Hole Marker: ☐ Yes ☐ No

Set \_\_\_\_\_ sacks in rat hole Set \_\_\_\_\_ sacks in mouse hole

### Additional Plugging Information for Subsequent Report Only

Casing Recovered: \_\_\_\_\_ ft. of \_\_\_\_\_ inch casing Plugging Date: \_\_\_\_\_

\*Wireline Contractor: \_\_\_\_\_ \*Cementing Contractor: \_\_\_\_\_

Type of Cement and Additives Used: \_\_\_\_\_

Flowline/Pipeline has been abandoned per Rule 1103 ☐ Yes ☐ No \*ATTACH JOB SUMMARY

Technical Detail/Comments:

SCHAFTER 2 Plugging Procedure

Codell

Existing Perforations:

Codell: 7135'-7145'

PBTD: 7273'

8 5/8" 24# @ 397' w/ 285 sks cmt (Est.)

4 1/2" 15.1# @ 7302' w/ 170 sks cmt (TOC @ 6276')

Procedure:

1. MIRU wireline

2. RIH, set CIBP @ 7075' (Top of Codell @ 7124')

3. RIH w/dump bailer and dump 30 sx cement on top of CIBP @ 7075' (cement from 6680'-7075'. NIO Top is 6819')

4. RIH w/casing cutter, cut & pull casing @ 6175' (TOC @ 6276')

5. TIH set 50 sack plug @ casing stub (6020'-6175')

6. TOH set 350 sack plug @ 4600' (3515'-4600') to cover Parkman/Sussex

7. TOH set 300 sack cement plug @ 600' to surface

8. Cut casing and weld on cap

9. RDMOL

I hereby certify all statements made in this form are, to the best of my knowledge, true, correct, and complete.

Signed: \_\_\_\_\_ Print Name: Jenifer Hakkarinen

Title: Regulatory Tech Date: \_\_\_\_\_ Email: Jenifer.Hakkarinen@pdce.com

Based on the information provided herein, this Well Abandonment Report (Form 6) complies with COGCC Rules and applicable orders and is hereby approved.

COGCC Approved: \_\_\_\_\_ Date: \_\_\_\_\_

**CONDITIONS OF APPROVAL, IF ANY:** \_\_\_\_\_

Expiration Date: \_\_\_\_\_

**Attachment Check List**

**Att Doc Num**

**Name**

400814347	WELLBORE DIAGRAM
400814348	WELLBORE DIAGRAM

Total Attach: 2 Files

**General Comments**

**User Group**

**Comment**

**Comment Date**

--	--	--

Total: 0 comment(s)