

FORM
6Rev
12/05State of Colorado
Oil and Gas Conservation Commission

1120 Lincoln Street, Suite 801, Denver, Colorado 80203 Phone: (303) 894-2100 Fax: (303) 894-2109



DE	ET	OE	ES
Document Number: 400835107			
Date Received:			

WELL ABANDONMENT REPORT

This form is to be submitted as an Intent to Abandon whenever an abandonment is planned on a borehole. After the abandonment is complete, this form shall again be submitted as a Subsequent Report of the actual work completed. The approved intent shall be valid for six months after the approval date, after that period, a new intent will be required. Attachments required with the Intent to Abandon are wellbore diagrams of the current configuration and the proposed configuration with plugs set. A Subsequent Report of Abandonment shall indicate the actual work completed. Attachments required with a Subsequent Report are a wellbore diagram showing plugs that were set and casing remaining in the hole, the job summaries from all plugging contractors used, including wireline and cementing (third party verification) and any logs that may have been run during abandonment.

OGCC Operator Number: 69175	Contact Name: Jenifer Hakkarinen
Name of Operator: PDC ENERGY INC	Phone: (303) 8605800
Address: 1775 SHERMAN STREET - STE 3000	Fax:
City: DENVER State: CO Zip: 80203	Email: Jenifer.Hakkarinen@pdce.com
For "Intent" 24 hour notice required, Name: Montoya, John Tel: (970) 397-4124	
COGCC contact: Email: john.montoya@state.co.us	

API Number 05-123-23066-00	Well Number: 7
Well Name: BECKER	
Location: QtrQtr: SW Section: 5 Township: 3N Range: 64W Meridian: 6	
County: WELD	Federal, Indian or State Lease Number:
Field Name: WATTENBERG	Field Number: 90750

☒ Notice of Intent to Abandon ☐ Subsequent Report of Abandonment

Only Complete the Following Background Information for Intent to Abandon

Latitude: 40.251207	Longitude: -104.579540
GPS Data:	
Date of Measurement: 12/20/2010	PDOP Reading: 3.0
GPS Instrument Operator's Name: Brandon Lucason	
Reason for Abandonment: <input type="checkbox"/> Dry <input checked="" type="checkbox"/> Production for Sub-economic <input type="checkbox"/> Mechanical Problems	
<input type="checkbox"/> Other	
Casing to be pulled: <input checked="" type="checkbox"/> Yes <input type="checkbox"/> No	Estimated Depth: 850
Fish in Hole: <input type="checkbox"/> Yes <input checked="" type="checkbox"/> No	If yes, explain details below
Wellbore has Uncemented Casing leaks: <input type="checkbox"/> Yes <input checked="" type="checkbox"/> No	If yes, explain details below
Details:	

Current and Previously Abandoned Zones

Formation	Perf. Top	Perf. Btm	Abandoned Date	Method of Isolation	Plug Depth
CODELL	6973	6987			
NIOBRARA	6698	6768			
Total: 2 zone(s)					

Casing History

Casing Type	Size of Hole	Size of Casing	Weight Per Foot	Setting Depth	Sacks Cement	Cement Bot	Cement Top	Status
SURF	12+1/4	8+5/8	24	563	445	563	0	
1ST	7+7/8	4+1/2	11.6	7,111	645	7,111	948	

Plugging Procedure for Intent and Subsequent Report

CIBP #1: Depth 6600 with 2 sacks cmt on top. CIBP #2: Depth _____ with _____ sacks cmt on top.
CIBP #3: Depth _____ with _____ sacks cmt on top. CIBP #4: Depth _____ with _____ sacks cmt on top.
CIBP #5: Depth _____ with _____ sacks cmt on top.

NOTE: Two(2) sacks cement required on all CIBPs.

Set 300 sks cmt from 850 ft. to 12 ft. Plug Type: STUB PLUG Plug Tagged: ☒

Set _____ sks cmt from _____ ft. to _____ ft. Plug Type: _____ Plug Tagged: ☐

Set _____ sks cmt from _____ ft. to _____ ft. Plug Type: _____ Plug Tagged: ☐

Set _____ sks cmt from _____ ft. to _____ ft. Plug Type: _____ Plug Tagged: ☐

Set _____ sks cmt from _____ ft. to _____ ft. Plug Type: _____ Plug Tagged: ☐

Perforate and squeeze at _____ ft. with _____ sacks. Leave at least 100 ft. in casing _____ CICR Depth

Perforate and squeeze at _____ ft. with _____ sacks. Leave at least 100 ft. in casing _____ CICR Depth

Perforate and squeeze at _____ ft. with _____ sacks. Leave at least 100 ft. in casing _____ CICR Depth

(Cast Iron Cement Retainer Depth)

Set _____ sacks half in. half out surface casing from _____ ft. to _____ ft. Plug Tagged: ☐

Set _____ sacks at surface

Cut four feet below ground level, weld on plate Above Ground Dry-Hole Marker: ☐ Yes ☐ No

Set _____ sacks in rat hole Set _____ sacks in mouse hole

Additional Plugging Information for Subsequent Report Only

Casing Recovered: _____ ft. of _____ inch casing Plugging Date: _____

*Wireline Contractor: _____ *Cementing Contractor: _____

Type of Cement and Additives Used: _____

Flowline/Pipeline has been abandoned per Rule 1103 ☐ Yes ☐ No *ATTACH JOB SUMMARY

Technical Detail/Comments:

Becker 7 (05-123-23066)/Plugging Procedure (Intent)
Producing formation: Niobrara-Codell
Existing Perforations: Niobrara 6698-6768'; Codell 6973'-6987'
TD: 7150' PBD: 7076'
Surface Casing: 8 5/8" 24# @ 563' w/ 445 sks cmt.
Production Casing: 4 1/2" 11.6# @ 7111' w/ 645 sks cmt (TOC 948').

Proposed Procedure:

1. MIRU. Pull production tubing. TIH with tubing and drill bit. Clean out well to 6700'.
2. TIH with CIBP. Set plug at 6600'. TIH with dump bailer. Dump 2 sxs cement on top of CIBP.
3. Cut off 4 1/2" casing at 850'. Pull 4 1/2" casing.
4. TIH with tubing to 900'. RU cementers. Mix and pump 300 sxs of 15.8#/gal CI G cement.
5. Cut casing 6' below ground level and weld on cap.

I hereby certify all statements made in this form are, to the best of my knowledge, true, correct, and complete.

Signed: _____ Print Name: Jenifer Hakkarinen
Title: REg Tech Date: _____ Email: Jenifer.Hakkarinen@pdce.com

Based on the information provided herein, this Well Abandonment Report (Form 6) complies with COGCC Rules and applicable orders and is hereby approved.

COGCC Approved: _____ Date: _____

CONDITIONS OF APPROVAL, IF ANY: _____ Expiration Date: _____

Attachment Check List

Att Doc Num

Name

400835118	WELLBORE DIAGRAM
400835120	WELLBORE DIAGRAM

Total Attach: 2 Files

General Comments

User Group

Comment

Comment Date

--	--	--

Total: 0 comment(s)