


Attachment to Form 6
Diamond Operating Inc.
UPRR Work #1 [API #: 05-075-08156]
Logan County, CO

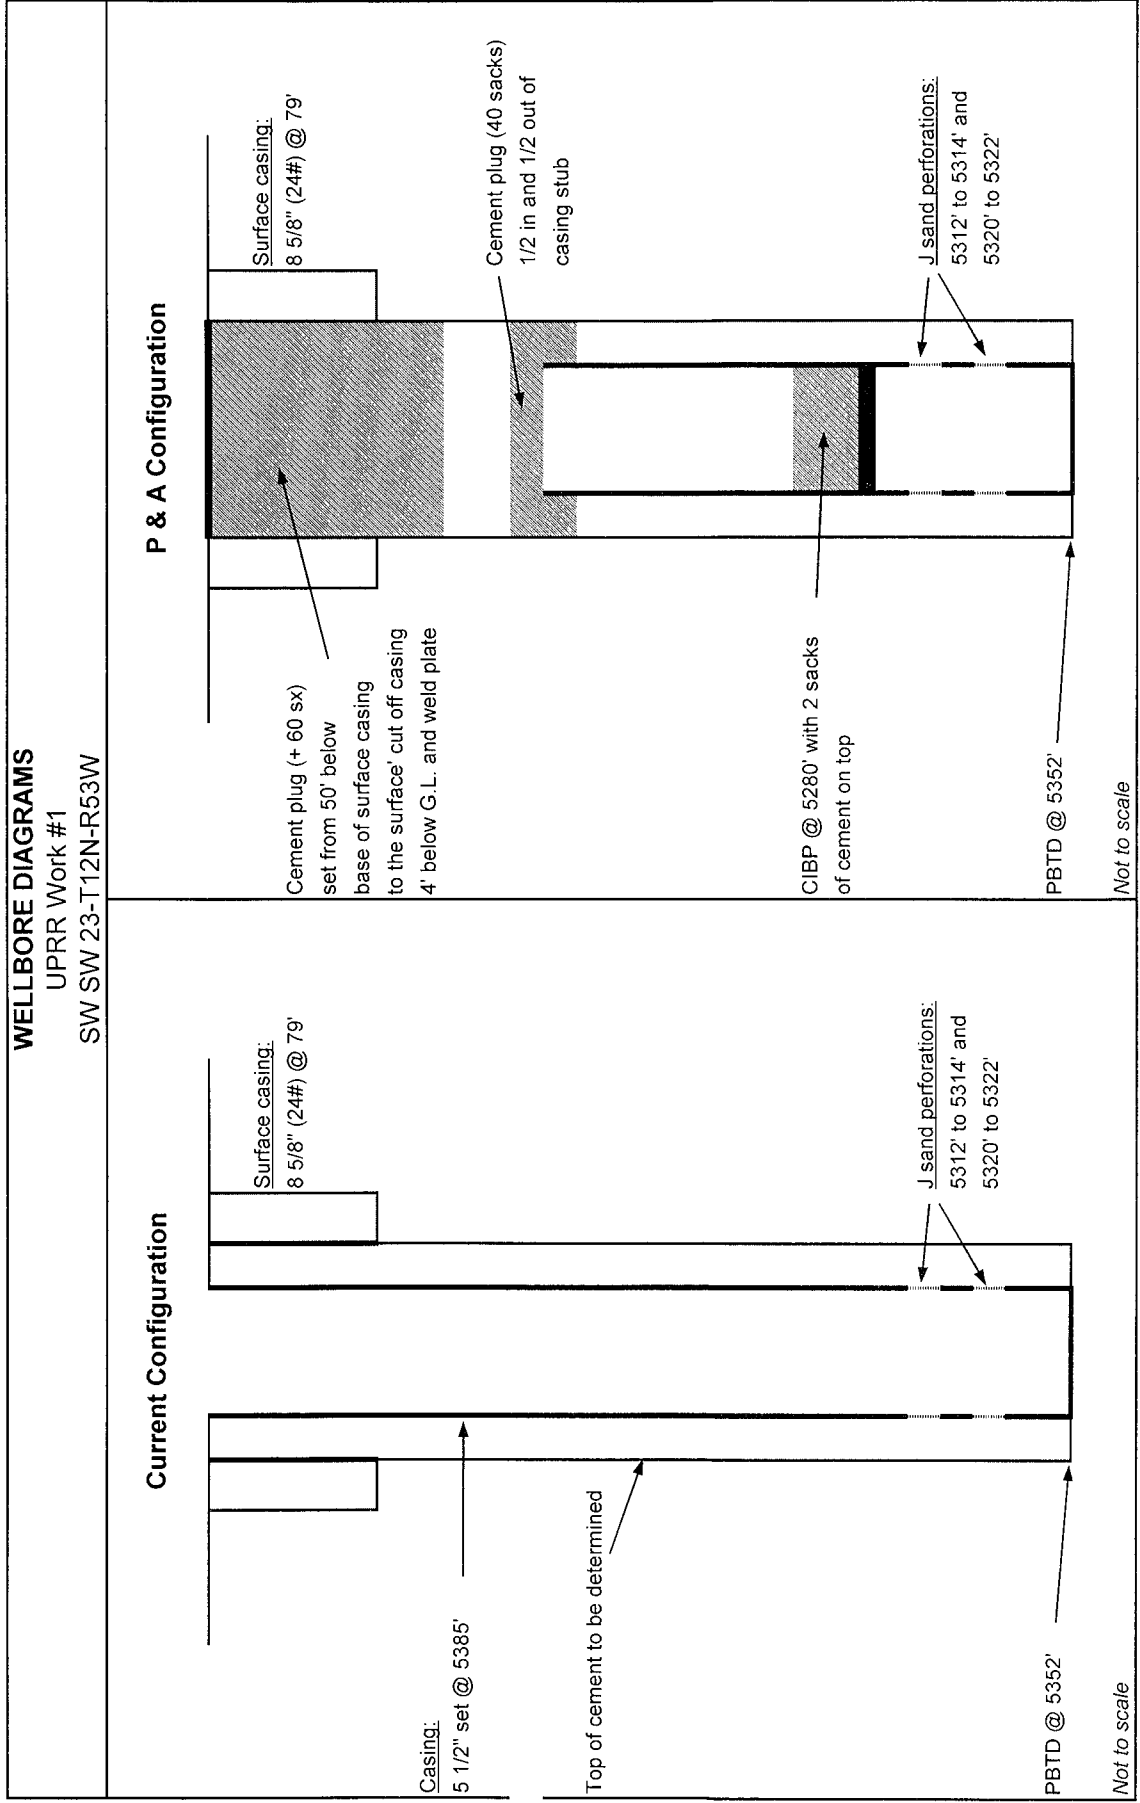

Attachment to Form 6

Diamond Operating, Inc.

UPRR Work #1 [API #: 05-075-08156]

SW SW Section 23-T12N-R53W

Logan County, CO

Technical Details -- P & A Procedure

- 1) Rig up Yetter Well Service and POOH with rods and tubing; LD sucker rods and pump.
- 2) RU JW Wireline and run cement bond log to determine top of cement.
- 3) RIH with CIBP and set at 5280'; set 2 sacks of cement on top with dump bailer.
- 4) Work 5 ½" production casing and cut off at free point; POOH with casing.
- 5) RU circulating equipment and circulate the hole and add gel in order to prevent cement plugs from slipping.
- 6) Set a forty (40) sack cement plug ½ in and ½ out of the casing stub.
- 7) Move up the hole and pump a cement plug from 130' [50' below base of surface casing] to surface.
- 8) Cut off casing 4' below ground level and weld a steel plate on top.