

Keith Caplan

From: Burn - DNR, Diana <diana.burn@state.co.us>
Sent: Wednesday, August 26, 2015 12:19 PM
To: Keith Caplan
Subject: RE: Rig skid guidance

Keith - I am good with the details provided with the skid description standing in for an NOIA.

Thanks,
Diana

On Aug 26, 2015 9:10 AM, "Keith Caplan" <KCaplan@bonanzacrk.com> wrote:

I requested drilling department get updated DD plan and WBD to me today.

Surveyor working on un-official plat and revised MWP.

The replacement well will be drilled 40' North of lost hole. There is a Codell well that was spud between these two spots, on 20' center. None of the other wells in this line will be affected.

I will be submitting the NOI Form 6 and a new APD as directed.

On the Sundry I will include the request to change the name of the lost hole to "Lost NPP31T3434HNB"

Thanks Diana.

Keith S. Caplan

BONANZA CREEK ENERGY, INC

410 17th Street, Suite 1400

Denver, CO 80202

[\(720\) 440-6112](tel:(720)440-6112) direct

[\(303\) 358-8535](tel:(303)358-8535) mobile

[\(720\) 440-6100](tel:(720)440-6100) office

[\(720\) 279-2331](tel:(720)279-2331) fax

kcaplan@bonanzacrk.com

www.bonanzacrk.com



NYSE : BCEI

From: Diana Burn - DNR [mailto:diana.burn@state.co.us]

Sent: Tuesday, August 25, 2015 6:41 PM

To: Gary Johnson; Steve Jenkins - DNR; Jason Kosola - DNR; Barbara Westerdale - DNR

Cc: Keith Caplan

Subject: RE: Rig skid guidance

Thank you – please submit APD as soon as you determine which ‘slot’ you will use for the redrill.

Diana

From: Gary Johnson [mailto:GJohnson@bonanzacrk.com]

Sent: Tuesday, August 25, 2015 1:40 PM

To: Diana Burn - DNR; steve.jenkins@state.co.us

Cc: Keith Caplan

Subject: RE: Rig skid guidance

Diana,

Per our conversation this morning regarding API 05-123-41763., rig skid, lost hole.

- b. Provide all of the following information by email to the appropriate COGCC Engineer shown above in Step 1.a. i. Explanation of the situation that has resulted in a lost hole and the need to plug the lost hole **1. Drilled 13-1/4" hole to 1680'. Ran 9-5/8", 36#, J-55 casing. Casing became stuck at 1120'. Cannot pull casing, cannot circulate to cement.**
- ii. Total measured depth reached in the lost hole **2. 1680'**
- iii. Casing set – size(s) and measured depth(s) **3. 9-5/8", 36#, J-55 casing stuck at 1120'**
- iv. Description of fish in the hole (if any) – including top and bottom measured depths **4. No fish in casing, casing at 1120' to surface.**
- v. Description of proposed plugs: setting measured depths, heights, and cement volumes **5. Fill casing with 308 sacks, 80 BBL, Type 3 cement with 1% CaCl₂ and .25#/sk poly flake. Weight 14.2 #/gal, yield 1.46 ft³/sk. Shoe at 1120', float collar at 1081', top of cement at surface. Cut off casing at bottom of cellar and weld on steel plate.**
- vi. Type of cement to be used for all plugs, including slurry weight (ppg) and yield (cf/sk) **6. Type 3 cement with 1% CaCl₂ and .25#/sk poly flake. Weight 14.2 ppg, yield 1.46 cf/sk.**
- vii. Proposed objective formation(s) for replacement well – new or same as lost hole **7. Proposed objective formation same as lost hole, Niobrara.**
- viii. BHL target for replacement well – new or same as lost hole (NOTE: a change in the BHL must be reviewed and approved by COGCC Permitting prior to completing the replacement well. Drilling a well to an unapproved BHL could result in an NOAV, plugging the well, or both). **8. BHL target for replacement well will be the same as that for lost hole.**

Thanks for your help with this.

Gary J. Johnson

Drilling Manager

Bonanza Creek Energy, Inc.

410 17th Street

Suite 1500

Denver, CO 80202

[720-440-6100](tel:720-440-6100) Office Main

[720-440-6138](tel:720-440-6138) Direct

[303-618-4783](tel:303-618-4783) Cell

[720-279-2331](tel:720-279-2331) Fax

gjohnson@bonanzacrk.com

From: Diana Burn - DNR [<mailto:diana.burn@state.co.us>]
Sent: Tuesday, August 25, 2015 9:14 AM
To: Gary Johnson
Subject: Rig skid guidance

Diana Burn, P.E.

Eastern Engineering Supervisor



P [303.894.2100](tel:303.894.2100) x5106 | F [303.894.2109](tel:303.894.2109) | C [303.918.6320](tel:303.918.6320)

1120 Lincoln Street, Suite 801, Denver, CO 80203

Diana.Burn@state.co.us | www.colorado.gov/cogcc