

Procedure for Plugging Bar X #26

Move in and rig up

ND wellhead NU BOPs

POOH tubing and tally

RIH with CICR and set at 2890'

Fill hole with 9 ppg mud

Test casing

Mix & pump 35 sx cement (25sx below CICR and 10 sx above)

Lay down 2 3/8" tubing

Perforate 4 1/2" casing at 371'

Mix and pump 110 sx cement down 4 1/2" casing and up 4 1/2" X 8 5/8" annulus until cement is at surface

Cut off wellhead and weld on DHM 4' below GL