

Foundation Energy Management, LLC
Drilling - Completion - Workover - Facilities
PROCEDURE

AFE No.:		AFE Amount	DRILLING	\$0
AFE Type:		COMPLETIONS		
AFE Category:		Total: \$45,483		
WI:	NRI:	AFE Date:	9/22/2015	Budget Year: 2014
Well / Battery:	Prospect Name	Total Depth	Est. Start Date	
Mitchem 2-26x	Paladin	7,614'	11/1/2015	
Location	Sec-Twn-Rng	Producing Horizon	County & State	
NE NE	26-3S-63W	JSND	Adams, CO	
AFE				
Plug and Abandon				

PROCEDURE

- Pre-Job**
1. Submit Intent to Plug Form 6 to COGCC for approval
 2. Notify COGCC and land owner 10 days prior to Rig up
 3. Notify COGCC inspector 48 hrs prior job
 4. Haul off 140 bbl oil thats left in battery
- Job**
1. MIRU WO Rig.
 2. ND Wellhead. NU BOP.
 3. MIRU Wireline Truck.
 4. Perform CBL at 1350'.
 5. Communicate results to Tulsa office and COGCC
 6. RIH to 6,775' and perf CSG.
 7. POOH to (1400)' and perf CSG (depth dependent on CBL).
 8. POOH to 850' and perf CSG.
 9. RDMO Wireline Truck.
 10. Changeover to 2-3/8" tubing tools.
 11. RIH to 6,650' to pump 55 sx of cement.
 12. POOH w/ 14 jts of 2-3/8" tbg and circulate 26 bbl of water. WOC and Tag plug.
 13. POOH with 2-3/8" tbg to (1400)' and pump (64)sx (depth & cement calculation dependent on CBL).
 14. POOH w/ 16 jts WOC and tag plug.
 15. POOH tbg to 850', pump 185 sx and circulate 4 bbl. Confirm surface returns.
 16. RDMO cement company.
 17. POOH w/ 2-3/8" tubing. Lay down on float.
 18. RDMO WO Rig
 19. Dig 4' down around wellbore.
 20. Cut off WH, weld cap.
 21. weld information plate on cap.
 22. Haul off both 300 bbl tanks (1 of them has a hole).
 23. Reclaim land
- Post - Job**
- File P&A reports with COGCC and notify land owner.

APPROVAL

By (Preparer)	<i>Dalton Reazin</i>	Date	09/22/15	By (Field Foreman)	Date
By (VP Operations)	<i>Richard L. Payne</i>				Date