

**WORKOVER PROCEDURE**

**WELL NAME:** ATKINSON-GALE 03-13 **DATE:** 10/5/2015

**LOCATION:**  
Qtr/Qtr: SW/SW Section: 3 Township: 4N Range: 64W  
Footages: 822' FSL & 787' FWL

**COUNTY:** WELD **STATE:** CO **API #:** 05-123-17160

**ENGINEER:** Jonathan Pomerantz 7 Day Notice Sent: \_\_\_\_\_  
(Please notify Engineer of any major Do not start operations until: \_\_\_\_\_  
changes prior to work) Notice Expires: \_\_\_\_\_

**OBJECTIVE:** P&A

**WELL DATA:** Surface Csg: 8 5/8" 23# @ 511' KB Elevation: 4686'  
Surface Cmt: 355 sx GL Elevation: 4675'  
Long St Csg: 4 1/2" 11.6# @ 6978' TD: 6980'  
Long St Cmt: 145 sx PBTD: 6925'  
Long St Date: 7/14/1993

Plug Back (Sand or CIBP): \_\_\_\_\_  
Perforation Interval (1): Niobrara Perforations 6584' - 6674'  
Perforation Interval (2): Codell Perforations 6820' - 6832'  
Perforation Interval (3): \_\_\_\_\_  
Tubing: 2 3/8" 4.7# J-55 tbg @ 6809' Rods: \_\_\_\_\_  
Pump: \_\_\_\_\_  
Misc.: \_\_\_\_\_

**PRODUCTION STATUS:** \_\_\_\_\_  
**COMMENTS:** \_\_\_\_\_

**PROCEDURE:**

- 1) MIRU Workover rig, pump & tank.
- 2) POOH w/ 2 3/8" tbg and lay down.
- 3) RU WL. RIH w/ CIBP. Set CIBP @ 6534', dump bail 2 sx of cement on top.
- 4) Unland casing. Cut casing off @ 2500'. POOH w/ casing laying down on trailer.
- 5) RIH w/ workstring to pump 100 sx stub plug where csg was pulled. If maintain circulation, no need to tag plug.
- 6) POOH w/ workstring to 620'. Pump 225 sx shoe plug. Cement to surface.
- 7) SI, WOC. RIH. Tag shoe plug. Add cement if needed.
- 8) Cut surface casing off 6'-8' below ground.
- 9) Clean up location. Reclaim location. RDMO.