



Photo 1. View of southern portion of project area from access road facing westward. Revegetation is progressing in this area.



Photo 2. View of eastern portion of project area from northeastern corner facing southward.



Photo 3. View of project area from northeastern corner facing center.



Photo 4. View of northern portion of project area from northeastern corner facing westward. Revegetation is progressing here and stormwater BMP appears to be in good condition. It appears that sediment is running off of the northern edge of the working area.



Photo 5. View of western edge of working area facing southward. Rill erosion is occurring all along this edge of the working area. See photos 6 and 7.



Photos 6 and 7. View of rills up to 18 inches deep and 1 foot wide along the western edge of the working area.



Photo 8. View of erosion along access road facing westward from beginning of access road. It appears concentrated stormwater flows over and erodes the road surface and continues down-slope.