

FORM
6Rev
12/05State of Colorado
Oil and Gas Conservation Commission

1120 Lincoln Street, Suite 801, Denver, Colorado 80203 Phone: (303) 894-2100 Fax: (303) 894-2109



DE ET OE ES

Document Number:

400917837

Date Received:

10/14/2015

WELL ABANDONMENT REPORT

This form is to be submitted as an Intent to Abandon whenever an abandonment is planned on a borehole. After the abandonment is complete, this form shall again be submitted as a Subsequent Report of the actual work completed. The approved intent shall be valid for six months after the approval date, after that period, a new intent will be required. Attachments required with the Intent to Abandon are wellbore diagrams of the current configuration and the proposed configuration with plugs set.

A Subsequent Report of Abandonment shall indicate the actual work completed. Attachments required with a Subsequent Report are a wellbore diagram showing plugs that were set and casing remaining in the hole, the job summaries from all plugging contractors used, including wireline and cementing (third party verification) and any logs that may have been run during abandonment.

OGCC Operator Number: 69175

Contact Name: Venessa Langmacher

Name of Operator: PDC ENERGY INC

Phone: (303) 318-6102

Address: 1775 SHERMAN STREET - STE 3000

Fax: (303) 831-3988

City: DENVER State: CO Zip: 80203

Email: venessa.langmacher@pdce.com

For "Intent" 24 hour notice required,

Name: Rickard, Jeff

Tel: (720) 305-8280

COGCC contact:

Email: jeffrey.rickard@state.co.us

API Number 05-123-11963-00

Well Name: BROWN

Well Number: 20-1

Location: QtrQtr: NWNW Section: 20 Township: 4N Range: 67W Meridian: 6

County: WELD

Federal, Indian or State Lease Number: 65447

Field Name: WATTENBERG

Field Number: 90750

☒ Notice of Intent to Abandon☐ Subsequent Report of Abandonment

Only Complete the Following Background Information for Intent to Abandon

Latitude: 40.304310

Longitude: -104.920690

GPS Data:

Date of Measurement: 10/26/2007

PDOP Reading: 2.8

GPS Instrument Operator's Name: Holly L. Tracy

Reason for Abandonment: ☐ Dry☒ Production for Sub-economic☐ Mechanical Problems☐ OtherCasing to be pulled: ☐ Yes☒ No

Estimated Depth:

Fish in Hole: ☐ Yes☒ No

If yes, explain details below

Wellbore has Uncemented Casing leaks: ☐ Yes☒ No

If yes, explain details below

Details:

Current and Previously Abandoned Zones

Formation	Perf. Top	Perf. Btm	Abandoned Date	Method of Isolation	Plug Depth
CODELL	7252	7262	07/22/2015	B PLUG CEMENT TOP	6900
NIOBRARA	6945	7038	07/22/2015	B PLUG CEMENT TOP	6900

Total: 2 zone(s)

Casing History

Casing Type	Size of Hole	Size of Casing	Weight Per Foot	Setting Depth	Sacks Cement	Cement Bot	Cement Top	Status
SURF	12+1/4	8+5/8	24	321	260	321	0	VISU
1ST	6+3/4	2+7/8	6.7	7,344	1,260	7,344	250	CBL

Plugging Procedure for Intent and Subsequent Report

CIBP #1: Depth 6900 with 2 sacks cmt on top. CIBP #2: Depth _____ with _____ sacks cmt on top.
CIBP #3: Depth _____ with _____ sacks cmt on top. CIBP #4: Depth _____ with _____ sacks cmt on top.
CIBP #5: Depth _____ with _____ sacks cmt on top.

NOTE: Two(2) sacks cement required on all CIBPs.

Set <u>10</u> sks cmt from <u>6260</u> ft. to <u>6615</u> ft.	Plug Type: <u>CASING</u>	Plug Tagged: <input type="checkbox"/>
Set <u>20</u> sks cmt from <u>0</u> ft. to <u>520</u> ft.	Plug Type: <u>CASING</u>	Plug Tagged: <input type="checkbox"/>
Set <u>10</u> sks cmt from <u>0</u> ft. to <u>57</u> ft.	Plug Type: <u>ANNULUS</u>	Plug Tagged: <input type="checkbox"/>
Set _____ sks cmt from _____ ft. to _____ ft.	Plug Type: _____	Plug Tagged: <input type="checkbox"/>
Set _____ sks cmt from _____ ft. to _____ ft.	Plug Type: _____	Plug Tagged: <input type="checkbox"/>

Perforate and squeeze at _____ ft. with _____ sacks. Leave at least 100 ft. in casing _____ CICR Depth

Perforate and squeeze at _____ ft. with _____ sacks. Leave at least 100 ft. in casing _____ CICR Depth

Perforate and squeeze at _____ ft. with _____ sacks. Leave at least 100 ft. in casing _____ CICR Depth

(Cast Iron Cement Retainer Depth)

Set _____ sacks half in. half out surface casing from _____ ft. to _____ ft. Plug Tagged: ☐

Set _____ sacks at surface

Cut four feet below ground level, weld on plate Above Ground Dry-Hole Marker: ☐ Yes ☒ No

Set _____ sacks in rat hole Set _____ sacks in mouse hole

Additional Plugging Information for Subsequent Report Only

Casing Recovered: _____ ft. of _____ inch casing Plugging Date: _____

*Wireline Contractor: _____ *Cementing Contractor: _____

Type of Cement and Additives Used: _____

Flowline/Pipeline has been abandoned per Rule 1103 ☐ Yes ☐ No *ATTACH JOB SUMMARY

Technical Detail/Comments:

Proposed Procedure:

1. MIRU pulling unit.
2. Rig up wireline company. Run Gyro survey from 6600' to surface.
3. TIH with tubing to 6615'. RU cementers. Mix and pump 10 sxs of 15.8#/gal CI G cement in 2?" casing.
4. Reset tubing at 520'. Mix and pump 20 sxs of 15.8#/gal CI G cement in 2?" casing. Cement should circulate to surface.
5. Mix and spot 10 sxs of 15.8#/gal CI G cement in 2?" x 8?" annulus.
6. Cut surface casing 6' below ground level and weld on cap.

I hereby certify all statements made in this form are, to the best of my knowledge, true, correct, and complete.

Signed: _____ Print Name: Venessa Langmacher

Title: Senior Regulatory Tech Date: 10/14/2015 Email: venessa.langmacher@pdce.com

Based on the information provided herein, this Well Abandonment Report (Form 6) complies with COGCC Rules and applicable orders and is hereby approved.

COGCC Approved: JENKINS, STEVE Date: 10/26/2015

CONDITIONS OF APPROVAL, IF ANY: _____

Expiration Date: 4/25/2016

<u>COA Type</u>	<u>Description</u>
	<p>Note changes to plugging procedure:</p> <p>1) Provide 48 hour notice of plugging MIRU via electronic Form 42.</p> <p>2) For 520' plug: pump plug and displace. If surface casing plug is not circulated to surface then tag plug – must be 221' or shallower and provide 10 sx plug at the surface. Leave at least 100' cement in the casing for each plug.</p> <p>3) Properly abandon flowlines as per Rule 1103. File electronic Form 42 once abandonment complete.</p>

Attachment Check List

<u>Att Doc Num</u>	<u>Name</u>
400917837	FORM 6 INTENT SUBMITTED
400917851	WELLBORE DIAGRAM
400917852	WELLBORE DIAGRAM

Total Attach: 3 Files

General Comments

<u>User Group</u>	<u>Comment</u>	<u>Comment Date</u>
Permit	Well Completion Report dated 12/03/1984	10/23/2015 10:33:46 AM
Public Room	Document verification complete 10/19/15	10/19/2015 12:54:44 PM

Total: 2 comment(s)