

WORKOVER PROCEDURE

WELL NAME: HOSHIKO C02-08 **DATE:** 11/2/2015
LOCATION:
Qtr/Qtr: SE/NE Section: 2 Township: 4N Range: 64W
Footages: 1979' FNL & 656' FEL
COUNTY: WELD **STATE:** CO **API #:** 05-123-20167

ENGINEER: Jonathan Pomerantz 7 Day Notice Sent: _____
(Please notify Engineer of any major Do not start operations until: _____
changes prior to work) Notice Expires: _____

OBJECTIVE: P&A

WELL DATA: Surface Csg: 8 5/8" 24# @ 365' KB Elevation: 4622'
Surface Cmt: 260 sx GL Elevation: 4612'
Long St Csg: 4 1/2" 11.6# @ 7308' TD: 7310'
Long St Cmt: 250 sx PBTD: 7024'
Long St Date: 10/20/2001

Plug Back (Sand or CIBP): **CIBP @ 7050' w/ 2 sx cement on top (8/18/2003)**
Perforation Interval (1): Codell Perforations 6744' - 6756'
Perforation Interval (2): J-Sand Perforations 7172' - 7230'
Perforation Interval (3): _____
Tubing: 2 3/8" 4.7# J-55 tbg @ 6724' Rods: _____
Pump: _____
Misc.: _____

PRODUCTION STATUS: _____
COMMENTS: _____

PROCEDURE:

- 1) MIRU Workover rig, pump & tank.
- 2) POOH w/ 2 3/8" tbg and lay down.
- 3) RU WL. RIH w/ CIBP. Set CIBP @ 6694'. RIH w/ workstring to top of CIBP. Pump 40 sx balance plug.
- 4) Unland casing. Cut casing off @ 2500'. POOH w/ casing laying down on trailer.
- 5) RIH w/ workstring to pump 100 sx stub plug where csg was pulled. If maintain circulation, no need to tag plug.
- 6) POOH w/ workstring to 550'. Pump 225 sx shoe plug. Cement to surface.
- 7) SI, WOC. RIH. Tag shoe plug. Add cement if needed.
- 8) Cut surface casing off 6'-8' below ground.
- 9) Clean up location. Reclaim location. RDMO.