

FORM
6Rev
12/05State of Colorado
Oil and Gas Conservation Commission

1120 Lincoln Street, Suite 801, Denver, Colorado 80203 Phone: (303) 894-2100 Fax: (303) 894-2109



DE ET OE ES

Document Number:

400946701

Date Received:

WELL ABANDONMENT REPORT

This form is to be submitted as an Intent to Abandon whenever an abandonment is planned on a borehole. After the abandonment is complete, this form shall again be submitted as a Subsequent Report of the actual work completed. The approved intent shall be valid for six months after the approval date, after that period, a new intent will be required.

Attachments required with the Intent to Abandon are wellbore diagrams of the current configuration and the proposed configuration with plugs set.

A Subsequent Report of Abandonment shall indicate the actual work completed. Attachments required with a Subsequent Report are a wellbore diagram showing plugs that were set and casing remaining in the hole, the job summaries from all plugging contractors used, including wireline and cementing (third party verification) and any logs that may have been run during abandonment.

OGCC Operator Number: 69175

Contact Name: Jenifer Hakkarinen

Name of Operator: PDC ENERGY INC

Phone: (303) 8605800

Address: 1775 SHERMAN STREET - STE 3000

Fax:

City: DENVER State: CO Zip: 80203

Email: Jenifer.Hakkarinen@pdce.com

For "Intent" 24 hour notice required,

Name: Rickard, Jeff

Tel: (720) 305-8280

COGCC contact:

Email: jeffrey.rickard@state.co.us

API Number 05-123-14714-00

Well Name: WIEDMAN

Well Number: 29-3

Location: QtrQtr: SESW Section: 29 Township: 4N Range: 66W Meridian: 6

County: WELD

Federal, Indian or State Lease Number: 67774

Field Name: WATTENBERG

Field Number: 90750

☒ Notice of Intent to Abandon☐ Subsequent Report of Abandonment

Only Complete the Following Background Information for Intent to Abandon

Latitude: 40.277778

Longitude: -104.803611

GPS Data:

Date of Measurement: 06/30/2010

PDOP Reading: 2.3

GPS Instrument Operator's Name: Shantell Kling

Reason for Abandonment:

☐ Dry☒ Production for Sub-economic☐ Mechanical Problems☐ OtherCasing to be pulled: ☒ Yes☐ No

Estimated Depth: 4350

Fish in Hole: ☐ Yes☒ No

If yes, explain details below

Wellbore has Uncemented Casing leaks:

☐ Yes☒ No

If yes, explain details below

Details:

Current and Previously Abandoned Zones

Formation	Perf. Top	Perf. Btm	Abandoned Date	Method of Isolation	Plug Depth
CODELL	7284	7298			
NIOBRARA	6978	7170			

Total: 2 zone(s)

Casing History

Casing Type	Size of Hole	Size of Casing	Weight Per Foot	Setting Depth	Sacks Cement	Cement Bot	Cement Top	Status
SURF	12+1/4	8+5/8	24	407	225	407	0	
1ST	7+7/8	4+1/2	15.1	7,933	180	7,933	6,640	

Plugging Procedure for Intent and Subsequent Report

CIBP #1: Depth 6930 with 2 sacks cmt on top. CIBP #2: Depth _____ with _____ sacks cmt on top.
CIBP #3: Depth _____ with _____ sacks cmt on top. CIBP #4: Depth _____ with _____ sacks cmt on top.
CIBP #5: Depth _____ with _____ sacks cmt on top.

NOTE: Two(2) sacks cement required on all CIBPs.

Set 50 sks cmt from 4400 ft. to 4212 ft. Plug Type: STUB PLUG Plug Tagged: ☐
Set _____ sks cmt from _____ ft. to _____ ft. Plug Type: _____ Plug Tagged: ☐
Set _____ sks cmt from _____ ft. to _____ ft. Plug Type: _____ Plug Tagged: ☐
Set _____ sks cmt from _____ ft. to _____ ft. Plug Type: _____ Plug Tagged: ☐
Set _____ sks cmt from _____ ft. to _____ ft. Plug Type: _____ Plug Tagged: ☐

Perforate and squeeze at _____ ft. with _____ sacks. Leave at least 100 ft. in casing _____ CICR Depth

Perforate and squeeze at _____ ft. with _____ sacks. Leave at least 100 ft. in casing _____ CICR Depth

Perforate and squeeze at _____ ft. with _____ sacks. Leave at least 100 ft. in casing _____ CICR Depth

(Cast Iron Cement Retainer Depth)

Set 230 sacks half in. half out surface casing from 620 ft. to 0 ft. Plug Tagged: ☐

Set _____ sacks at surface

Cut four feet below ground level, weld on plate Above Ground Dry-Hole Marker: ☐ Yes ☐ No

Set _____ sacks in rat hole Set _____ sacks in mouse hole

Additional Plugging Information for Subsequent Report Only

Casing Recovered: _____ ft. of _____ inch casing Plugging Date: _____

*Wireline Contractor: _____ *Cementing Contractor: _____

Type of Cement and Additives Used: _____

Flowline/Pipeline has been abandoned per Rule 1103 ☐ Yes ☐ No *ATTACH JOB SUMMARY

Technical Detail/Comments:

Wiedeman #29-3 (05-123-14714)/Plugging Procedure (Intent)
Producing Formation: Niobrara - Codell
Existing Perforations: Niobrara 6968'-7170' Codell 7284'-7298'
TD: 7412' PBDT: 7374'
Surface Casing: 8 ?" 24# @ 407' w/ 225 sks cmt.
Production Casing: 4 1/2" 15.1# @ 7933' w/ 180 sks cmt (TOC 6640').

Tubing: 2 ?" 4.7#/ft tubing set at 7270'. (4/3/2015)

Proposed Procedure:

1. MIRU pulling unit. TOOH with tubing.
2. Rig up wireline company. TIH with CIBP. Set CIBP at 6930'. TIH with dump bailer. Spot 2 sxs of 15.8#/gal CI G cement on top of CIBP.
3. TIH with casing cutter. Cut off 4 1/2" casing at 4350'. Pull 4 1/2" casing.
4. TIH with tubing to 4400'. RU cementers. Mix and pump 50 sxs of 15.8#/gal CI G cement.
5. Reset tubing at 620'. Mix and pump 230 sxs of 15.8#/gal CI G cement. Cement should circulate to surface.
6. Cut surface casing 6' below ground level and weld on cap.

I hereby certify all statements made in this form are, to the best of my knowledge, true, correct, and complete.

Signed: _____ Print Name: Jenifer Hakkarinen

Title: Regulatory Tech Date: _____ Email: Jenifer.Hakkarinen@pdce.com

Based on the information provided herein, this Well Abandonment Report (Form 6) complies with COGCC Rules and applicable orders and is hereby approved.

COGCC Approved: _____

Date: _____

CONDITIONS OF APPROVAL, IF ANY: _____

Expiration Date: _____

COA Type

Description

--	--

Attachment Check List

Att Doc Num

Name

400946703	WELLBORE DIAGRAM
400946704	WELLBORE DIAGRAM

Total Attach: 2 Files

General Comments

User Group

Comment

Comment Date

--	--	--

Total: 0 comment(s)