

Document Number:
400919982

Date Received:
10/19/2015

WELL ABANDONMENT REPORT

This form is to be submitted as an Intent to Abandon whenever an abandonment is planned on a borehole. After the abandonment is complete, this form shall again be submitted as a Subsequent Report of the actual work completed. The approved intent shall be valid for six months after the approval date, after that period, a new intent will be required. Attachments required with the Intent to Abandon are wellbore diagrams of the current configuration and the proposed configuration with plugs set.

A Subsequent Report of Abandonment shall indicate the actual work completed. Attachments required with a Subsequent Report are a wellbore diagram showing plugs that were set and casing remaining in the hole, the job summaries from all plugging contractors used, including wireline and cementing (third party verification) and any logs that may have been run during abandonment.

OGCC Operator Number: 69175 Contact Name: Jenifer Hakkarinen

Name of Operator: PDC ENERGY INC Phone: (303) 8605800

Address: 1775 SHERMAN STREET - STE 3000 Fax: _____

City: DENVER State: CO Zip: 80203 Email: Jenifer.Hakkarinen@pdce.com

For "Intent" 24 hour notice required, Name: Rickard, Jeff Tel: (720) 305-8280

COGCC contact: Email: jeffrey.rickard@state.co.us

API Number 05-123-14495-00

Well Name: RANDALL Well Number: 11-28

Location: QtrQtr: NESW Section: 28 Township: 4N Range: 66W Meridian: 6

County: WELD Federal, Indian or State Lease Number: 67456

Field Name: WATTENBERG Field Number: 90750

Notice of Intent to Abandon Subsequent Report of Abandonment

Only Complete the Following Background Information for Intent to Abandon

Latitude: 40.280282 Longitude: -104.784071

GPS Data:
Date of Measurement: 07/01/2010 PDOP Reading: 2.4 GPS Instrument Operator's Name: Shantell Kling

Reason for Abandonment: Dry Production for Sub-economic Mechanical Problems

Other failed MIT

Casing to be pulled: Yes No Estimated Depth: 6100

Fish in Hole: Yes No If yes, explain details below

Wellbore has Uncemented Casing leaks: Yes No If yes, explain details below

Details: _____

Current and Previously Abandoned Zones

Formation	Perf. Top	Perf. Btm	Abandoned Date	Method of Isolation	Plug Depth
CODELL	7259	7269	09/01/2015	B PLUG CEMENT TOP	6900

Total: 1 zone(s)

Casing History

Casing Type	Size of Hole	Size of Casing	Weight Per Foot	Setting Depth	Sacks Cement	Cement Bot	Cement Top	Status
SURF	12+1/4	8+5/8	24	217	190	217	0	VISU
1ST	7+7/8	3+1/2	9.3	7,392	230	7,392	6,475	CBL

Plugging Procedure for Intent and Subsequent Report

CIBP #1: Depth 6884 with 2 sacks cmt on top. CIBP #2: Depth _____ with _____ sacks cmt on top.
CIBP #3: Depth _____ with _____ sacks cmt on top. CIBP #4: Depth _____ with _____ sacks cmt on top.
CIBP #5: Depth _____ with _____ sacks cmt on top.

NOTE: Two(2) sacks cement required on all CIBPs.

Set 50 sks cmt from 6150 ft. to 5973 ft. Plug Type: STUB PLUG Plug Tagged:
Set _____ sks cmt from _____ ft. to _____ ft. Plug Type: _____ Plug Tagged:
Set _____ sks cmt from _____ ft. to _____ ft. Plug Type: _____ Plug Tagged:
Set _____ sks cmt from _____ ft. to _____ ft. Plug Type: _____ Plug Tagged:
Set _____ sks cmt from _____ ft. to _____ ft. Plug Type: _____ Plug Tagged:

Perforate and squeeze at _____ ft. with _____ sacks. Leave at least 100 ft. in casing _____ CICR Depth
Perforate and squeeze at _____ ft. with _____ sacks. Leave at least 100 ft. in casing _____ CICR Depth
Perforate and squeeze at _____ ft. with _____ sacks. Leave at least 100 ft. in casing _____ CICR Depth
(Cast Iron Cement Retainer Depth)

Set 170 sacks half in. half out surface casing from 450 ft. to 0 ft. Plug Tagged:

Set _____ sacks at surface

Cut four feet below ground level, weld on plate Above Ground Dry-Hole Marker: Yes No

Set _____ sacks in rat hole Set _____ sacks in mouse hole

Additional Plugging Information for Subsequent Report Only

Casing Recovered: _____ ft. of _____ inch casing Plugging Date: _____

*Wireline Contractor: _____ *Cementing Contractor: _____

Type of Cement and Additives Used: _____

Flowline/Pipeline has been abandoned per Rule 1103 Yes No *ATTACH JOB SUMMARY

Technical Detail/Comments:

Randall 11-28 (05-123-14495)/Plugging Procedure (Intent)
Producing Formation: Codell
Existing Perforations: Codell 7259'-7269'
TD: 7413' PBTD: 7345'
Surface Casing: 8 5/8" 24# @ 217' w/ 190 sks cmt.
Production Casing: 3 1/2" 9.3# @ 7392' w/ 230 sks cmt (TOC 6475').

Existing CIBP: at 6900' with 2 sxs cement.

Proposed Procedure:

1. MIRU pulling unit.
2. Rig up wireline company. Establish free point of 3 1/2" casing. (The current CBL indicates some bonding above 6475' but was not run above 6350'. Calculated top of cement is 6200'.)
3. TIH with casing cutter. Cut off 3 1/2" casing at 6100'. Pull 3 1/2" casing.
4. TIH with tubing to 6150'. RU cementers. Mix and pump 50 sxs of 15.8#/gal CI G cement.
5. Reset tubing at 450'. Mix and pump 170 sxs of 15.8#/gal CI G cement. Cement should circulate to surface.
6. Cut surface casing 6' below ground level and weld on cap.

I hereby certify all statements made in this form are, to the best of my knowledge, true, correct, and complete.

Signed: _____ Print Name: Jenifer Hakkarinen

Title: Regulatory Tech Date: 10/19/2015 Email: Jenifer.Hakkarinen@pdce.com

Based on the information provided herein, this Well Abandonment Report (Form 6) complies with COGCC Rules and applicable orders and is hereby approved.

COGCC Approved: JENKINS, STEVE Date: 12/14/2015

CONDITIONS OF APPROVAL, IF ANY:Expiration Date: 6/13/2016**COA Type****Description**

	<p>Note changes to plugging procedure:</p> <ol style="list-style-type: none"> 1) Provide 48 hour notice of plugging MIRU via electronic Form 42. 2) Add CIBP and 2 sx of cmt at 6884, to provide Niobrara isolation. 3) For 450' plug: pump plug and displace. If surface casing plug is not circulated to surface then tag plug – must be 117' or shallower and provide 10 sx plug at the surface. Leave at least 100' of cement in the casing for each plug. 4) Properly abandon flowlines as per Rule 1103. File electronic Form 42 once abandonment complete.
--	---

Attachment Check List**Att Doc Num****Name**

400919982	FORM 6 INTENT SUBMITTED
400919984	WELLBORE DIAGRAM
400919985	WELLBORE DIAGRAM

Total Attach: 3 Files

General Comments**User Group****Comment****Comment Date**

Permit	Form 4 approved. Permitting Review Complete.	12/14/2015 8:49:58 AM
Permit	ON HOLD: w/o form 4 approval. doc # 400904933	10/23/2015 3:06:45 PM
Permit	Well Completion Report dated 4/26/1990.	10/23/2015 3:06:44 PM
Public Room	Document verification complete 10/19/15	10/19/2015 1:22:50 PM

Total: 4 comment(s)