

FORM
6Rev
12/05State of Colorado
Oil and Gas Conservation Commission

1120 Lincoln Street, Suite 801, Denver, Colorado 80203 Phone: (303) 894-2100 Fax: (303) 894-2109



DE ET OE ES

Document Number:

400955747

Date Received:

WELL ABANDONMENT REPORT

This form is to be submitted as an Intent to Abandon whenever an abandonment is planned on a borehole. After the abandonment is complete, this form shall again be submitted as a Subsequent Report of the actual work completed. The approved intent shall be valid for six months after the approval date, after that period, a new intent will be required. Attachments required with the Intent to Abandon are wellbore diagrams of the current configuration and the proposed configuration with plugs set.

A Subsequent Report of Abandonment shall indicate the actual work completed. Attachments required with a Subsequent Report are a wellbore diagram showing plugs that were set and casing remaining in the hole, the job summaries from all plugging contractors used, including wireline and cementing (third party verification) and any logs that may have been run during abandonment.

OGCC Operator Number: 69175

Contact Name: Kelsi Welch

Name of Operator: PDC ENERGY INC

Phone: (303) 831-3974

Address: 1775 SHERMAN STREET - STE 3000

Fax:

City: DENVER State: CO Zip: 80203

Email: kelsi.welch@pdce.com

For "Intent" 24 hour notice required,

Name: Rickard, Jeff

Tel: (720) 305-8280

COGCC contact:

Email: jeffrey.rickard@state.co.us

API Number 05-123-12519-00

Well Name: PESCHEL

Well Number: 34-20

Location: QtrQtr: SWSE Section: 20 Township: 4N Range: 65W Meridian: 6

County: WELD

Federal, Indian or State Lease Number: 62431

Field Name: WATTENBERG

Field Number: 90750

☐ Notice of Intent to Abandon☒ Subsequent Report of Abandonment

Only Complete the Following Background Information for Intent to Abandon

Latitude: 40.292222

Longitude: -104.684722

GPS Data:

Date of Measurement: 01/14/2010

PDOP Reading: 2.9

GPS Instrument Operator's Name: Brandon Lucason

Reason for Abandonment:

☐ Dry☒ Production for Sub-economic☐ Mechanical Problems☐ Other

Casing to be pulled:

☒ Yes☐ No

Estimated Depth: 4587

Fish in Hole:

☐ Yes☒ No

If yes, explain details below

Wellbore has Uncemented Casing leaks:

☐ Yes☒ No

If yes, explain details below

Details:

Current and Previously Abandoned Zones

Formation	Perf. Top	Perf. Btm	Abandoned Date	Method of Isolation	Plug Depth
NIOBRARA-CODELL	6960	7266	11/24/2015	B PLUG CEMENT TOP	6190

Total: 1 zone(s)

Casing History

Casing Type	Size of Hole	Size of Casing	Weight Per Foot	Setting Depth	Sacks Cement	Cement Bot	Cement Top	Status
SURF	12+1/4	8+5/8	24	306	272	306	0	VISU
1ST	7+7/8	4+1/2	11.6	7,370	260	7,370	4,587	CALC

Plugging Procedure for Intent and Subsequent Report

CIBP #1: Depth 6910 with 2 sacks cmt on top. CIBP #2: Depth _____ with _____ sacks cmt on top.
CIBP #3: Depth _____ with _____ sacks cmt on top. CIBP #4: Depth _____ with _____ sacks cmt on top.
CIBP #5: Depth _____ with _____ sacks cmt on top.

NOTE: Two(2) sacks cement required on all CIBPs.

Set 600 sks cmt from 4701 ft. to 3487 ft. Plug Type: STUB PLUG Plug Tagged: ☐
Set _____ sks cmt from _____ ft. to _____ ft. Plug Type: _____ Plug Tagged: ☐
Set _____ sks cmt from _____ ft. to _____ ft. Plug Type: _____ Plug Tagged: ☐
Set _____ sks cmt from _____ ft. to _____ ft. Plug Type: _____ Plug Tagged: ☐
Set _____ sks cmt from _____ ft. to _____ ft. Plug Type: _____ Plug Tagged: ☐

Perforate and squeeze at _____ ft. with _____ sacks. Leave at least 100 ft. in casing _____ CICR Depth

Perforate and squeeze at _____ ft. with _____ sacks. Leave at least 100 ft. in casing _____ CICR Depth

Perforate and squeeze at _____ ft. with _____ sacks. Leave at least 100 ft. in casing _____ CICR Depth

(Cast Iron Cement Retainer Depth)

Set 370 sacks half in. half out surface casing from 609 ft. to 0 ft. Plug Tagged: ☐

Set _____ sacks at surface

Cut four feet below ground level, weld on plate Above Ground Dry-Hole Marker: ☐ Yes ☐ No

Set _____ sacks in rat hole Set _____ sacks in mouse hole

Additional Plugging Information for Subsequent Report Only

Casing Recovered: 4587 ft. of 4+1/2 inch casing

Plugging Date: 11/24/2015

*Wireline Contractor: Magna

*Cementing Contractor: Magna

Type of Cement and Additives Used: _____

Flowline/Pipeline has been abandoned per Rule 1103 ☐ Yes ☐ No

*ATTACH JOB SUMMARY

Technical Detail/Comments:

Peschel 34-20 Post P&A Procedure
123-12519

Surface: Hole: 12 ¼ Csg: 8 5/8 Weight: 24 Depth: 306 272sx
Prod: Hole: 7 7/8 Csg: 4 ½ Weight: 11.6 Depth: 7370 260sx
Procedure:

1. MIRU wireline
2. RIH set CIBP @ 6910'
3. RIH w/dump bailer and dump 2 sks cement on top of CIBP @ 6910'
4. RIH w/ casing cutter, cut casing @ 4587'
5. TIH set 600 sk stub plug @ casing stub (4701'-3487')
7. TOH and set 370 sack cement plug half in half out of surface casing from 609' to surface
8. Cut casing and weld on cap

I hereby certify all statements made in this form are, to the best of my knowledge, true, correct, and complete.

Signed: _____

Print Name: Kelsi Welch

Title: Regulatory Analyst

Date: _____

Email: kelsi.welch@pdce.com

Based on the information provided herein, this Well Abandonment Report (Form 6) complies with COGCC Rules and applicable orders and is hereby approved.

COGCC Approved: _____

Date: _____

CONDITIONS OF APPROVAL, IF ANY:

COA Type

Description

--	--

Attachment Check List

Att Doc Num

Name

400955890	OTHER
400955896	WELLBORE DIAGRAM

Total Attach: 2 Files

General Comments

User Group

Comment

Comment Date

--	--	--

Total: 0 comment(s)