

FORM  
6Rev  
12/05

# State of Colorado Oil and Gas Conservation Commission

1120 Lincoln Street, Suite 801, Denver, Colorado 80203 Phone: (303) 894-2100 Fax: (303) 894-2109



DE	ET	OE	ES
Document Number:  400964315			
Date Received:			

## WELL ABANDONMENT REPORT

This form is to be submitted as an Intent to Abandon whenever an abandonment is planned on a borehole. After the abandonment is complete, this form shall again be submitted as a Subsequent Report of the actual work completed. The approved intent shall be valid for six months after the approval date, after that period, a new intent will be required. Attachments required with the Intent to Abandon are wellbore diagrams of the current configuration and the proposed configuration with plugs set. A Subsequent Report of Abandonment shall indicate the actual work completed. Attachments required with a Subsequent Report are a wellbore diagram showing plugs that were set and casing remaining in the hole, the job summaries from all plugging contractors used, including wireline and cementing (third party verification) and any logs that may have been run during abandonment.

OGCC Operator Number: 69175	Contact Name: Jenifer Hakkarinen
Name of Operator: PDC ENERGY INC	Phone: (303) 8605800
Address: 1775 SHERMAN STREET - STE 3000	Fax:
City: DENVER State: CO Zip: 80203	Email: Jenifer.Hakkarinen@pdce.com
<b>For "Intent" 24 hour notice required,</b> Name: Rains, Bill Tel: (970) 590-6480 <b>COGCC contact:</b> Email: bill.rains@state.co.us	

API Number: 05-123-20430-00	Well Number: 22-4
Well Name: STATE	
Location: QtrQtr: SENW Section: 4 Township: 5N Range: 63W Meridian: 6	
County: WELD	Federal, Indian or State Lease Number:
Field Name: WATTENBERG	Field Number: 90750

☒ Notice of Intent to Abandon ☐ Subsequent Report of Abandonment

### Only Complete the Following Background Information for Intent to Abandon

Latitude: 40.430310	Longitude: -104.444390
GPS Data:	
Date of Measurement: 03/05/2007	PDOP Reading: 1.9
GPS Instrument Operator's Name: Holly L. Tracy	
Reason for Abandonment: <input type="checkbox"/> Dry <input checked="" type="checkbox"/> Production Sub-economic <input type="checkbox"/> Mechanical Problems	
<input type="checkbox"/> Other	
Casing to be pulled: <input checked="" type="checkbox"/> Yes <input type="checkbox"/> No	Estimated Depth: 600
Fish in Hole: <input type="checkbox"/> Yes <input checked="" type="checkbox"/> No	If yes, explain details below
Wellbore has Uncemented Casing leaks: <input type="checkbox"/> Yes <input checked="" type="checkbox"/> No	If yes, explain details below
Details:	

### Current and Previously Abandoned Zones

Formation	Perf. Top	Perf. Btm	Abandoned Date	Method of Isolation	Plug Depth
CODELL	6810	6816			
J SAND	7286	7278			

Total: 2 zone(s)

### Casing History

Casing Type	Size of Hole	Size of Casing	Weight Per Foot	Setting Depth	Sacks Cement	Cement Bot	Cement Top	Status
SURF	12+1/4	8+5/8	24	402	285	402	0	
1ST	7+7/8	4+1/2	10.5	7,428	535	7,248	2,885	

## Plugging Procedure for Intent and Subsequent Report

CIBP #1: Depth 6920 with 2 sacks cmt on top. CIBP #2: Depth 6870 with 2 sacks cmt on top.  
CIBP #3: Depth \_\_\_\_\_ with \_\_\_\_\_ sacks cmt on top. CIBP #4: Depth \_\_\_\_\_ with \_\_\_\_\_ sacks cmt on top.  
CIBP #5: Depth \_\_\_\_\_ with \_\_\_\_\_ sacks cmt on top.

NOTE: Two(2) sacks cement required on all CIBPs.

Set \_\_\_\_\_ sks cmt from \_\_\_\_\_ ft. to \_\_\_\_\_ ft. Plug Type: \_\_\_\_\_ Plug Tagged: ☐  
Set \_\_\_\_\_ sks cmt from \_\_\_\_\_ ft. to \_\_\_\_\_ ft. Plug Type: \_\_\_\_\_ Plug Tagged: ☐  
Set \_\_\_\_\_ sks cmt from \_\_\_\_\_ ft. to \_\_\_\_\_ ft. Plug Type: \_\_\_\_\_ Plug Tagged: ☐  
Set \_\_\_\_\_ sks cmt from \_\_\_\_\_ ft. to \_\_\_\_\_ ft. Plug Type: \_\_\_\_\_ Plug Tagged: ☐  
Set \_\_\_\_\_ sks cmt from \_\_\_\_\_ ft. to \_\_\_\_\_ ft. Plug Type: \_\_\_\_\_ Plug Tagged: ☐  
Perforate and squeeze at \_\_\_\_\_ ft. with \_\_\_\_\_ sacks. Leave at least 100 ft. in casing \_\_\_\_\_ CICR Depth  
Perforate and squeeze at \_\_\_\_\_ ft. with \_\_\_\_\_ sacks. Leave at least 100 ft. in casing \_\_\_\_\_ CICR Depth  
Perforate and squeeze at \_\_\_\_\_ ft. with \_\_\_\_\_ sacks. Leave at least 100 ft. in casing \_\_\_\_\_ CICR Depth  
(Cast Iron Cement Retainer Depth)

Set 240 sacks half in. half out surface casing from 650 ft. to 0 ft. Plug Tagged: ☐

Set \_\_\_\_\_ sacks at surface

Cut four feet below ground level, weld on plate Above Ground Dry-Hole Marker: ☐ Yes ☐ No

Set \_\_\_\_\_ sacks in rat hole Set \_\_\_\_\_ sacks in mouse hole

### Additional Plugging Information for Subsequent Report Only

Casing Recovered: \_\_\_\_\_ ft. of \_\_\_\_\_ inch casing Plugging Date: \_\_\_\_\_

\*Wireline Contractor: \_\_\_\_\_ \*Cementing Contractor: \_\_\_\_\_

Type of Cement and Additives Used: \_\_\_\_\_

Flowline/Pipeline has been abandoned per Rule 1103 ☐ Yes ☐ No \*ATTACH JOB SUMMARY

Technical Detail/Comments:

State #22-4 (05-123-20430)/Plugging Procedure (Intent)  
Producing Formation: Codell 6810'-6816'  
Abandoned Perforations: J Sand 7268'-7278'  
Existing CIBP: Set at 6920' without cement  
TD: 7509' PBTD: 7386'  
Surface Casing: 8?" 24# @ 402' w/ 285 sks cmt.  
Production Casing: 4½" 10.5# @ 7428' w/ 535 sks cmt (TOC 2885'CBL).

Tubing: 2?" 4.7# J-55 EUE set at 6801'.

Proposed Procedure:

1. MIRU RU pulling unit. Pull 2?" tubing.
2. RU wireline company. TIH with dump bailer. Spot 2 sxs cement on top of CIBP at 6920'.
3. TIH with CIBP. Set bridge plug at 6870'. TIH with dump bailer. Spot 2 sxs cement on top of CIBP at 6870'.
4. TIH with casing cutter. Cut 4½" casing at 600'. Pull 4½" casing.
5. TIH with tubing to 650'. Mix and pump 240 sxs of 15.8#/gal CI G cement. Cement should circulate to surface.
6. Cut surface casing 6' below ground level and weld on cap.

I hereby certify all statements made in this form are, to the best of my knowledge, true, correct, and complete.

Signed: \_\_\_\_\_ Print Name: Jenifer Hakkarinen

Title: Reg TEch Date: \_\_\_\_\_ Email: Jenifer.Hakkarinen@pdce.com

Based on the information provided herein, this Well Abandonment Report (Form 6) complies with COGCC Rules and applicable orders and is hereby approved.

COGCC Approved: \_\_\_\_\_

Date: \_\_\_\_\_

**CONDITIONS OF APPROVAL, IF ANY:** \_\_\_\_\_

Expiration Date: \_\_\_\_\_

**COA Type**

**Description**

--	--

**Attachment Check List**

**Att Doc Num**

**Name**

400964351	WELLBORE DIAGRAM
400964352	WELLBORE DIAGRAM

Total Attach: 2 Files

**General Comments**

**User Group**

**Comment**

**Comment Date**

--	--	--

Total: 0 comment(s)