

**WELL ABANDONMENT REPORT**

This form is to be submitted as an Intent to Abandon whenever an abandonment is planned on a borehole. After the abandonment is complete, this form shall again be submitted as a Subsequent Report of the actual work completed. The approved intent shall be valid for six months after the approval date, after that period, a new intent will be required. Attachments required with the Intent to Abandon are wellbore diagrams of the current configuration and the proposed configuration with plugs set.  
A Subsequent Report of Abandonment shall indicate the actual work completed. Attachments required with a Subsequent Report are a wellbore diagram showing plugs that were set and casing remaining in the hole, the job summaries from all plugging contractors used, including wireline and cementing (third party verification) and any logs that may have been run during abandonment.

OGCC Operator Number: 47120 Contact Name: CHERYL LIGHT  
 Name of Operator: KERR MCGEE OIL & GAS ONSHORE LP Phone: (720) 929-6461  
 Address: P O BOX 173779 Fax: (720) 929-7461  
 City: DENVER State: CO Zip: 80217- Email: CHERYL.LIGHT@ANADARKO.COM

**For "Intent" 24 hour notice required,** Name: Peterson, Tom Tel: (303) 815-9641  
 Email: tom.peterson@state.co.us

**COGCC contact:**

API Number 05-123-08269-00 Well Number: 1  
 Well Name: T. P. HOLTON GAS UNIT  
 Location: QtrQtr: NWSW Section: 6 Township: 1N Range: 66W Meridian: 6  
 County: WELD Federal, Indian or State Lease Number: \_\_\_\_\_  
 Field Name: WATTENBERG Field Number: 90750

Notice of Intent to Abandon       Subsequent Report of Abandonment

*Only Complete the Following Background Information for Intent to Abandon*

Latitude: 40.076620 Longitude: -104.826150  
 GPS Data:  
 Date of Measurement: 04/17/2008 PDOP Reading: 2.1 GPS Instrument Operator's Name: Cody Mattson  
 Reason for Abandonment:  Dry  Production for Sub-economic  Mechanical Problems  
 Other \_\_\_\_\_  
 Casing to be pulled:  Yes  No Estimated Depth: 400  
 Fish in Hole:  Yes  No If yes, explain details below  
 Wellbore has Uncemented Casing leaks:  Yes  No If yes, explain details below  
 Details: Stage Tool at 764' cemented w/ 200 sx. No CBL found, will run one on the rig to determine Nio coverage and Fox Hills coverage.

**Current and Previously Abandoned Zones**

Formation	Perf. Top	Perf. Btm	Abandoned Date	Method of Isolation	Plug Depth
J SAND	7938	7966			
Total: 1 zone(s)					

**Casing History**

Casing Type	Size of Hole	Size of Casing	Weight Per Foot	Setting Depth	Sacks Cement	Cement Bot	Cement Top	Status
SURF	12+1/4	8+5/8	24	218	200	218	0	VISU
1ST	7+7/8	4+1/2	10.5/11.6	8,065	200	8,065	7,172	CALC
	7+7/8	4+1/2	Stage Tool	764	200	764	416	CALC

## Plugging Procedure for Intent and Subsequent Report

CIBP #1: Depth 7870 with 2 sacks cmt on top. CIBP #2: Depth 80 with 25 sacks cmt on top.  
 CIBP #3: Depth \_\_\_\_\_ with \_\_\_\_\_ sacks cmt on top. CIBP #4: Depth \_\_\_\_\_ with \_\_\_\_\_ sacks cmt on top.  
 CIBP #5: Depth \_\_\_\_\_ with \_\_\_\_\_ sacks cmt on top.

NOTE: Two(2) sacks cement required on all CIBPs.

Set \_\_\_\_\_ sks cmt from \_\_\_\_\_ ft. to \_\_\_\_\_ ft. Plug Type: \_\_\_\_\_ Plug Tagged:   
 Set \_\_\_\_\_ sks cmt from \_\_\_\_\_ ft. to \_\_\_\_\_ ft. Plug Type: \_\_\_\_\_ Plug Tagged:   
 Set \_\_\_\_\_ sks cmt from \_\_\_\_\_ ft. to \_\_\_\_\_ ft. Plug Type: \_\_\_\_\_ Plug Tagged:   
 Set \_\_\_\_\_ sks cmt from \_\_\_\_\_ ft. to \_\_\_\_\_ ft. Plug Type: \_\_\_\_\_ Plug Tagged:   
 Set \_\_\_\_\_ sks cmt from \_\_\_\_\_ ft. to \_\_\_\_\_ ft. Plug Type: \_\_\_\_\_ Plug Tagged:

Perforate and squeeze at 7150 ft. with 110 sacks. Leave at least 100 ft. in casing 6890 CICR Depth  
 Perforate and squeeze at 4770 ft. with 330 sacks. Leave at least 100 ft. in casing 4340 CICR Depth  
 Perforate and squeeze at 1500 ft. with 420 sacks. Leave at least 100 ft. in casing 820 CICR Depth  
(Cast Iron Cement Retainer Depth)

Set 150 sacks half in. half out surface casing from 500 ft. to 118 ft. Plug Tagged:   
 Set 25 sacks at surface  
 Cut four feet below ground level, weld on plate Above Ground Dry-Hole Marker:  Yes  No  
 Set \_\_\_\_\_ sacks in rat hole Set \_\_\_\_\_ sacks in mouse hole

### Additional Plugging Information for Subsequent Report Only

Casing Recovered: \_\_\_\_\_ ft. of \_\_\_\_\_ inch casing Plugging Date: \_\_\_\_\_  
 \*Wireline Contractor: \_\_\_\_\_ \*Cementing Contractor: \_\_\_\_\_  
 Type of Cement and Additives Used: \_\_\_\_\_  
 Flowline/Pipeline has been abandoned per Rule 1103  Yes  No \*ATTACH JOB SUMMARY

Technical Detail/Comments:

I hereby certify all statements made in this form are, to the best of my knowledge, true, correct, and complete.

Signed: \_\_\_\_\_ Print Name: CHERYL LIGHT  
 Title: SR. REGULATORY ANALYST Date: 8/27/2015 Email: DJREGULATORY@ANADARKO.COM

Based on the information provided herein, this Well Abandonment Report (Form 6) complies with COGCC Rules and applicable orders and is hereby approved.

COGCC Approved: JENKINS, STEVE Date: 12/14/2015

**CONDITIONS OF APPROVAL, IF ANY:** \_\_\_\_\_ Expiration Date: 6/13/2016

COA Type	Description
	Note changes to plugging procedure: 1) Provide 48 hour notice of plugging MIRU via electronic Form 42. 2) For 500' plug: pump plug and displace. If surface casing plug is not circulated to surface then tag plug – must be 118' or shallower and provide 25 sx plug at the surface. Leave at least 100' of cement in the casing for each plug. 3) Properly abandon flowlines as per Rule 1103. File electronic Form 42 once abandonment complete.

## Attachment Check List

<u>Att Doc Num</u>	<u>Name</u>
400891228	FORM 6 INTENT SUBMITTED
400891243	PROPOSED PLUGGING PROCEDURE
400891245	WELLBORE DIAGRAM

Total Attach: 3 Files

## General Comments

<u>User Group</u>	<u>Comment</u>	<u>Comment Date</u>
Permit	Well Completion Report dated 3/17/1975	9/2/2015 12:59:58 PM
Public Room	Document Verification Complete 8/28/15	8/28/2015 10:54:42 AM

Total: 2 comment(s)