

WORKOVER PROCEDURE

WELL NAME: SOUTHARD 02 DATE: 3/15/2016
LOCATION: Qtr/Qtr: SW/NW Section: 12 Township: 6N Range: 66W
Footages: 1980 FNL & 660 FWL
COUNTY: WELD STATE: CO API #: 05-123-12378

ENGINEER: JOHN HATCH 7 Day Notice Sent:
(Please notify Engineer of any major Do not start operations until:
changes prior to work) Notice Expires:

OBJECTIVE: P&A

WELL DATA: Surface Csg: 8 5/8" 24#, J-55 @ 305' KB Elevation: 4813'
Surface Cmt: 250 sx GL Elevation: 4802'
Long St Csg: 4 1/2" 11.60#, J-55 @ 7330' TD: 7330'
Long St Cmt: 200 sx PBTD: 7287'
Long St Date: 4/6/1985

Plug Back (Sand or CIBP):
Perforation Interval (1): Codell Perforations 7241' - 7256'
Perforation Interval (2):
Perforation Interval (3):
Tubing: 2 3/8" 4.70#, J-55 @ 7223' Rods:
Pump:
Misc.:

PRODUCTION STATUS:
COMMENTS:

PROCEDURE:

- 1) MIRU Workover rig, pump & tank.
2) POOH w/ 2 3/8" tbg and lay down.
3) RU WL. RIH w/ CIBP. Set CIBP @ 7191', pump 35 sx of cement on top.
4) Unland casing. Cut casing off @ 2500'. POOH with casing laying down on trailer.
5) RIH w/ workstring to pump 100 sx stub plug where csg was pulled. If maintain circulation, no need to tag plug.
6) POOH w/ workstring to 355'. Pump 131 sx shoe plug. Cement to surface.
7) SI, WOC. RIH. Tag shoe plug. Add cement if needed.
8) Cut surface casing off 6'-8' below ground.
9) Clean up location. RDMOL.