

FORM
6
Rev
12/05

State of Colorado
Oil and Gas Conservation Commission

1120 Lincoln Street, Suite 801, Denver, Colorado 80203 Phone: (303) 894-2100 Fax: (303) 894-2109



DE	ET	OE	ES
Document Number: 401009751			
Date Received:			

WELL ABANDONMENT REPORT

This form is to be submitted as an Intent to Abandon whenever an abandonment is planned on a borehole. After the abandonment is complete, this form shall again be submitted as a Subsequent Report of the actual work completed. The approved intent shall be valid for six months after the approval date, after that period, a new intent will be required. Attachments required with the Intent to Abandon are wellbore diagrams of the current configuration and the proposed configuration with plugs set. A Subsequent Report of Abandonment shall indicate the actual work completed. Attachments required with a Subsequent Report are a wellbore diagram showing plugs that were set and casing remaining in the hole, the job summaries from all plugging contractors used, including wireline and cementing (third party verification) and any logs that may have been run during abandonment.

OGCC Operator Number: <u>69175</u>	Contact Name: <u>Kelsi Welch</u>
Name of Operator: <u>PDC ENERGY INC</u>	Phone: <u>(303) 831-3974</u>
Address: <u>1775 SHERMAN STREET - STE 3000</u>	Fax: _____
City: <u>DENVER</u> State: <u>CO</u> Zip: <u>80203</u>	Email: <u>kelsi.welch@pdce.com</u>
For "Intent" 24 hour notice required, Name: <u>Gomez, Jason</u> Tel: <u>(970) 573-1277</u>	
COGCC contact: Email: <u>jason.gomez@state.co.us</u>	

API Number <u>05-123-19306-00</u>	Well Number: <u>34-3</u>
Well Name: <u>GAMEWELL</u>	
Location: QtrQtr: <u>NENE</u> Section: <u>34</u> Township: <u>5N</u> Range: <u>64W</u> Meridian: <u>6</u>	
County: <u>WELD</u> Federal, Indian or State Lease Number: <u>63833</u>	
Field Name: <u>WATTENBERG</u> Field Number: <u>90750</u>	

Notice of Intent to Abandon Subsequent Report of Abandonment

Only Complete the Following Background Information for Intent to Abandon

Latitude: 40.361111 Longitude: -104.528611

GPS Data:
Date of Measurement: 12/01/2009 PDOP Reading: 2.4 GPS Instrument Operator's Name: James Bernal

Reason for Abandonment: Dry Production Sub-economic Mechanical Problems
 Other _____

Casing to be pulled: Yes No Estimated Depth: 570

Fish in Hole: Yes No If yes, explain details below

Wellbore has Uncemented Casing leaks: Yes No If yes, explain details below

Details: _____

Current and Previously Abandoned Zones

Formation	Perf. Top	Perf. Btm	Abandoned Date	Method of Isolation	Plug Depth
CODELL	6820	6834			
NIOBRARA	6581	6700			
Total: 2 zone(s)					

Casing History

Casing Type	Size of Hole	Size of Casing	Weight Per Foot	Setting Depth	Sacks Cement	Cement Bot	Cement Top	Status
SURF	12+1/4	8+5/8	24	364	300	364	0	
1ST	7+7/8	4+1/2	13.5	6,965	160	6,965	5,980	

Plugging Procedure for Intent and Subsequent Report

CIBP #1: Depth 6790 with 2 sacks cmt on top. CIBP #2: Depth 6530 with 2 sacks cmt on top.
CIBP #3: Depth _____ with _____ sacks cmt on top. CIBP #4: Depth _____ with _____ sacks cmt on top.
CIBP #5: Depth _____ with _____ sacks cmt on top.

NOTE: Two(2) sacks cement required on all CIBPs.

Set _____ sks cmt from _____ ft. to _____ ft. Plug Type: _____ Plug Tagged:
Set _____ sks cmt from _____ ft. to _____ ft. Plug Type: _____ Plug Tagged:
Set _____ sks cmt from _____ ft. to _____ ft. Plug Type: _____ Plug Tagged:
Set _____ sks cmt from _____ ft. to _____ ft. Plug Type: _____ Plug Tagged:
Set _____ sks cmt from _____ ft. to _____ ft. Plug Type: _____ Plug Tagged:

Perforate and squeeze at _____ ft. with _____ sacks. Leave at least 100 ft. in casing _____ CICR Depth
Perforate and squeeze at _____ ft. with _____ sacks. Leave at least 100 ft. in casing _____ CICR Depth
Perforate and squeeze at _____ ft. with _____ sacks. Leave at least 100 ft. in casing _____ CICR Depth
(Cast Iron Cement Retainer Depth)

Set 220 sacks half in. half out surface casing from 620 ft. to 0 ft. Plug Tagged:

Set _____ sacks at surface

Cut four feet below ground level, weld on plate Above Ground Dry-Hole Marker: Yes No

Set _____ sacks in rat hole Set _____ sacks in mouse hole

Additional Plugging Information for Subsequent Report Only

Casing Recovered: _____ ft. of _____ inch casing Plugging Date: _____

*Wireline Contractor: _____ *Cementing Contractor: _____

Type of Cement and Additives Used: _____

Flowline/Pipeline has been abandoned per Rule 1103 Yes No *ATTACH JOB SUMMARY

Technical Detail/Comments:

Gamewell 34-3 (05-123-19306)/Plugging Procedure (Intent)
Producing Formation: Niobrara 6581'-6700' Codell 6820'-6834'
TD: 6965' PBDT: 6937'
Surface Casing: 8" 24# @ 364' w/ 300 sks cmt.
Production Casing: 4½" 13.5# @ 6965' w/ 160 sks cmt (TOC 5980'CBL).

Tubing: 2" 4.7# J55 EUE set at 6807'. (4/10/2015)

Proposed Procedure:

1. MIRU RU pulling unit. Pull 2" tubing.
2. RU wireline company. TIH with CIBP. Set bridge plug at 6790'. TIH with dump bailer. Spot 2 sxs cement on top of CIBP.
3. TIH with CIBP. Set bridge plug at 6530'. TIH with dump bailer. Spot 2 sxs cement on top of CIBP.
4. TIH with casing cutter. Cut 4½" casing at 570'. Pull ½" casing.
5. TIH with tubing to 620'. Mix and pump 220 sxs of 15.8#/gal CI G cement. Cement should circulate to surface.
6. Cut surface casing 6' below ground level and weld on cap.

I hereby certify all statements made in this form are, to the best of my knowledge, true, correct, and complete.

Signed: _____ Print Name: Kelsi Welch

Title: Regulatory Analyst Date: _____ Email: kelsi.welch@pdce.com

Based on the information provided herein, this Well Abandonment Report (Form 6) complies with COGCC Rules and applicable orders and is hereby approved.

COGCC Approved: _____ Date: _____

CONDITIONS OF APPROVAL, IF ANY: _____

Expiration Date: _____

<u>COA Type</u>	<u>Description</u>

Attachment Check List

<u>Att Doc Num</u>	<u>Name</u>
401018425	WELLBORE DIAGRAM
401018426	WELLBORE DIAGRAM

Total Attach: 2 Files

General Comments

<u>User Group</u>	<u>Comment</u>	<u>Comment Date</u>

Total: 0 comment(s)