

Document Number:  
401021012

Date Received:

**WELL ABANDONMENT REPORT**

This form is to be submitted as an Intent to Abandon whenever an abandonment is planned on a borehole. After the abandonment is complete, this form shall again be submitted as a Subsequent Report of the actual work completed. The approved intent shall be valid for six months after the approval date, after that period, a new intent will be required. Attachments required with the Intent to Abandon are wellbore diagrams of the current configuration and the proposed configuration with plugs set. A Subsequent Report of Abandonment shall indicate the actual work completed. Attachments required with a Subsequent Report are a wellbore diagram showing plugs that were set and casing remaining in the hole, the job summaries from all plugging contractors used, including wireline and cementing (third party verification) and any logs that may have been run during abandonment.

OGCC Operator Number: 100322 Contact Name: GARRETT REDDIN  
 Name of Operator: NOBLE ENERGY INC Phone: (970) 304-5409  
 Address: 1625 BROADWAY STE 2200 Fax: \_\_\_\_\_  
 City: DENVER State: CO Zip: 80202 Email: GARRETT.REDDIN@NBLENERGY.COM

**For "Intent" 24 hour notice required,** Name: Peterson, Tom Tel: (303) 815-9641  
**COGCC contact:** Email: tom.peterson@state.co.us

API Number 05-123-17625-00  
 Well Name: BACKUS Well Number: 4-16  
 Location: QtrQtr: SESE Section: 4 Township: 4N Range: 65W Meridian: 6  
 County: WELD Federal, Indian or State Lease Number: 63781  
 Field Name: WATTENBERG Field Number: 90750

Notice of Intent to Abandon       Subsequent Report of Abandonment

*Only Complete the Following Background Information for Intent to Abandon*

Latitude: 40.336230 Longitude: -104.660730  
 GPS Data:  
 Date of Measurement: 07/25/2006 PDOP Reading: 2.6 GPS Instrument Operator's Name: Paul Tappy  
 Reason for Abandonment:  Dry  Production Sub-economic  Mechanical Problems  
 Other \_\_\_\_\_  
 Casing to be pulled:  Yes  No Estimated Depth: \_\_\_\_\_  
 Fish in Hole:  Yes  No If yes, explain details below  
 Wellbore has Uncemented Casing leaks:  Yes  No If yes, explain details below  
 Details: 3 JOINTS OF TUBING COULD BE IN THE HOLE (6557') AS OF 3/12/2013

**Current and Previously Abandoned Zones**

Formation	Perf. Top	Perf. Btm	Abandoned Date	Method of Isolation	Plug Depth
CODELL	7104	7118			
NIOBRARA	6786	6922			
Total: 2 zone(s)					

**Casing History**

Casing Type	Size of Hole	Size of Casing	Weight Per Foot	Setting Depth	Sacks Cement	Cement Bot	Cement Top	Status
SURF	12+1/4	8+5/8	23	518	500	518	11	VISU
1ST	7+7/8	3+1/2	7.7	7,335	206	7,335	6,356	CBL
S.C. 1.1				4,584	200	4,584	4,072	CBL
S.C. 1.2				4,062	55	4,062	3,860	CBL
S.C. 2.1				3,056	100	3,056	2,000	CBL

### Plugging Procedure for Intent and Subsequent Report

CIBP #1: Depth 6552 with 2 sacks cmt on top. CIPB #2: Depth \_\_\_\_\_ with \_\_\_\_\_ sacks cmt on top.  
 CIBP #3: Depth \_\_\_\_\_ with \_\_\_\_\_ sacks cmt on top. CIPB #4: Depth \_\_\_\_\_ with \_\_\_\_\_ sacks cmt on top.  
 CIBP #5: Depth \_\_\_\_\_ with \_\_\_\_\_ sacks cmt on top.

NOTE: Two(2) sacks cement required on all CIBPs.

Set 25 sks cmt from 4500 ft. to 4000 ft. Plug Type: CASING Plug Tagged:   
 Set 10 sks cmt from 2500 ft. to 2000 ft. Plug Type: CASING Plug Tagged:   
 Set \_\_\_\_\_ sks cmt from \_\_\_\_\_ ft. to \_\_\_\_\_ ft. Plug Type: \_\_\_\_\_ Plug Tagged:   
 Set \_\_\_\_\_ sks cmt from \_\_\_\_\_ ft. to \_\_\_\_\_ ft. Plug Type: \_\_\_\_\_ Plug Tagged:   
 Set \_\_\_\_\_ sks cmt from \_\_\_\_\_ ft. to \_\_\_\_\_ ft. Plug Type: \_\_\_\_\_ Plug Tagged:

Perforate and squeeze at \_\_\_\_\_ ft. with \_\_\_\_\_ sacks. Leave at least 100 ft. in casing \_\_\_\_\_ CICR Depth  
 Perforate and squeeze at \_\_\_\_\_ ft. with \_\_\_\_\_ sacks. Leave at least 100 ft. in casing \_\_\_\_\_ CICR Depth  
 Perforate and squeeze at \_\_\_\_\_ ft. with \_\_\_\_\_ sacks. Leave at least 100 ft. in casing \_\_\_\_\_ CICR Depth  
 (Cast Iron Cement Retainer Depth)

Set 618 sacks half in. half out surface casing from 235 ft. to 0 ft. Plug Tagged:   
 Set \_\_\_\_\_ sacks at surface  
 Cut four feet below ground level, weld on plate Above Ground Dry-Hole Marker:  Yes  No  
 Set \_\_\_\_\_ sacks in rat hole Set \_\_\_\_\_ sacks in mouse hole

### Additional Plugging Information for Subsequent Report Only

Casing Recovered: \_\_\_\_\_ ft. of \_\_\_\_\_ inch casing Plugging Date: \_\_\_\_\_  
 \*Wireline Contractor: \_\_\_\_\_ \*Cementing Contractor: \_\_\_\_\_  
 Type of Cement and Additives Used: \_\_\_\_\_  
 Flowline/Pipeline has been abandoned per Rule 1103  Yes  No \*ATTACH JOB SUMMARY

Technical Detail/Comments:

HALLIBURTON ENGINEER: TANNER BOYD 432-803-6064  
 PERFORATE @ 618', PUMP 203 SX OUT AND 30 SX IN. BRING CMT TO SURFACE

I hereby certify all statements made in this form are, to the best of my knowledge, true, correct, and complete.

Signed: \_\_\_\_\_ Print Name: ANGELA FIORE  
 Title: ENGINEERING TECHNICIAN Date: \_\_\_\_\_ Email: ANGELA.FIORE@NBLENERGY.COM

Based on the information provided herein, this Well Abandonment Report (Form 6) complies with COGCC Rules and applicable orders and is hereby approved.

COGCC Approved: \_\_\_\_\_ Date: \_\_\_\_\_

CONDITIONS OF APPROVAL, IF ANY: \_\_\_\_\_ Expiration Date: \_\_\_\_\_

<u>COA Type</u>	<u>Description</u>

**Attachment Check List**

<u>Att Doc Num</u>	<u>Name</u>
401021083	WELLBORE DIAGRAM
401021084	PROPOSED PLUGGING PROCEDURE
401021086	WELLBORE DIAGRAM

Total Attach: 3 Files

**General Comments**

<u>User Group</u>	<u>Comment</u>	<u>Comment Date</u>

Total: 0 comment(s)