

WORKOVER PROCEDURE

WELL NAME: ROTHE STATE B36-15 **DATE:** 4/20/2016

LOCATION:

Qtr/Qtr: SW/SE Section: 36 Township: 5N Range: 64W
Footages: 593 FSL & 1991 FEL

COUNTY: WELD **STATE:** CO **API #:** 05-123-19216

ENGINEER: Jon Lefor 7 Day Notice Sent: _____
(Please notify Engineer of any major Do not start operations until: _____
changes prior to work) Notice Expires: _____

OBJECTIVE: P&A

WELL DATA: Surface Csg: 8 5/8 24# @ 360' KB Elevation: 4597'
Surface Cmt: 300 SX GL Elevation: 4587'
Long St Csg: 3 1/2 7.7# M-75 @ 6812' TD: 6812'
Long St Cmt: 145 SX PBTD: 6669'
Long St Date: 10/25/1996

Plug Back (Sand or CIBP): _____
Perforation Interval (1): Niobrara Perforations 6555' - 6562'
Perforation Interval (2): Codell Perforations 6637' - 6648'
Perforation Interval (3): _____
Perforation Interval (4): _____
Tubing: 2 1/16" 3.25# J-55 @ 6607' Rods: _____
Pump: _____
Misc.: _____

PRODUCTION STATUS: _____
COMMENTS: _____

PROCEDURE:

- 1) MIRU Workover rig, pump & tank.
- 2) POOH w/ 2 1/16" tbg and lay down.
- 3) RU WL. RIH w/ CIBP. Set CIBP @ 6505', dump bail 2 sx of cement on top.
- 4) Unland casing. Cut casing off @ 2500'. POOH w/ casing laying down on trailer.
- 5) RIH w/ workstring to pump 100 sx stub plug where csg was pulled. If maintain circulation, no need to tag plug.
- 6) POOH w/ workstring to 475'. Pump 200 sx shoe plug. Cement to surface.
- 7) SI, WOC. RIH. Tag shoe plug. Add cement if needed.
- 8) Cut surface casing off 6'-8' below ground.
- 9) Clean up location. Reclaim location. RDMO.