

FORM  
6Rev  
12/05

# State of Colorado Oil and Gas Conservation Commission

1120 Lincoln Street, Suite 801, Denver, Colorado 80203 Phone: (303) 894-2100 Fax: (303) 894-2109



DE	ET	OE	ES
----	----	----	----

Document Number:

401047026

Date Received:

## WELL ABANDONMENT REPORT

This form is to be submitted as an Intent to Abandon whenever an abandonment is planned on a borehole. After the abandonment is complete, this form shall again be submitted as a Subsequent Report of the actual work completed. The approved intent shall be valid for six months after the approval date, after that period, a new intent will be required.

Attachments required with the Intent to Abandon are wellbore diagrams of the current configuration and the proposed configuration with plugs set.

A Subsequent Report of Abandonment shall indicate the actual work completed. Attachments required with a Subsequent Report are a wellbore diagram showing plugs that were set and casing remaining in the hole, the job summaries from all plugging contractors used, including wireline and cementing (third party verification) and any logs that may have been run during abandonment.

OGCC Operator Number: 69175

Contact Name: Jenifer Hakkarinen

Name of Operator: PDC ENERGY INC

Phone: (303) 8605800

Address: 1775 SHERMAN STREET - STE 3000

Fax:

City: DENVER State: CO Zip: 80203

Email: Jenifer.Hakkarinen@pdce.com

**For "Intent" 24 hour notice required,**

Name: Peterson, Tom

Tel: (303) 815-9641

**COGCC contact:**

Email: tom.peterson@state.co.us

API Number 05-123-21965-00

Well Name: STATE CORSAIR

Well Number: 23-36

Location: QtrQtr: NESW Section: 36 Township: 4N Range: 68W Meridian: 6

County: WELD

Federal, Indian or State Lease Number:

Field Name: WATTENBERG

Field Number: 90750

☒ Notice of Intent to Abandon☐ Subsequent Report of Abandonment

### Only Complete the Following Background Information for Intent to Abandon

Latitude: 40.268810

Longitude: -104.953670

GPS Data:

Date of Measurement: 09/26/2006

PDOP Reading: 2.2

GPS Instrument Operator's Name: Holly L. Tracy

Reason for Abandonment:

☐ Dry☒ Production Sub-economic☐ Mechanical Problems☐ Other

Casing to be pulled:

☒ Yes☐ No

Estimated Depth: 600

Fish in Hole:

☐ Yes☒ No

If yes, explain details below

Wellbore has Uncemented Casing leaks:

☐ Yes☒ No

If yes, explain details below

Details:

### Current and Previously Abandoned Zones

Formation	Perf. Top	Perf. Btm	Abandoned Date	Method of Isolation	Plug Depth
CODELL	7336	7344			

Total: 1 zone(s)

### Casing History

Casing Type	Size of Hole	Size of Casing	Weight Per Foot	Setting Depth	Sacks Cement	Cement Bot	Cement Top	Status
SURF	12+1/4	8+5/8	24	400	225	400	0	VISU
1ST	7+7/8	4+1/2	10.5	7,535	190	7,535	6,380	CBL

## Plugging Procedure for Intent and Subsequent Report

CIBP #1: Depth 7300 with 2 sacks cmt on top. CIBP #2: Depth 7000 with 2 sacks cmt on top.  
CIBP #3: Depth \_\_\_\_\_ with \_\_\_\_\_ sacks cmt on top. CIBP #4: Depth \_\_\_\_\_ with \_\_\_\_\_ sacks cmt on top.  
CIBP #5: Depth \_\_\_\_\_ with \_\_\_\_\_ sacks cmt on top.

NOTE: Two(2) sacks cement required on all CIBPs.

Set \_\_\_\_\_ sks cmt from \_\_\_\_\_ ft. to \_\_\_\_\_ ft. Plug Type: \_\_\_\_\_ Plug Tagged: ☐  
Set \_\_\_\_\_ sks cmt from \_\_\_\_\_ ft. to \_\_\_\_\_ ft. Plug Type: \_\_\_\_\_ Plug Tagged: ☐  
Set \_\_\_\_\_ sks cmt from \_\_\_\_\_ ft. to \_\_\_\_\_ ft. Plug Type: \_\_\_\_\_ Plug Tagged: ☐  
Set \_\_\_\_\_ sks cmt from \_\_\_\_\_ ft. to \_\_\_\_\_ ft. Plug Type: \_\_\_\_\_ Plug Tagged: ☐  
Set \_\_\_\_\_ sks cmt from \_\_\_\_\_ ft. to \_\_\_\_\_ ft. Plug Type: \_\_\_\_\_ Plug Tagged: ☐

Perforate and squeeze at \_\_\_\_\_ ft. with \_\_\_\_\_ sacks. Leave at least 100 ft. in casing \_\_\_\_\_ CICR Depth

Perforate and squeeze at \_\_\_\_\_ ft. with \_\_\_\_\_ sacks. Leave at least 100 ft. in casing \_\_\_\_\_ CICR Depth

Perforate and squeeze at \_\_\_\_\_ ft. with \_\_\_\_\_ sacks. Leave at least 100 ft. in casing \_\_\_\_\_ CICR Depth

(Cast Iron Cement Retainer Depth)

Set 230 sacks half in. half out surface casing from 700 ft. to 0 ft. Plug Tagged: ☐

Set \_\_\_\_\_ sacks at surface

Cut four feet below ground level, weld on plate Above Ground Dry-Hole Marker: ☐ Yes ☐ No

Set \_\_\_\_\_ sacks in rat hole Set \_\_\_\_\_ sacks in mouse hole

### Additional Plugging Information for Subsequent Report Only

Casing Recovered: \_\_\_\_\_ ft. of \_\_\_\_\_ inch casing Plugging Date: \_\_\_\_\_

\*Wireline Contractor: \_\_\_\_\_ \*Cementing Contractor: \_\_\_\_\_

Type of Cement and Additives Used: \_\_\_\_\_

Flowline/Pipeline has been abandoned per Rule 1103 ☐ Yes ☐ No \*ATTACH JOB SUMMARY

Technical Detail/Comments:

State Corsair #23-36 (05-123-21965)/Plugging Procedure (Intent)

Producing formation: Codell

Existing Perforations: Codell - 7,336'-7,344'

TD: 7,560' PBD: 7,521'

Surface Casing: 8 5/8" 24# @ 400' w/ 225 sks cmt.

Production Casing: 4 1/2" 10.5# @ 7,535' w/ 190 sks cmt (TOC at 6,380').

Proposed Procedure:

1. MIRU pulling unit.
2. Blow down to tanks. Load with fluid to kill well.
3. Circulate and condition well for P&A ops.
4. TOOH with 235 jts of 2 3/8" production tubing.
5. Rig up wireline. RIH with CIBP. Set CIBP at 7,300'.
6. Load dump bailer with 2sx of 15.8#/gal CI G cement. RIH with dump bailer and spot on top of CIBP.
7. RIH with CIBP. Set CIBP at 7,000'.
8. Load dump bailer with 2sx of 15.8#/gal CI G cement. RIH with dump bailer and spot on top of CIBP.
9. RIH w/ casing cutter and cut production casing above TOC at 600'. Pull 4 1/2" casing out of hole.
10. TIH with workstring to 700'. Circulate and condition to prepare for surface plug.
11. RU cementers. Mix and pump cement stub plug to surface (700') with 230 sks of 15.8#/gal CL G cement. Confirm cement to surface.
12. Cut surface casing 6' below ground level and weld on cap.

I hereby certify all statements made in this form are, to the best of my knowledge, true, correct, and complete.

Signed: \_\_\_\_\_ Print Name: Jenifer Hakkarinen

Title: Reg Tech Date: \_\_\_\_\_ Email: Jenifer.Hakkarinen@pdce.com

Based on the information provided herein, this Well Abandonment Report (Form 6) complies with COGCC Rules and applicable orders and is hereby approved.

COGCC Approved: \_\_\_\_\_

Date: \_\_\_\_\_

**CONDITIONS OF APPROVAL, IF ANY:** \_\_\_\_\_

Expiration Date: \_\_\_\_\_

**COA Type**

**Description**

--	--

**Attachment Check List**

**Att Doc Num**

**Name**

401047036	WELLBORE DIAGRAM
401047037	WELLBORE DIAGRAM

Total Attach: 2 Files

**General Comments**

**User Group**

**Comment**

**Comment Date**

--	--	--

Total: 0 comment(s)