

FORM  
6Rev  
12/05State of Colorado  
Oil and Gas Conservation Commission

1120 Lincoln Street, Suite 801, Denver, Colorado 80203 Phone: (303) 894-2100 Fax: (303) 894-2109



DE ET OE ES

Document Number:

401057196

Date Received:

06/02/2016

## WELL ABANDONMENT REPORT

This form is to be submitted as an Intent to Abandon whenever an abandonment is planned on a borehole. After the abandonment is complete, this form shall again be submitted as a Subsequent Report of the actual work completed. The approved intent shall be valid for six months after the approval date, after that period, a new intent will be required. Attachments required with the Intent to Abandon are wellbore diagrams of the current configuration and the proposed configuration with plugs set.

A Subsequent Report of Abandonment shall indicate the actual work completed. Attachments required with a Subsequent Report are a wellbore diagram showing plugs that were set and casing remaining in the hole, the job summaries from all plugging contractors used, including wireline and cementing (third party verification) and any logs that may have been run during abandonment.

OGCC Operator Number: 100322

Contact Name: AJ PAINE

Name of Operator: NOBLE ENERGY INC

Phone: (720) 587-2374

Address: 1625 BROADWAY STE 2200

Fax:

City: DENVER State: CO Zip: 80202

Email: AJ.PAINE@NBLENERGY.COM

For "Intent" 24 hour notice required,

Name: Peterson, Tom

Tel: (303) 815-9641

COGCC contact:

Email: tom.peterson@state.co.us

API Number 05-123-21031-00

Well Name: CERVI

Well Number: 42-27

Location: QtrQtr: SENE Section: 27 Township: 4N Range: 63W Meridian: 6

County: WELD

Federal, Indian or State Lease Number:

Field Name: WATTENBERG

Field Number: 90750

☒ Notice of Intent to Abandon☐ Subsequent Report of Abandonment

## Only Complete the Following Background Information for Intent to Abandon

Latitude: 40.285240

Longitude: -104.416768

GPS Data:

Date of Measurement: 04/12/2007

PDOP Reading: 1.8

GPS Instrument Operator's Name: Paul Tappy

Reason for Abandonment: ☐ Dry ☐ Production Sub-economic ☐ Mechanical Problems☒ Other LANDOWNER SENSITIVITYCasing to be pulled: ☒ Yes ☐ No Estimated Depth: 2500Fish in Hole: ☐ Yes ☒ No If yes, explain details belowWellbore has Uncemented Casing leaks: ☐ Yes ☒ No If yes, explain details below

Details:

## Current and Previously Abandoned Zones

Formation	Perf. Top	Perf. Btm	Abandoned Date	Method of Isolation	Plug Depth
CODELL	6686	6695			
J SAND	7144	7158			
NIOBRARA	6492	6566			

Total: 3 zone(s)

## Casing History

Casing Type	Size of Hole	Size of Casing	Weight Per Foot	Setting Depth	Sacks Cement	Cement Bot	Cement Top	Status
SURF	12+1/4	8+5/8	24	534	378	534	0	VISU
1ST	7+7/8	4+1/2	11.6	7,281	180	7,281	6,132	CBL

## Plugging Procedure for Intent and Subsequent Report

CIBP #1: Depth 7050 with 2 sacks cmt on top. CIBP #2: Depth 6442 with 2 sacks cmt on top.  
CIBP #3: Depth \_\_\_\_\_ with \_\_\_\_\_ sacks cmt on top. CIBP #4: Depth \_\_\_\_\_ with \_\_\_\_\_ sacks cmt on top.  
CIBP #5: Depth \_\_\_\_\_ with \_\_\_\_\_ sacks cmt on top.

NOTE: Two(2) sacks cement required on all CIBPs.

Set 100 sks cmt from 2500 ft. to 2300 ft. Plug Type: STUB PLUG Plug Tagged: ☐  
Set \_\_\_\_\_ sks cmt from \_\_\_\_\_ ft. to \_\_\_\_\_ ft. Plug Type: \_\_\_\_\_ Plug Tagged: ☐  
Set \_\_\_\_\_ sks cmt from \_\_\_\_\_ ft. to \_\_\_\_\_ ft. Plug Type: \_\_\_\_\_ Plug Tagged: ☐  
Set \_\_\_\_\_ sks cmt from \_\_\_\_\_ ft. to \_\_\_\_\_ ft. Plug Type: \_\_\_\_\_ Plug Tagged: ☐  
Set \_\_\_\_\_ sks cmt from \_\_\_\_\_ ft. to \_\_\_\_\_ ft. Plug Type: \_\_\_\_\_ Plug Tagged: ☐

Perforate and squeeze at \_\_\_\_\_ ft. with \_\_\_\_\_ sacks. Leave at least 100 ft. in casing \_\_\_\_\_ CICR Depth

Perforate and squeeze at \_\_\_\_\_ ft. with \_\_\_\_\_ sacks. Leave at least 100 ft. in casing \_\_\_\_\_ CICR Depth

Perforate and squeeze at \_\_\_\_\_ ft. with \_\_\_\_\_ sacks. Leave at least 100 ft. in casing \_\_\_\_\_ CICR Depth

(Cast Iron Cement Retainer Depth)

Set 220 sacks half in. half out surface casing from 634 ft. to 0 ft. Plug Tagged: ☒

Set \_\_\_\_\_ sacks at surface

Cut four feet below ground level, weld on plate Above Ground Dry-Hole Marker: ☐ Yes ☐ No

Set \_\_\_\_\_ sacks in rat hole Set \_\_\_\_\_ sacks in mouse hole

### Additional Plugging Information for Subsequent Report Only

Casing Recovered: \_\_\_\_\_ ft. of \_\_\_\_\_ inch casing Plugging Date: \_\_\_\_\_

\*Wireline Contractor: \_\_\_\_\_ \*Cementing Contractor: \_\_\_\_\_

Type of Cement and Additives Used: \_\_\_\_\_

Flowline/Pipeline has been abandoned per Rule 1103 ☐ Yes ☐ No \*ATTACH JOB SUMMARY

Technical Detail/Comments:

I hereby certify all statements made in this form are, to the best of my knowledge, true, correct, and complete.

Signed: \_\_\_\_\_ Print Name: MARILYN TUCKER

Title: ENG TECH Date: 6/2/2016 Email: MARILYN.TUCKER@NBLENERGY.COM

Based on the information provided herein, this Well Abandonment Report (Form 6) complies with COGCC Rules and applicable orders and is hereby approved.

COGCC Approved: JENKINS, STEVE Date: 6/13/2016

**CONDITIONS OF APPROVAL, IF ANY:** \_\_\_\_\_

Expiration Date: 12/12/2016

<b>COA Type</b>	<b>Description</b>
	<p>Note changes to plugging procedure:</p> <p>1) Provide 48 hour notice of plugging MIRU via electronic Form 42.</p> <p>2) For the 634' plug: pump plug and displace. If surface casing plug is not circulated to surface then tag plug – must be at 484' or shallower and provide 10 sx plug at the surface. Leave at least 100' of cement in the casing for each plug.</p> <p>3) Properly abandon flowlines as per Rule 1103. File electronic Form 42 once abandonment complete.</p> <p>4) Submit CBL run prior to plugging operations with the Susequent Form 6.</p> <p>5) Prior to initiation of plugging operations, a Bradenhead test shall be performed. If any pressure remains at the conclusion of the test or any liquids were present call COGCC Engineer for sampling requirements. Form 17 shall be submitted within 10 days.</p>

### **Attachment Check List**

<b>Att Doc Num</b>	<b>Name</b>
401057196	FORM 6 INTENT SUBMITTED
401057218	PROPOSED PLUGGING PROCEDURE
401057221	WELLBORE DIAGRAM
401057222	WELLBORE DIAGRAM

Total Attach: 4 Files

### **General Comments**

<b>User Group</b>	<b>Comment</b>	<b>Comment Date</b>
Public Room	Document verification complete 06/06/16	3/9/2016 4:06:15 PM

Total: 1 comment(s)