

US ROCKIES REGION
Operation Summary Report

Well: DREYER #2				Spud date: 3/12/1993					
Project: COLORADO-ADAMS-NAD83-UTM13				Site: DREYER #2				Rig name no.: BASIC 1549/1549	
Event: ABANDONMENT				Start date: 7/7/2016			End date:		
Active datum: RKB @5,065.99usft (above Mean Sea Level)				UWI: 0/1/S/65/W/5/0/SWNE/6/0/0/0/0/0/0/0					
Date	Time Start-End	Duration (hr)	Phase	Code	Sub Code	P/U	MD from (usft)	Operation	
6/28/2016	-								
7/6/2016	-								
	11:00 - 15:00	4.00	ABANDP	35	A	P		MIRU CORETECH WL. RU LUBRICATOR AND RIH TO FISH TOOLS. FISH PLUNER @ 7908' GL. FISH FLOATER @ 7909' GL. TAG FILL @ 7970' GL. RU VES. RUN GYRO FROM 7400' TO SURFACE. RD VES. RDMO CORETECH WL.	
7/7/2016	8:30 - 9:30	1.00	ABANDP	33	1	P		NOTIFY PROD FOREMAN/FIELD COORDINATOR, MIRU FLARE EQUIP/PULL AUTOMATION	
	9:30 - 9:34	0.08	ABANDP	52	I	P		TP400/CP400/SP0, PUT GAUGE IN SFC VALVE, SFC REMAINED DEAD THROUGHOUT JOB	
	9:35 - 11:30	1.92	ABANDP	33	F	P		BLOW DOWN CSG THROUGH FLARE TO 80#, PUMPED 55 BBLs WATER W/BIO DOWN CSG WHILE FLARING TBG TO 80#, CSG WENT ON VAC @ 2 BBLs AWAY, PUMPED 25 BBLs DOWN TBG, WENT ON VAC @ 1 BBL AWAY, 10.7 MCF'S BURNED	
	11:30 - 12:00	0.50	ABANDP	33	1	P		SWI, RDMO FLARE EQUIP	
	14:15 - 15:00	0.75	ABANDP	30	G	P		CREW TRAVEL FROM CHAMPLIN 78 AMOCO D 1 TO LOCATION.	
	15:00 - 15:15	0.25	ABANDP	48	B			SAFETY MEETING/JSA RIG CREW - TALK THROUGH THE DAYS OPERATIONS. TALK ABOUT THE WARM WEATHER AND TO MAKE SURE AND STAY HYDRATED. USE GOOD COMMUNICATION AND HAND SIGNALS WHEN MOVING EQUIPMENT OUT OF LOCATION. USE WINCH LINE WHEN HANDLING TOOLS UP TO THE RIG FLOOR. KEEP EYES ON WHEN TRANSFERING FLUID AND BREAKING LINES. TALKED THROUGH OUR EMERGENCY RESPONSE PROTOCOL.	
	15:15 - 17:15	2.00	ABANDP	30	A	P		MIRU BASIC 1549.	
	17:15 - 18:00	0.75	ABANDP	30	G	P		CREW TRAVEL FROM LOCATION	
7/8/2016	6:00 - 6:45	0.75	ABANDP	30	G	P		CREW TRAVEL TO LOCATION	
	6:45 - 7:00	0.25	ABANDP	48	B			SAFETY MEETING/JSA RIG CREW - TALK THROUGH THE DAYS OPERATIONS. TALK ABOUT THE WARM WEATHER AND TO MAKE SURE AND STAY HYDRATED. USE GOOD COMMUNICATION AND HAND SIGNALS WHEN MOVING EQUIPMENT OUT OF LOCATION. USE WINCH LINE WHEN HANDLING TOOLS UP TO THE RIG FLOOR. KEEP EYES ON WHEN TRANSFERING FLUID AND BREAKING LINES. TALKED THROUGH OUR EMERGENCY RESPONSE PROTOCOL. WATCH FOR PINCH PIONTS WHEN TRIPPING PIPE AND MAKE SURE AND KEEP HANDS CLEAR OF ANY HAZARDS.	
	7:00 - 7:00	0.00	ABANDP	52	I	P		BRADENHEAD PRESSURE @ 0 PSI - NO FLUID. LEAVE OPEN ALL DAY. SI AT THE END OF THE DAY.	
	7:00 - 8:30	1.50	ABANDP	31	I	P		CP: 40 PSI, TBG: 30 PSI, SC: 0 PSI. UNLAND 2-3/8" TBG FROM THE WELLHEAD AND TOOH W/ 253 JTS.	
	8:30 - 12:00	3.50	ABANDP	31	I	P		PU AND TIH W/ 4-1/2" CSG SCRAPER W/ 253 JTS OF 2-3/8" TBG DOWN TO 7916'. TOOH SB ALL TBG.	

US ROCKIES REGION
Operation Summary Report

Well: DREYER #2

Spud date: 3/12/1993

Project: COLORADO-ADAMS-NAD83-UTM13

Site: DREYER #2

Rig name no.: BASIC 1549/1549

Event: ABANDONMENT

Start date: 7/7/2016

End date:

Active datum: RKB @5,065.99usft (above Mean Sea Level)

UWI: 0/1/S/65/W/5/0/SWNE/6/0/0/0/0/0/0/0

Date	Time Start-End	Duration (hr)	Phase	Code	Sub Code	P/U	MD from (usft)	Operation
7/11/2016	12:00 - 13:30	1.50	ABANDP	34	I	P		MIRU RELIANCE WL. PU AND RIH W/ 4-1/2" CIBP DOWN TO 7890'. SET CIBP @ 7890'. PU AND THEN RIH TO TAG CIBP. CONFIRM CIBP IS SET AND TOOH. LD WL TOOLS. RDMO RELIANCE WL.
	13:30 - 15:00	1.50	ABANDP	31	I	P		TIH W/ 252 JTS OF 2-3/8" TBG DOWN TO 7884' OPEN ENDED.
	15:00 - 16:00	1.00	ABANDP	31	H	P		LOAD HOLE W/ 70 BBLs OF BIOCIDES TREATED FRESH WATER AND CIRCULATE ALL GAS AND WELL FLUIDS OUT OF THE WELL.
	16:00 - 17:15	1.25	ABANDP	31	I	P		TOOH AND SB 226 JTS OF 2-3/8" TBG AND LD THE REMAINDER. SWI. SDFN.
	17:15 - 18:00	0.75	ABANDP	30	G	P		CREW TRAVEL FROM LOCATION.
	6:00 - 6:45	0.75	ABANDP	30	G	P		CREW TRAVEL TO LOCATION
	6:45 - 7:00	0.25	ABANDP	48	B			SAFETY MEETING/JSA RIG CREW - TALK THROUGH THE DAYS OPERATIONS. TALK ABOUT THE WARM WEATHER AND TO MAKE SURE AND STAY HYDRATED. USE GOOD COMMUNICATION AND HAND SIGNALS WHEN MOVING EQUIPMENT OUT OF LOCATION. USE WINCH LINE WHEN HANDLING TOOLS UP TO THE RIG FLOOR. KEEP EYES ON WHEN TRANSFERING FLUID AND BREAKING LINES. TALKED THROUGH OUR EMERGENCY RESPONSE PROTOCOL. WATCH FOR PINCH POINTS WHEN TRIPPING PIPE AND MAKE SURE AND KEEP HANDS CLEAR OF ANY HAZARDS.
	7:00 - 7:00	0.00	ABANDP	52	I	P		BRADENHEAD PRESSURE @ 0 PSI - NO FLUID. LEAVE OPEN ALL DAY. SI AT THE END OF THE DAY.
	7:00 - 10:15	3.25	ABANDP	41	A	P		MIRU RELIANCE WL. HOLD JSA AND TALK THROUGH THE DAYS OPERATIONS. PU LOGGING TOOLS AND RUN CBL FROM 7880' TO SURFACE. TOC @ 6695'. CMT FROM 1520'- 55'. NO CHANGE OF PLANS DUE TO CMT COVERAGE. LD LOGGING TOOLS. PU DUMP BAILER AND RIH. DUMP BAIL 2 sx OF CMT ON TOP OF CIBP @ 7890'. TOOH AND LD BAILER. RDMO RELIANCE WL.
	10:15 - 10:30	0.25	ABANDP	52	F	P		PT CIBP TO 1000 PSI FOR 15 MINUTES. NO BLEED OFF. GOOD TEST.
	10:30 - 13:30	3.00	ABANDP	31	I	P		MIRU HOLE SEEKERS. HYDROTEST 226 JTS OF 2-3/8" TBG TO 6000 PSI DOWN TO 7074'. ALL JTS TESTED. RDMO HYDROTESTERS.
	13:30 - 14:30	1.00	ABANDP	31	H	P		RU KELLY HOSE AND CIRCULATION EQUIPMENT. CIRCULATE THE WELL CLEAN AT 200 PSI AND 2 BBL/MIN.
	14:30 - 16:00	1.50	ABANDP	51	D	P		WOC. SLB ABT TRUCK BROKE DOWN AND CAUSED 1.5 HRS OF NPT.

US ROCKIES REGION
Operation Summary Report

Well: DREYER #2		Spud date: 3/12/1993	
Project: COLORADO-ADAMS-NAD83-UTM13	Site: DREYER #2		Rig name no.: BASIC 1549/1549
Event: ABANDONMENT	Start date: 7/7/2016		End date:
Active datum: RKB @5,065.99usft (above Mean Sea Level)		UWI: 0/1/S/65/W/5/0/SWNE/6/0/0/0/0/0/0/0	

Date	Time Start-End	Duration (hr)	Phase	Code	Sub Code	P/U	MD from (usft)	Operation
	16:00 - 17:30	1.50	ABANDP	51	D	P		MIRU SLB CEMENTING. HOLD JSA AND TALK THROUGH THE DAYS OPERATIONS. SET MAX PRESSURE AT 2000 PSI. PRESSURE TEST LINES TO 2500 PSI FOR THREE MINUTES. PUMP 40 sx (11BBLs) 15.8 PPG 1.55 YLD CLASS G CMT AT AVERAGE OF 200 PSI AND 2.2 BBLs/MIN. DISPLACE W/ 23.4 BBLs OF FRESH WATER. GOOD CIRCULATION THROUGHOUT JOB. GOT APPROVAL FROM DIANA BURN TO NOT TAG THIS PLUG IF CIRCULATION WAS MAINTAINED. PLUG ESTIMATED FROM 7074' - 6364'. WASH UP PUMP TRUCK THROUGH RETURN LINES TO THE MUD TANK. RDMO SLB CEMENTING.
	17:30 - 19:15	1.75	ABANDP	31	I	P		TOOH, SB 73 STANDS (146 JTS) AND LD 80 JTS OF 2-3/8" TBG. SWI. SDFN.
	19:15 - 20:00	0.75	ABANDP	30	G	P		CREW TRAVEL FROM LOCATION.
7/12/2016	6:00 - 6:45	0.75	ABANDP	30	G	P		CREW TRAVEL TO LOCATION
	6:45 - 7:00	0.25	ABANDP	48	B			SAFETY MEETING/JSA RIG CREW - TALK THROUGH THE DAYS OPERATIONS. TALK ABOUT THE WARM WEATHER AND TO MAKE SURE AND STAY HYDRATED. USE GOOD COMMUNICATION AND HAND SIGNALS WHEN MOVING EQUIPMENT OUT OF LOCATION. USE WINCH LINE WHEN HANDLING TOOLS UP TO THE RIG FLOOR. KEEP EYES ON WHEN TRANSFERRING FLUID AND BREAKING LINES. TALKED THROUGH OUR EMERGENCY RESPONSE PROTOCOL. WATCH FOR PINCH POINTS WHEN TRIPPING PIPE AND MAKE SURE AND KEEP HANDS CLEAR OF ANY HAZARDS.
	7:00 - 7:00	0.00	ABANDP	52	I	P		BRADENHEAD PRESSURE @ 0 PSI - NO FLUID. LEAVE OPEN ALL DAY. SI AT THE END OF THE DAY.
	7:00 - 8:00	1.00	ABANDP	34	H	P		MIRU RELIANCE WL. HOLD JSA AND TALK THROUGH THE DAYS OPERATIONS. PU AND RIH W/ TWO 3-1/8" PERF GUNS W/ 3 SPF, 0.7" EHD, 120" PHASING. SHOOT 2' OF HOLES @ 4778' AND 4' OF HOLES @ 4570'. TOOH AND CONFIRM ALL SHOTS FIRED. RDMO RELIANCE WL.
	8:00 - 9:00	1.00	ABANDP	31	I	P		PU 4-1/2", 11.6# CICR AND TIH W/ 147 JTS OF 2-3/8" TBG DOWN TO 4604'. SET CICR.
	9:00 - 11:00	2.00	ABANDP	31	H	P		RU KELLY HOSE AND CIRCULATION EQUIPMENT. CIRCLUTE 250 BBLs OF BIO FRESH WATER AT 600 PSI AND 2.2 BBL/MIN. GOOD CIRCULATION THROUGHOUT.

US ROCKIES REGION
Operation Summary Report

Well: DREYER #2

Spud date: 3/12/1993

Project: COLORADO-ADAMS-NAD83-UTM13

Site: DREYER #2

Rig name no.: BASIC 1549/1549

Event: ABANDONMENT

Start date: 7/7/2016

End date:

Active datum: RKB @5,065.99usft (above Mean Sea Level)

UWI: 0/1/S/65/W/5/0/SWNE/6/0/0/0/0/0/0/0

Date	Time Start-End	Duration (hr)	Phase	Code	Sub Code	P/U	MD from (usft)	Operation
	11:00 - 13:00	2.00	ABANDP	51	A	P		MIRU SLB CEMENTING. HOLD JSA AND TALK THROUGH THE DAYS OPERATIONS. SET MAX PRESSURE AT 1500 PSI. PRESSURE TEST LINES TO 1500 FOR ONE MINUTE AND 2500 PSI FOR THREE MINUTES. PUMP 140 sx (29.5 BBLS) 15.8 PPG 1.18 YLD CLASS G CMT AT AVERAGE OF 200 PSI AND 2.0 BBLS/MIN. DISPLACE W/ 15.5 BBLS OF FRESH WATER. STING OUT OF CICR AND LEAVE 3 BBLS ON TOP. GOOD CIRCULATION THROUGHOUT JOB. WASH UP PUMP TRUCK THROUGH RETURN LINES TO THE MUD TANK.
	13:00 - 14:45	1.75	ABANDP	31	I	P		TOOH. SB 24 STANDS (48JTS) AND LD 99 JTS OF 2-3/8" TBG AND CICR STINGER. TIH W/ 48 JTS OF 2-3/8" TBG. EOT @ 1506'.
	14:45 - 15:45	1.00	ABANDP	51	D	P		RU CMT PUMPING EQUIPMENT AND PUMP 88.5sx (18.3 BBLS) 15.8 PPG 1.16 YLD CLASS G CMT AT AVERAGE OF 200 PSI AND 2.2 BBLS/MIN. DISPLACE W/ 1 BBL OF FRESH WATER. GOOD CIRCULATION THROUGHOUT JOB.
	15:45 - 16:45	1.00	ABANDP	31	I	P		PUH, LD 35 JTS OF 2-3/8" TBG. EOT @ 409'. RU KELLY HOSE AND CIRCULATION EQUIPMENT. USE SLB PUMPS TO WASH UP AND CIRCULATE THE CASING CLEAN W/ 30 BBLS OF FRESH WATER. RDMO SLB CEMENTING. TOOH AND LD ALL TBG. SWI. SDFN.
	16:45 - 17:30	0.75	ABANDP	30	G	P		CREW TRAVEL FROM LOCATION.
7/13/2016	6:00 - 6:45	0.75	ABANDP	30	G	P		CREW TRAVEL TO LOCATION
	6:45 - 7:00	0.25	ABANDP	48	B			SAFETY MEETING/JSA RIG CREW - TALK THROUGH THE DAYS OPERATIONS. TALK ABOUT THE WARM WEATHER AND TO MAKE SURE AND STAY HYDRATED. USE GOOD COMMUNICATION AND HAND SIGNALS WHEN MOVING EQUIPMENT OUT OF LOCATION. USE WINCH LINE WHEN HANDLING TOOLS UP TO THE RIG FLOOR. KEEP EYES ON WHEN TRANSFERING FLUID AND BREAKING LINES. TALKED THROUGH OUR EMERGENCY RESPONSE PROTOCOL. WATCH FOR PINCH PIONTS WHEN TRIPPING PIPE AND MAKE SURE AND KEEP HANDS CLEAR OF ANY HAZARDS. STAY AWAY FROM PUMP TRUCK AND IRON WHEN PUMPING CMT.
	7:00 - 7:00	0.00	ABANDP	52	I	P		BRADENHEAD PRESSURE @ 0 PSI - NO FLUID. LEAVE OPEN ALL DAY. SI AT THE END OF THE DAY.
	7:00 - 7:15	0.25	ABANDP	31	I	P		TIH W/ 14 JTS OF 2-3/8" AND TAG CMT AT 415'. PUH AND LD JT 14. EOT @ 409' W/ 13 JTS.
	7:15 - 8:00	0.75	ABANDP	51	D	P		MIRU SLB CEMENTING. HOLD JSA AND TALK THROUGH THE DAYS OPERATIONS. SET MAX PRESSURE AT 1500 PSI. PRESSURE TEST LINES TO 1900 PSI FOR THREE MINUTES. PUMP 38 sx (8 BBLS) 15.8 PPG 1.17 YLD CLASS G CMT AT AVERAGE OF 200 PSI AND 2.3 BBLS/MIN. DISPLACE W/ 0.5 BBLS OF FRESH WATER. CIRCULATE CMT TO SURFACE. GOOD CIRCULATION THROUGHOUT JOB.

US ROCKIES REGION
Operation Summary Report

Well: DREYER #2				Spud date: 3/12/1993					
Project: COLORADO-ADAMS-NAD83-UTM13			Site: DREYER #2				Rig name no.: BASIC 1549/1549		
Event: ABANDONMENT			Start date: 7/7/2016				End date:		
Active datum: RKB @5,065.99usft (above Mean Sea Level)			UWI: 0/1/S/65/W/5/0/SWNE/6/0/0/0/0/0/0/0						
Date	Time Start-End	Duration (hr)	Phase	Code	Sub Code	P/U	MD from (usft)	Operation	
	8:00 - 8:30	0.50	ABANDP	31	I	P		PUH. LD 12 JTS OF 2-3/8" TBG. RU SLB CMT HOSE AND WASH UP CMT TRUCK AND CLEAN UP BOPS AND WH W/ 1 JT IN THE HOLE. LD FINAL JT AND RDMO SLB.	
	8:30 - 12:00	3.50	ABANDP	30	C	P		ND RIG FLOOR, ND BOPS. BREAK ALL LINES. SCOPE DOWN RIG. RDMO BASIC 1549 AND TRAVEL TO DREYER 1.	
8/3/2016	8:00 - 9:00	1.00	ABANDP	53	B	P		dug up surface casing	
	9:00 - 10:00	1.00	ABANDP	53	C	P		cut casings 6' below GL. Tagged @ 19' in 4-1/2, 10' in 8-5/8	
	10:00 - 11:00	1.00	ABANDP	53	B	P		filled 4-1/2 with 3 bags, 8-5/8 with 5 bags 5000 psi cement	
	11:00 - 12:00	1.00	ABANDP	53	A	P		capped casing with a metal plate containing well info	
	12:00 - 13:00	1.00	ABANDP	53	B	P		backfilled	