

PLUG and ABANDONMENT PROCEDURE

EVAN P 2-14

Step	Description of Work
------	---------------------

- | | |
|-----|--|
| 1. | Provide 48 hour notice to COGCC prior to rig up per request on approved Form 6 (e.g. call field coordinator, submit Form 42, etc.). Notify Automation Removal Group at least 24 hours prior to rig move. Request they catch and remove plunger, isolate production equipment, and remove any automation prior to rig MIRU. |
| 2. | MIRU Slickline. Pull production equipment and tag bottom. Record tag depth in Open Wells. RD slickline. |
| 3. | Prepare location for base beam equipped rig. Install perimeter fence as needed. |
| 4. | Verify COAs before RU. |
| 5. | Upon RU, check and record bradenhead pressure. If bradenhead valve is not accessible, re-plumb so that valve is above GL. Blow down bradenhead and re-check pressure the next day. Repeat until pressure stays at 0 psi. |
| 6. | MIRU WO rig. Spot a min of 25 jts of 2-3/8" 4.7# J-55, EXTERNAL-UPS tbgs. Kill well as necessary using clean fresh water with biocide. ND WH. NU BOP. Unland tbgs using unlanding joint and LD. |
| 7. | TOOH and SB 7110' 2-3/8" tbgs. LD Remainder. |
| 8. | MIRU WL. PU and RIH with (4.5", 11.6#) gauge ring to 7120'. POOH. |
| 9. | PU and RIH with (4.5", 11.6#) CIBP and set at +/- 7110' (collars at 7102' & 7144') to abandon the Nio formation / Codell perfs. POOH. RD WL. |
| 10. | TIH with 2-3/8" tbgs while hydrotesting to 3000 psi to 7110'. Circulate all gas from well. PT CIBP to 1000 psi for 15 minutes. |
| 11. | <u>RU cementers</u> . Pump Niobrara Balance Plug: Pump 40 sxs (62 cf) 15.8 ppg & 1.55 cf/sk. Volume based on 680' inside 4-1/2" production casing. Cement will be from 7110' – 6430'. RD cementers. |
| 12. | Slowly pull out of the cement and PUH to 5930'. Reverse circulate tubing clean to ensure no cement is left in the tubing. TOOH and SB 3890' of 2-3/8" tubing. LD Remaining. |
| 13. | RU WL. PU and RIH with two 3-1/8" perf guns with 3 spf, min 0.5" EHD, 120° phasing. Shoot 2' of squeeze holes at 4270' and 4' of squeeze holes at 3860'. RD WL. |
| 14. | PU and RIH with (4.5" 11.6#) CICR on 2-3/8" tbgs. Set CICR at 3890'. |
| 15. | Establish circulation to surface with biocide treated fresh water, and pump 100 bbls to clean up hole. |
| 16. | <u>RU Cementers</u> . Pump Sussex Squeeze: Pump 10 bbls sodium silicate and 5 bbls fresh water followed 185 sx (234 cf) with 0.25 lb/sk polyflake 15.8 ppg & 1.17 cf/sk. Underdisplace by 3 bbls. Volume is based on 380' below the CICR inside 4-1/2" production casing with no excess, 410' in the 4-1/2" annulus assuming 7-7/8" bit size with 60% excess and 185' on top of the CICR to cover top perfs. RD cementers. |
| 17. | Slowly pull out of the cement and TOOH to 3205'. Reverse circulate to ensure no cement is left in the tbgs. |
| 18. | TOOH and SB 980' 2-3/8" tbgs, LD CICR stinger and remaining tbgs. |
| 19. | RU WL. RIH and cut 4-1/2" casing at 880'. RD WL. |
| 20. | Circulate with 50 bbls fresh water containing biocide to remove any gas. |

PLUG and ABANDONMENT PROCEDURE

EVAN P 2-14

21. Un-land casing using a casing spear, not a lifting sub. Max pull shall be 100,000#. If unable to unland, contact Engineering.
22. ND BOP. ND TH. Install BOP on casing head with 4-1/2" pipe rams.
23. TOO H and LD all 4-1/2" casing. Remove 4-1/2" pipe rams and install 2-3/8" pipe rams.
24. TIH with mule shoe 2-3/8" tubing to 980'.
25. Establish circulation with biocide treated fresh water and pump one hole volume (70 bbls). Pump 10 bbls (min) SAPP, followed by 5 bbls fresh water spacer.
26. RU Cementers. Pump Stub Plug: 225 sxs (261 cf) with 0.25 lb/sk Polyflake, 15.8 ppg & 1.16 cf/sk (100' in 4-1/2" production casing with no excess, 311' in 7-7/8" bit size w/ 60% excess factor, and 200' in 8-5/8" surface casing with no excess). The plug will cover 980' – 369' RD cementers.
27. Slowly pull out of the cement and TOO H to 100'. Reverse Circulate using biocide treated fresh water, to ensure the tubing is clean. TOO H, LD all 2.375" tbg.
28. WOC per cement company recommendation. TIH and tag cement. Cement top needs to be at or above 519' (50' above the surface casing shoe at 569'). Call Engineering if tag is lower than 486'. PU and TOO H.
29. RU WL. RIH 8-5/8" 24# CIBP to 80'. RDMO WL and WO rig.
30. Instruct cementing and wireline contractors to e-mail copies of all job logs/job summaries to rscDJVendors@anadarko.com within 24 hours of completion of the job.
31. Supervisor submit paper copies of all invoices, logs, and reports to Evans Engineering Specialist.
32. Excavation crew to notify One Call to clear excavation area around wellhead and for flow lines.
33. Capping crew will set and secure night cap on 8 5/8" casing head, restrain the casing head, pressure test CIBP to 500 psi with hydrotest pump, then remove night cap and casing head restraints.
34. Excavate hole around surface casing enough to allow welder to cut casing a minimum 5' below ground level.
35. Welder cut casing minimum 5' below ground level.
36. Fill casing to surface using 4500 psi compressive strength cement (NO gravel).
37. Spot weld on steel marker plate. Marker should contain Well name, Well number, legal location (1/4 1/4 descriptor) and API number.
38. Obtain GPS location data as per COGCC Rule 215 and send to rscDJVendors@anadarko.com.
39. Properly abandon flow lines per Rule 1103. File electronic Form 42 once abandonment is complete.
40. Back fill hole with fill. Clean location, and level.
41. Submit Form 6 to COGCC ensuring to provide 'As performed' WBD identifying operations completed.