

**FORM
INSP**Rev
X/15**State of Colorado
Oil and Gas Conservation Commission**1120 Lincoln Street, Suite 801, Denver, Colorado 80203
Phone: (303) 894-2100 Fax: (303) 894-2109

Inspection Date:

10/21/2016

Submitted Date:

10/24/2016

Document Number:

682501434**FIELD INSPECTION FORM**
 Loc ID 442964 Inspector Name: Trujillo, Aaron On-Site Inspection ☐ 2A Doc Num: _____
Status Summary:

- ☐ THIS IS A FOLLOW UP INSPECTION
- ☐ FOLLOW UP INSPECTION REQUIRED
- ☐ NO FOLLOW UP INSPECTION REQUIRED

Operator Information:OGCC Operator Number: 35080Name of Operator: GRAND MESA OPERATING COAddress: 1700 N. WATERFRONT PKWY BL 600City: WICHITA State: KS Zip: 67206**Findings:**4 Number of Comments0 Number of Corrective Actions☐ Corrective Action Response Requested**Contact Information:**

Contact Name	Phone	Email	Comment
Brewer, Phyllis	(316) 265-3000	pbrewer@gmocks.com	

Inspected Facilities:

Facility ID	Type	Status	Status Date	Well Class	API Num	Facility Name	Insp Status
442963	WELL	XX	08/23/2015	LO	121-11053	Buzzs Boat 14	CI

General Comment:

This is a pre-drill construction and stormwater inspection. Any corrective actions from previous inspections that have not been addressed are still applicable.

Location ConstructionLocation ID: 442964

Lease Road Adeq.: _____ Pads: _____ Soil Stockpile: _____ CDP: _____

Comment: _____

Corrective Action: _____ Date: _____

Form 2A COAs:**Comment:** _____Corrective Action: _____ **Date:** _____**Wildlife BMPs:****Comment:** _____Corrective Action: _____ **Date:** _____**Stormwater:**

Erosion BMPs	Present	Other BMPs	Present
SLOPE ROUGHENING	Yes		

Comments: Erosion BMPs: Surface roughening

Other BMPs: _____

Corrective Action: _____ Date: _____

BERMS	Yes	
Comments: Erosion BMPs: <input type="text"/>		
Other BMPs: <input type="text"/>		
Corrective Action: <input type="text"/>		Date: <input type="text"/>

Comment: Surface roughening incorporated around entire perimeter of location, and parallel to the area of where the access road will be constructed. Berm constructed on the western and northern perimeter of the location and have been adequately tracked. Topography of the location slopes down to the northwest. Eastern portion of the location is relatively flat. BMPs implemented appear to be site specific and sufficient. Continue to maintain BMPs and adjust as needed.

Corrective Action: **Date:**

On Site Inspection (305):Surface Owner Contact Information:

Name: Address:
Phone Number: Cell Phone:

Operator Rep. Contact Information:

Landman Name: Phone Number:
Date Onsite Request Received: Date of Rule 306 Consultation:
Request LGD Attendance:

LGD Contact Information:

Name: Phone Number: Agreed to Attend:

Summary of Landowner Issues:Summary of Operator Response to Landowner Issues:Onsite Inspection Memorandum Summarizing Discussions at Inspection as Attachment:

Inspected FacilitiesFacility ID: 442963 Type: WELL API Number: 121-11053 Status: XX Insp. Status: CI**COGCC Comments**

Comment	User	Date
Ephemeral wetland (playa) feature to the NW of the location.	trujilloam	10/24/2016

Attached DocumentsYou can go to COGCC Images (<https://cogcc.state.co.us/weblink/>) and search by document number:

Document Num	Description	URL
682501435	Inspection Photos	http://ogccweblink.state.co.us/DownloadDocumentPDF.aspx?DocumentId=3982959