

**FORM
INSP**Rev
X/15**State of Colorado
Oil and Gas Conservation Commission**1120 Lincoln Street, Suite 801, Denver, Colorado 80203
Phone: (303) 894-2100 Fax: (303) 894-2109

Inspection Date:

10/27/2016

Submitted Date:

10/31/2016

Document Number:

685301665**FIELD INSPECTION FORM**
 Loc ID 313552 Inspector Name: St John, William (Cal) On-Site Inspection ☐ 2A Doc Num: _____
Operator Information:OGCC Operator Number: 10343Name of Operator: QEP ENERGY COMPANYAddress: 1050 17TH STREET - SUITE 800City: DENVER State: CO Zip: 80265**Status Summary:**☐ THIS IS A FOLLOW UP INSPECTION☒ FOLLOW UP INSPECTION REQUIRED☐ NO FOLLOW UP INSPECTION REQUIRED**Findings:**17 Number of Comments5 Number of Corrective Actions☒ Corrective Action Response Requested**Contact Information:**

Contact Name	Phone	Email	Comment
Labowskie, Steve		steve.labowskie@state.co.us	COGCC
Tomkinson, Stephanie	435-781-4308	stephanie.tomkinson@qepres.com	All SW Inspections
Maez, Leonard	(970) 564-1699/ (806) 435-0529	leonard.maez@qepres.com	Production Foreman (Cortez)
Abrams, Laura	303-260-6745	laura.abrams@qepres.com	All SW Inspections

Inspected Facilities:

Facility ID	Type	Status	Status Date	Well Class	API Num	Facility Name	Insp Status
224458	WELL	TA	12/27/2013	SI	083-06523	CUTTHROAT 7	TA

General Comment:

Inspection report contains corrective actions and comments. See Good Housekeeping, Facility, and Stormwater Sections of report for additional details. See link at end of report for path to downloadable pictures.

Location				
Lease Road:				
Type	Access			
comment:	Requires maintenance.			
Corrective Action	L			Date:
Overall Good: <input type="checkbox"/>				
Signs/Marker:				
Type	WELLHEAD			
Comment:				
Corrective Action:				Date:
Emergency Contact Number:				
Comment:				
Corrective Action:				Date: _____
Good Housekeeping:				
Type	UNUSED EQUIPMENT			
Comment:	Metal spool of shielded wire left on location.			
Corrective Action:	Remove spool of wire to comply with Rule 603.f using the Rule 603.f guidance document for further details.			Date: 12/30/2016
Type	WEEDS			
Comment:	Well is TA and with lack of production related activity the location is re-vegetating with weeds, sage, and grass.			
Corrective Action:	Clean-up production area to comply with Rule 603.f using the Rule 603.f guidance document for further details.			Date: 11/10/2016
Type	UNUSED EQUIPMENT			
Comment:	Disconnected pipe sections and fittings left on location.			
Corrective Action:	Remove pipe and fittings to comply with Rule 603.f using the Rule 603.f guidance document.			Date: 11/30/2016
Type	OTHER			
Comment:	Stained soil at wellhead.			
Corrective Action:	Clean up stained soil to comply with Rule 906.a.			Date: 11/30/2016
Overall Good: <input type="checkbox"/>				
Spills:				
Type	Area	Volume		
In Containment: No				
Comment:				
<input type="checkbox"/> Multiple Spills and Releases?				
Equipment:				
Type: Other	# 1			corrective date
Comment:	Metal Equipment Building			
Corrective Action:				Date:
Type: Horizontal Heated Separator	# 1			
Comment:				

Corrective Action:		Date:	
Type: Other	# 1		
Comment:	Heat Exchanger		
Corrective Action:		Date:	
Type: Ancillary equipment	# 1		
Comment:	Electrical generator with natural gas motor.		
Corrective Action:		Date:	
Type: Ancillary equipment	# 1		
Comment:	Electrical service Equipment		
Corrective Action:		Date:	
Type: Bird Protectors	# 1		
Comment:			
Corrective Action:		Date:	
Type: Ancillary equipment	# 1		
Comment:	Wellhead		
Corrective Action:		Date:	
Type: Deadman # & Marked	# 4		
Comment:			
Corrective Action:		Date:	

Venting:

Yes/No	NO		
Comment:			
Corrective Action:		Date:	

Flaring:

Type		
Comment:		
Corrective Action:		Date:

Inspected Facilities

Facility ID: 224458 Type: WELL API Number: 083-06523 Status: TA Insp. Status: TA

Idle Well

Purpose: ☐ Shut In ☒ Temporarily Abandoned Reminder: _____

Comment: Successful MIT completed 2/15/2012. MIT will be due 2/17.

Corrective Action: _____ Date: _____

Reclamation - Storm Water - Pit**Storm Water:**

Loc Erosion BMPs	BMP Maintenance	Lease Road Erosion BMPs	Lease BMP Maintenance	Chemical BMPs	Chemical BMP Maintenance	Comment
Berms	Fail			Material Handling And Spill Prevention	Fail	
Ditches	Fail	Ditches	Fail			
Compaction	Fail	Compaction	Fail			

Comment: SE corner berm has washed out allowing stormwater and sediment to run off location. NE corner cut slope has erosion channels allowing stormwater and sediment to run onto location creating silt deposit on location. SW side of location entrance has erosion channel cutting and eroding ditch. Two 55 gallon drums containing fluid with no spill prevention. Lease road is rough and washed out with erosion channels. Ditches are no longer functioning allowing stormwater and silt to flow onto road from surrounding hillside further deteriorating road condition.

Corrective Action: Install or repair required BMPs to comply with Rule 1002.f. Refer to the 1002.f guidance document for further details.

Date: 11/30/2016

Pits: ☒ NO SURFACE INDICATION OF PIT

Attached Documents

You can go to COGCC Images (<https://cogcc.state.co.us/weblink/>) and search by document number:

Document Num	Description	URL
685301665	INSPECTION SUBMITTED	http://ogccweblink.state.co.us/DownloadDocumentPDF.aspx?DocumentId=3988804
685301690	SE corner berm failure	http://ogccweblink.state.co.us/DownloadDocumentPDF.aspx?DocumentId=3988784
685301691	Spool of wire	http://ogccweblink.state.co.us/DownloadDocumentPDF.aspx?DocumentId=3988785
685301693	Stained soil at wellhead	http://ogccweblink.state.co.us/DownloadDocumentPDF.aspx?DocumentId=3988786
685301694	Pipe Sections	http://ogccweblink.state.co.us/DownloadDocumentPDF.aspx?DocumentId=3988787
685301695	Fittings	http://ogccweblink.state.co.us/DownloadDocumentPDF.aspx?DocumentId=3988788
685301696	55 Gallon drums	http://ogccweblink.state.co.us/DownloadDocumentPDF.aspx?DocumentId=3988789
685301697	Access Road 2	http://ogccweblink.state.co.us/DownloadDocumentPDF.aspx?DocumentId=3988790
685301698	Access Road 1	http://ogccweblink.state.co.us/DownloadDocumentPDF.aspx?DocumentId=3988791